



General Notes

1. This drawing is © copyright Hampshire County Council 2020. No unauthorised reproduction of any kind is permitted.

2. No dimensions to be scaled from this drawing. Verify all dimensions prior to construction. Immediately report any discrepancies on the document to the Architect/Contract Administrator. This document shall be read in conjunction with associated models, specifications and related consultant's documents.

3. Drawing to be read with all relevant Architectural, Interiors, Structural, M&E, Drainage/Public Health, Landscape, Civils and Interiors drawings and specifications.

4. This map is reproduced from Ordnance Survey material with the permission of Ordnance Survey on behalf of the controller of Her Majesty's Stationary Office © Crown copyright. Unauthorized reproduction infringes Crown Copyright & may lead to prosecution or civil proceedings (100019180) 2020.

Notes:

Scope of works (Roof).

Proposed conservation works to structure and fabric.

When high level access is available, invite the CA and structural engineer to undertake a roof condition survey, to include inspection of the roof covering, the gutter, the flashing, the condition of the parapet masonry and render finish inside and outside. Further high level access to the chimney is required to inspect the capping detail.

There are drone images of the roof covering. It is assumed that the lead sheet is in sound condition. However there is evidence of leaks to the gutter, which appears to be caused by vegetation and blockages. Allow for cleaning, the gutter and outlets through the parapet.

Chimney repairs.

4.2 Top section stabilise loose render.

4.3 Check whether chimney is capped.
If not cap with slate fixed over ventilated hit and miss masonry, to direct water through the battlements.

4.1 Green hatch indicates areas of high level internal damp masonry.
Drone photograprs indicate vegetation in parapet gutter.
Clear the gutter to the full perimeter and clear the 2 no. shoots through the parapet masonry..

2.1 Cracks above window arch in this location extends through the parapet.
Provide high level access for structural inspection.

2.1 Structural inspection.
2 no. 1m long Hilibar crack stitching.
Outer face set into brickwork above arch window.
Inner face set masonry parapet facing the roof

4.1 Green hatch indicates areas of high level internal damp masonry.
Drone photograprs indicate vegetation in parapet gutter.
Clear the gutter to the full perimeter and clear the 2 no. shoots through the parapet masonry.

4.1 Green hatch indicates areas of high level internal damp masonry.
Drone photograprs indicate vegetation in parapet gutter.
Clear the gutter to the full perimeter and clear the 2 no. shoots through the parapet masonry..

4.1 Green hatch indicates areas of high level internal damp masonry.
Drone photograprs indicate vegetation in parapet gutter.
Clear the gutter to the full perimeter and clear the 2 no. shoots through the parapet masonry.



Rev	Description	Date	By	Chkd
L1	A2 APPROVED FOR PLANNING STAGE	19/09/2024	SA	js

HCC Property Services,
Three Ministers House,
76 High Street, Winchester SO23 8UL
tel: (01962) 847801

PROJECT NAME
Staunton Farm, Gothic Library

SHEET NAME
GA Roof Plan
Condition Survey
And Scope of Works

SCALE
1:20 @ A1

DRAWN
SA

CHKD
js

APRV
XXX

DRAWING No.
project code - originator - volume - level - type - role - number

P13962-HCC-ZZ -115 ROOF

L1

00

SUITABILITY
code description

A2 APPROVED FOR PLANNING STAGE