


Before: Modern finishes to walls and ceilings with spine beam, side girt, cross beam, box frame visible.



Current (2018/19):

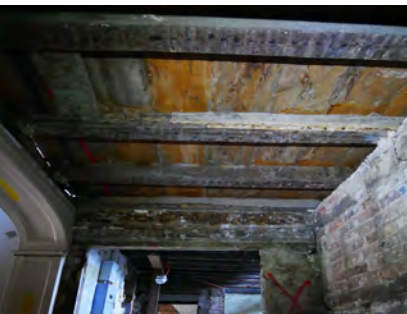

19. G6 - Inner hallway - baffle entry from west. The nib was added to narrow the doorway. A narrow timber has been added below the cross beam. Ceiling was intended to be concealed.



20. G7 - another former baffle entry. Blocked up and may have accommodated a stair/ladder to the first floor. This was used as an ensuite with tiled walls and floor and sanitary fittings.



21. As per the former state but walls exposed, former door revealed and modern ceiling covering removed revealing joists.



22. The central bay includes G9 and 10. There appears to have been doors on each side, that to west side altered, to the east blocked up. Evidence of fixed furniture to box frame. Wattle & daub was replaced with brick infill panels. Floor raised. Flags and floor boards are later finishes. Inner wall of G10 - side girt has racked and disengaged. Chamfers and run through stops to spine beam.



Notes:

Refer to Dwg MHB-02A & 05A and repairs indicated by The Green Oak Carpentry Co.



23. Used as an ensuite, tiled with wc & handbasin. Now removed & reveals past alterations to the brickwork, posts and an introduced steel RSJ. The Crossbeam above the door shows the original height of the room.



24. Disengaged side girt of the original 3-bay timber frame. Intruded into with formation of doors to G11 & G12 as well as west extension.

SHEET 6
Photographic Record / Inventory:
Ground Floor: G6, 7, 8, 9, 10

January 2020