

Before: Dining Room



Current (2018/19):




32. Inner face of south wall reveals a former door opening to G12 and a cambered arch to the door to G13. Bolts for new Floor to G11/12 noted.



33. Inner face of east wall is more rudimentary in construction with timber.



31. Inner north wall exposing brickwork to fireplace, higher arch to side indicating a possible doorway. Predominantly stretcher bond which could relate to the addition of the first cross wing. East and west walls are Flemish bond.

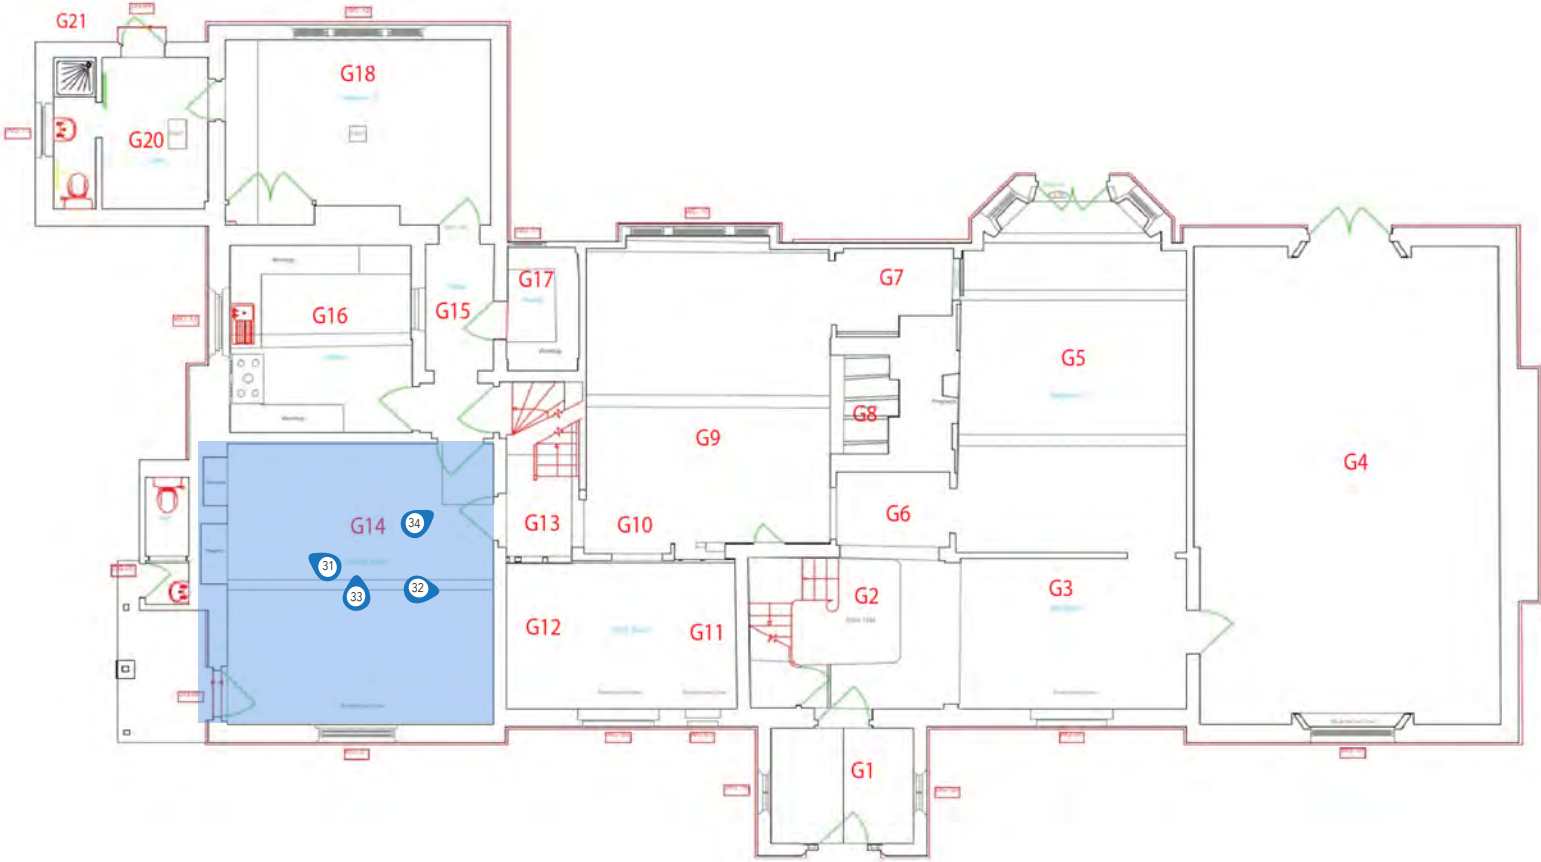

34. The bulkhead for the introduction staircase to the SW corner.

Notes:

Refer to Dwg MHB-02A for notes.
The general appearance of this room and given that this was a farmhouse, this room was more agricultural in its origins - a dairy, for example, which needed to be cool and well ventilated. It was invariably located to the north side with cool flagstone on the floor, whitewashed walls. Plenty of space was required as a dairy for butter and cheese making. (Jeremy, L (1989) 'Historic Farm Buildings').