

Before: No images available of this area. It was divided into two rooms with a small corridor and ensuite with access to the loft.

Current (2018/19):



68. Victorian southern cross-wing. The NE corner of room shows the original external southern wall of the three-bay building. The original end wallplate has been served losing the west side. Evidence of a former windows. Brick infills not maintained properly. Evidence of 2 stages of change to the roof.




69. View of southern end bay




70. FF6 north wall, built after FF5. The rafters are of the Victorian period and a late construction.




71. Truncated end wallplate for new opening. Infill panels would have had wattle and daub but have been replaced with brick.

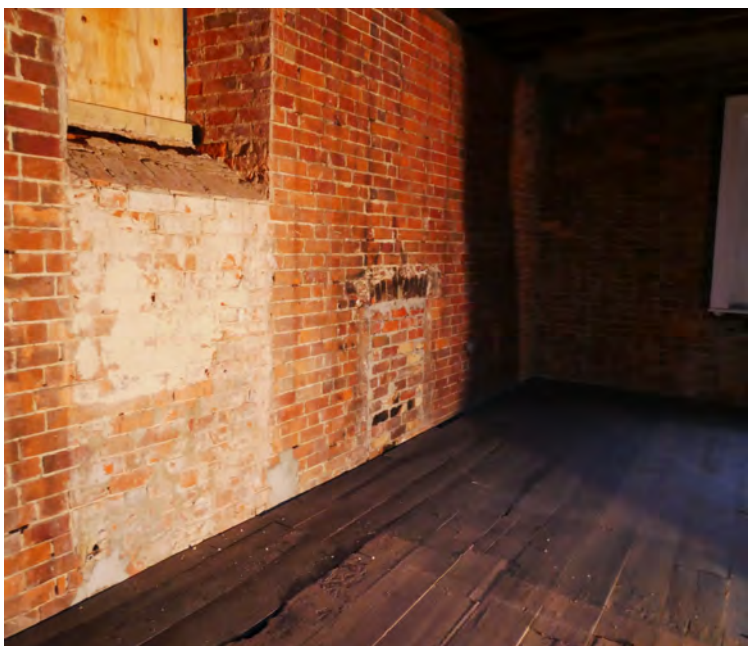

72. South wall with small window to east of former fireplace.

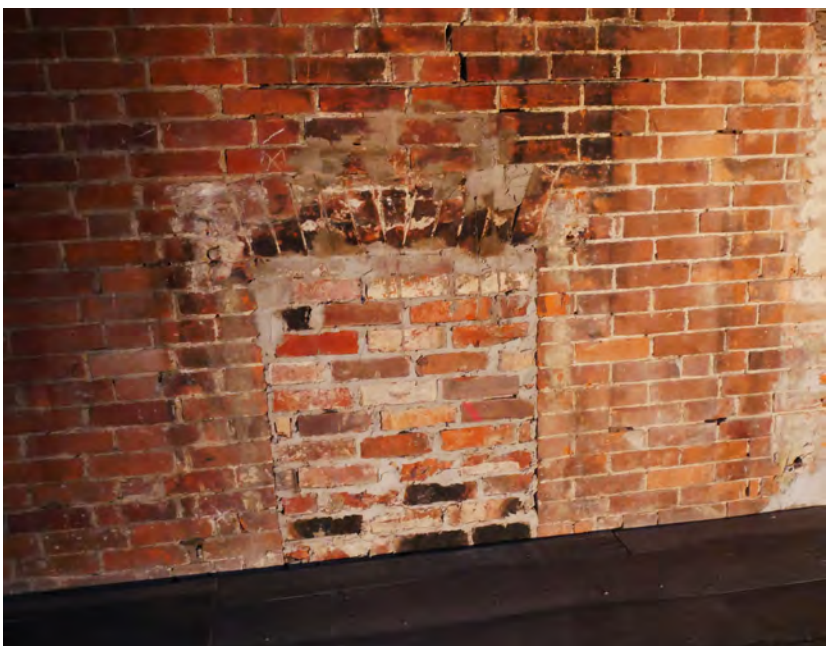

73. Cental fireplace indicates that this space was originally one room.

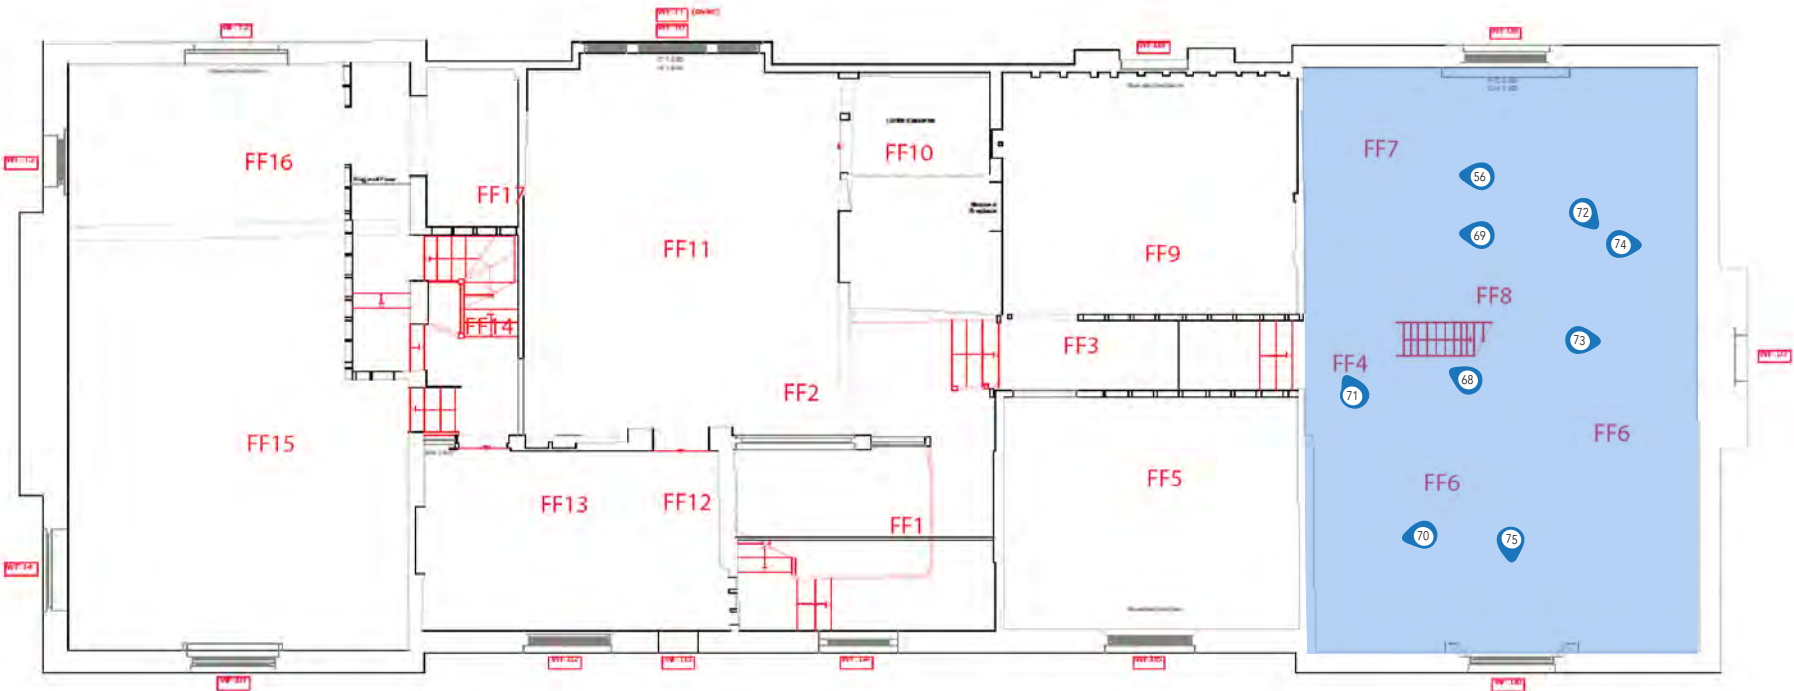

Notes:
Refer to Dwg MHB-03A, 05A for notes and O7A.
Reference should also be made to The Green Oak Carpentry Co details for repairs. FF5 pre-dates the insertion of hall / stair bay. Both FF5 and FF9 were altered during the time that the southern cross wing was added and including raising floor, ceiling.



74. Small window to south gable of Victorian cross-wing.



75. Original west facing window with shutters.