

Before: No image available

Current (2018/19):



25. SW corner of G11, previously a wc. This was an extension to the north of the main entrance and west of central bay. The floor was been lowered in the past, revealing the cambered arch to the basement. The ceiling had been lower, cutting across the main windows. Now raised. Evidence of a former bay window can be said, a door at half landing height and a later small window.



26. NW corner of G12. Previously partitioned off G11 as a utility room. Evidence of a former bay window clearly noted. Plaster had been applied direct to brickwork.



27. New floor inserted at higher level. Accepted that reversal would be harmful to historic fabric.




28.Edge of G13 Stair with post to door leading into G10. Evidence of wattle and daub to rear of wall of G9. The base post has eroded at the base requiring brick underbuilding.



29. Newel Post, baluster and spindels of staircase, late Victorian.



30. Ground to First Floor flight showing crossbeam, hidden rails.

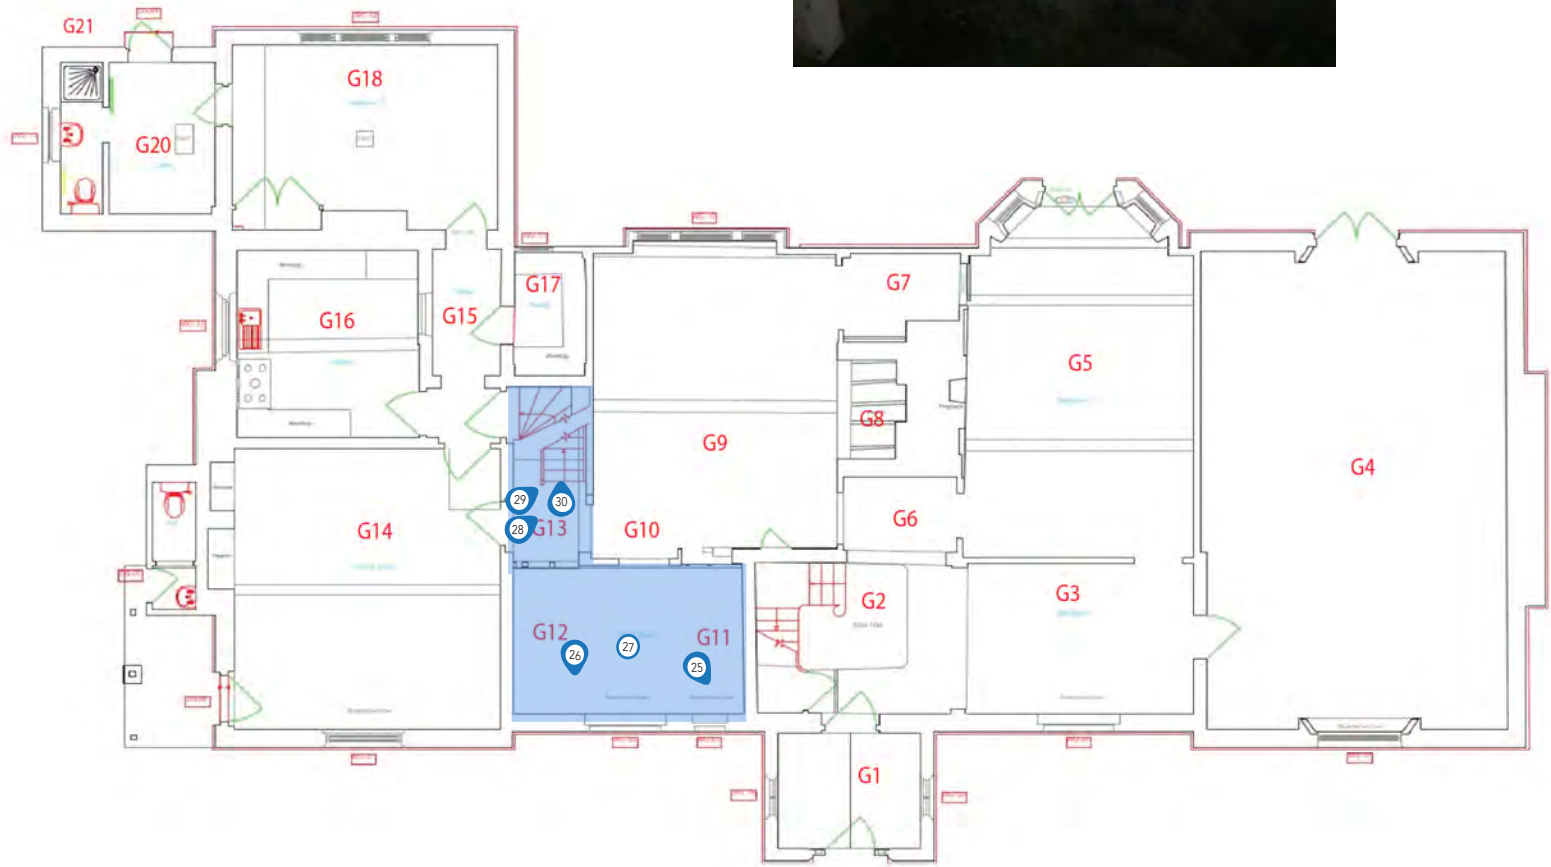

Notes:
Refer to Dwg MHB-02A and 5A for notes and The Green Oak Carpentry Co for repair details.