

Before: No images available of this area but FF9 was used as a bedroom with an ensuite wc and built -in wardrobe. FF5 was used as a bedroom and had a wash basin.

Current (2018/19):



61. View from FF3 stair. This hall serves FF5, FF9 and leads to the later Victorian cross wing with attic above. Height floor to ceiling has been raised to 'fit' with the Victorian alterations.



62. Valley between 2 roof above. Later partitions of each side.




63. FF5 NW - Evidence of bay window. Note the outer west wall plate has been raised. The two walls do not match which indicates different builds.



64. FF5 SW - Noteable mark/cambered brick lintel for a bay. Sth wall also shows signs of wall plate increase with later Victorian cross wing added. Evidence of old cement repairs.



65. Nrtth & East inner walls -the south end chamber bay of the 3-bay post medieval house. The floor is notably raised. Cross beam and wall plate with jowl post to corner. Blocked up fire-place. The ceiling height had also been raised. This was covered over.

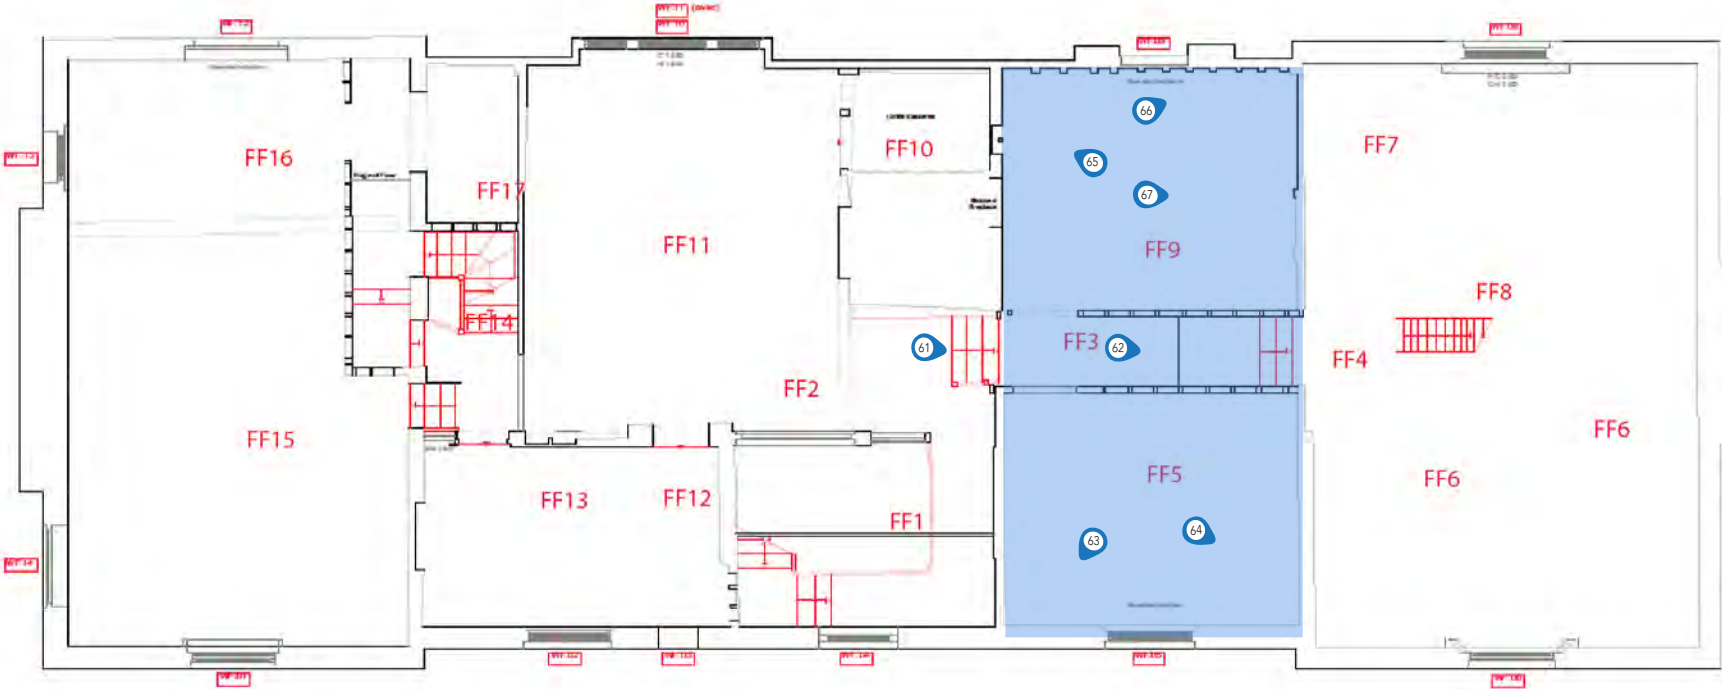

Notes:
Refer to Dwg MHB-03A, 05A for notes and O7A. Reference should also be made to The Green Oak Carpentry Co details for repairs. FF5 pre-dates the insertion of hall / stair bay. Both FF5 and FF9 were altered during the time that the southern cross wing was added and including raising floor, ceiling.



67. FF5 south. The joists of the 'new' floor can be clearly seen. End wall plate intact. Floor raised.



66. Raised wall. of a less substantial construction. Evidence of adaptations to roof incl. dormer introduced.