

Before: Partial view to First Floor



Note the presence of a chair lift and handrail to inner wall.

Current (2018/19):



47. View of FF1 stairs and landings. The chair lift has been removed. Bolts noted through inner face of north wall. Note spindles are metal as the staircase has been altered.



48. View up to underside of roof showing structure. The tie beam is pole stripped of bark, roughly shaped. The 'spine' is quite is lightweight and at the height of the former ceiling.




49. View of NW corner revealing parting of west face from inner north wall and raised height. Evidence of past cement repairs.



50. Similar view showing the blocked up door to FF12 and the cambered brick arch to former bay window. Again raised height evident.



51. South inner elevation - wall plate to central chamber of 3-bay timber framed building noted with two extended areas of brickwork suggesting two phases of change and raised ceiling heights corresponding with raised floor heights to southern rooms. Note the nature of the Queen Post roof to FF5. Note the roof to the south differs over FF12 /13

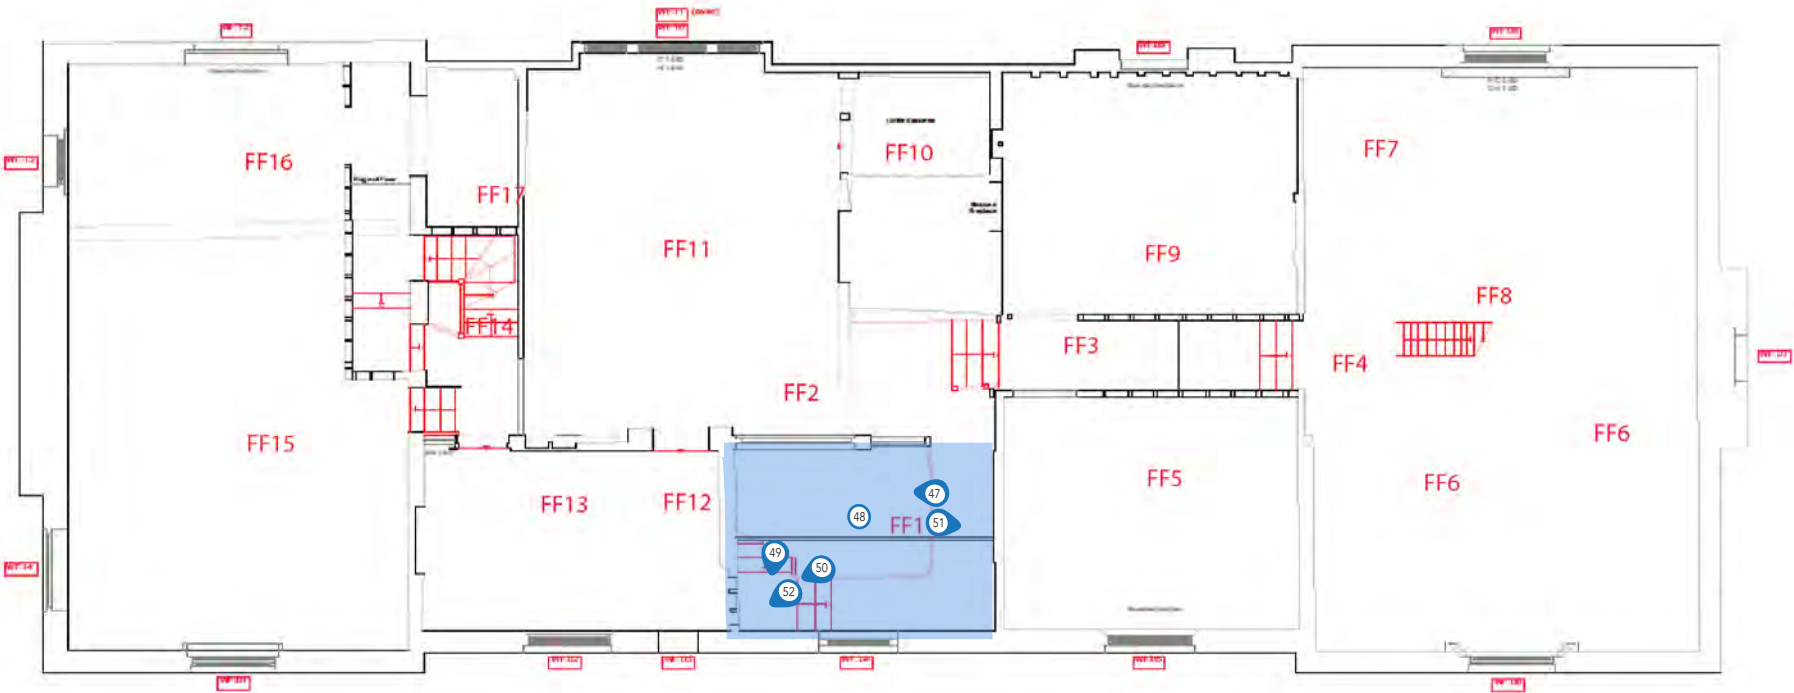

Notes:

Refer to Dwg MHB-03A, 05A for notes and O7A.
Reference should also be made to The Green Oak Carpentry Co details for repairs at FF1/FF2.
It is ascertained that the rooms FF5 and FF12/13 pre-dated the insertion of hall / stair bay. There is clear evidence of changes to floor levels and ceiling heights to the southern side of the building and with that changes to the roof to create parallel range adapting to forward gabled projecting to FF5 and FF12/13 which had bay windows rising from the ground floor.

See sheets for FF2 and FF11 for more details of this area.



52. Later interventions to roof over wall between FF1 & FF12