

Before: Kitchen (G16)



Current (2018/19):



35. G16 - Kitchen. Of a similar rudimentary construction as G14 and Victorian.




36. Inner south wall, single brick thick. Door and window to a former external passage.




37. G15 - Former external wall to G16. Single brick thick and rudimentary dairy/agricultural form of construction.




38. G15 - Looking toward G14. This is also part of the area where the lost north bay of the 3-bay timber-framed building existed.

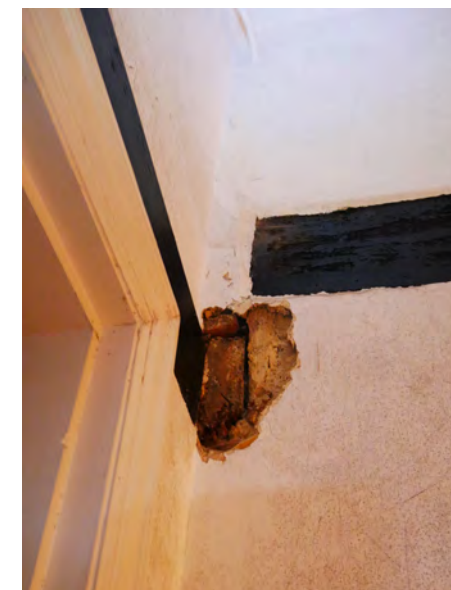

39. SE corner of G15 - evidence of side girt. The cross beam is likely to be reused from the dismantled frame.

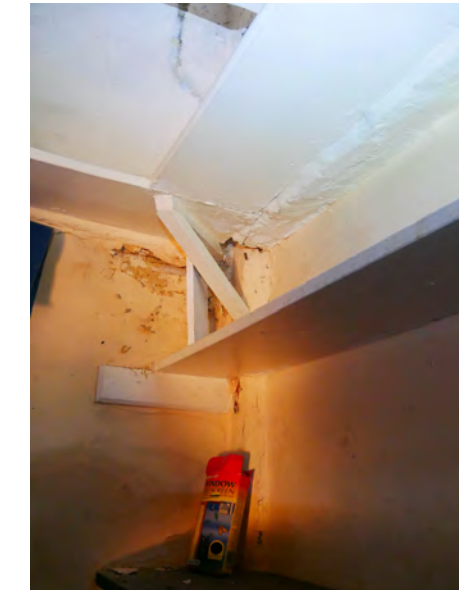

40. SE corner of G17, concealed jowl post, with cross beam evident. The side girt can be found above the top shelf.

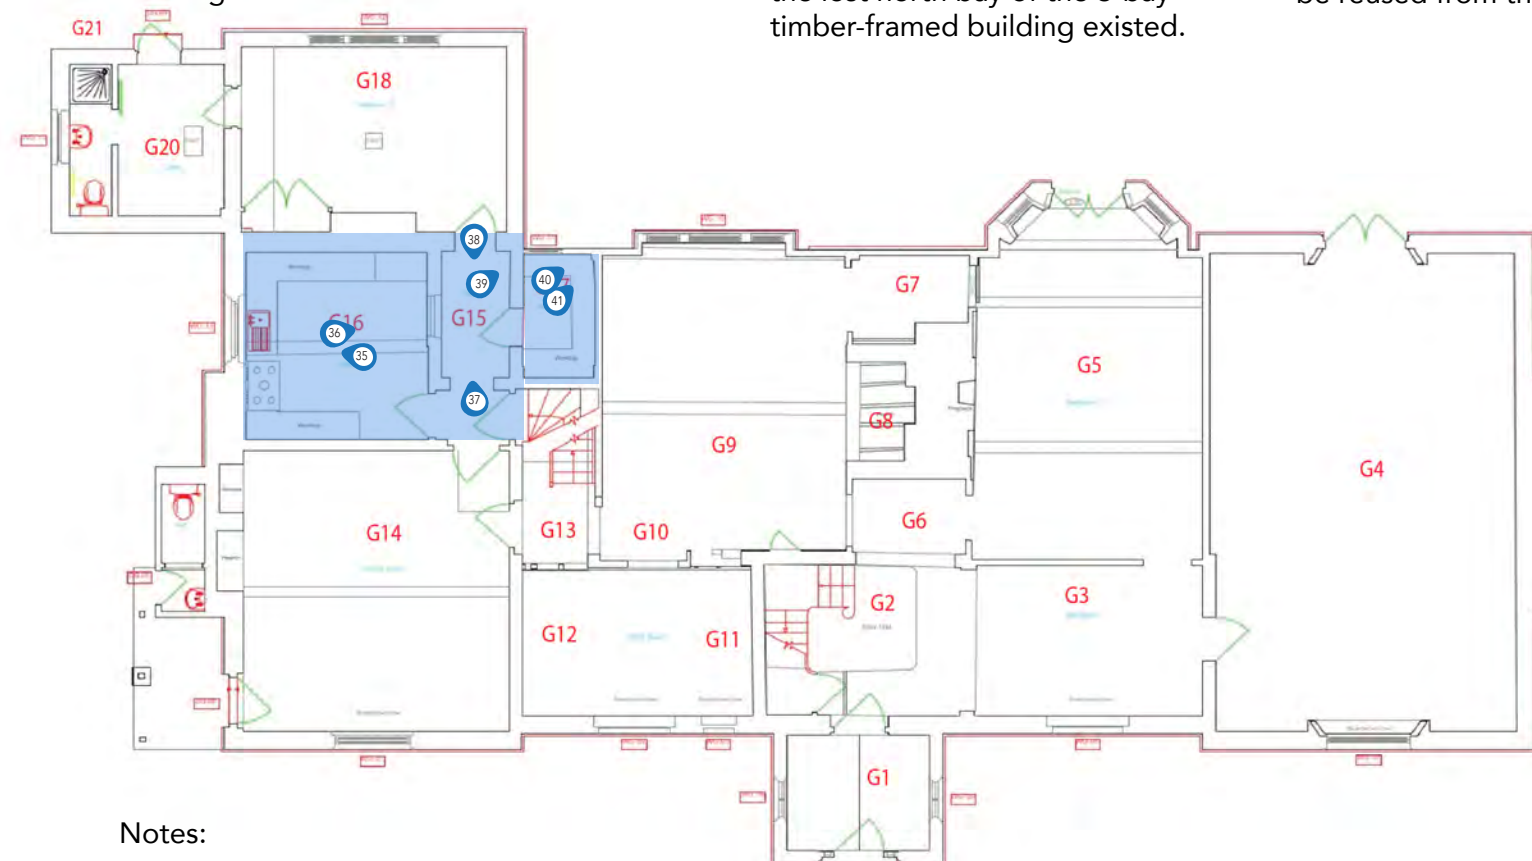

Notes:

Refer to Dwg MHB-02A for notes.

It should be noted that a window to the east of wall of G18 contains a Victorian window with brick drip mould (hood) where this extension was unsympathetically added.

Mapping from 1833 clearly shows a step in plan form to the north. It is likely that fire resulted in the original northern bay being lost, with a dairy added to the north side, following by G16 which is of the same rudimentary construction. It may have been used for meat hanging as some hooks were still evident. G15 appears to have been an external space with access to the inner doors to G16 and G17 and also the basement. The later Victorian cross-wing then consumed the entire area leaving some evidence of the former northern bay but also the rudimentary structures. Apart from the chamber to the former north bay, it is most probable that this end was rebuilt as a single storey construction with the additional floors added at the same time as the 'new' Victorian cross wing and the wrapping new facade.



41. SE corner of G17 - the sole plate is clearly visible and is also evidence of the existence of the north bay.

SHEET 9
Photographic Record / Inventory:
Ground Floor: G15, 16 and 17

January 2020