


Before: No image available but this area had a partition between the bedroom at FF11 to create a corridor. According to p23 of the AHP report, an ensuite extended beyond the stud/partition shown to FF10 to abut the edge of the bay. It is also noted that the timber frame was not visible within this room but to the other side (FF14).

Current (2018/19):



53. View from FF3 stair along sight line of former FF2 modern partition, FF1/2 screen and part of FF11. Note the cross beam has a principal rafter but no principal post. The mortice for a beam can be seen.

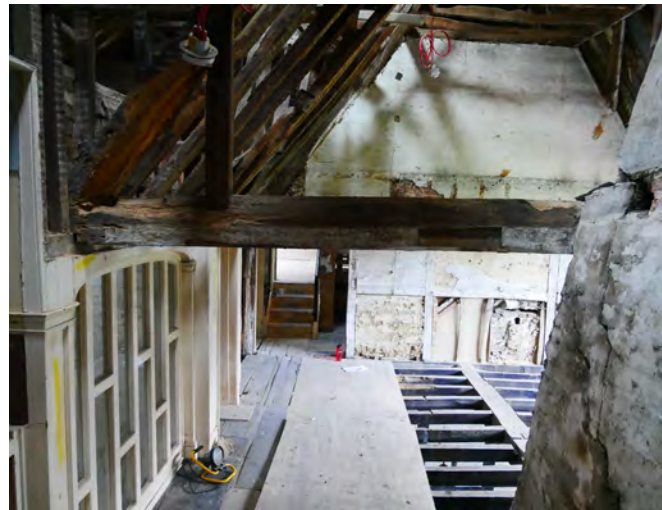

54. Closer view of the missing post. The wall plate has been altered in this area. There is evidence of a partition / door in this location.



55. Brick above the wallplate relates to the roof over what became a parallel range.




56. An amalgamated photograph showing the inner north wall plus former garret above. Evidence remains for the former spine position, the scar mark for the modern partition and two different ceiling heights. Daub panels have been repaired.



57. The East wall plate, rail and side girt was cut for the late Victorian Bay. Scar marks can be seen for the former ensuite partition. The timber in this area was disintegrating & brickwork collapsing. A former window to FF10 was also uncovered as well the doorway to the garrett above. Modern blocks to fireplace.



58. View to the south reveals the original wall plate, principal rafter and principal post. As the floors beyond have been raised, the door cuts through the end wall plate.

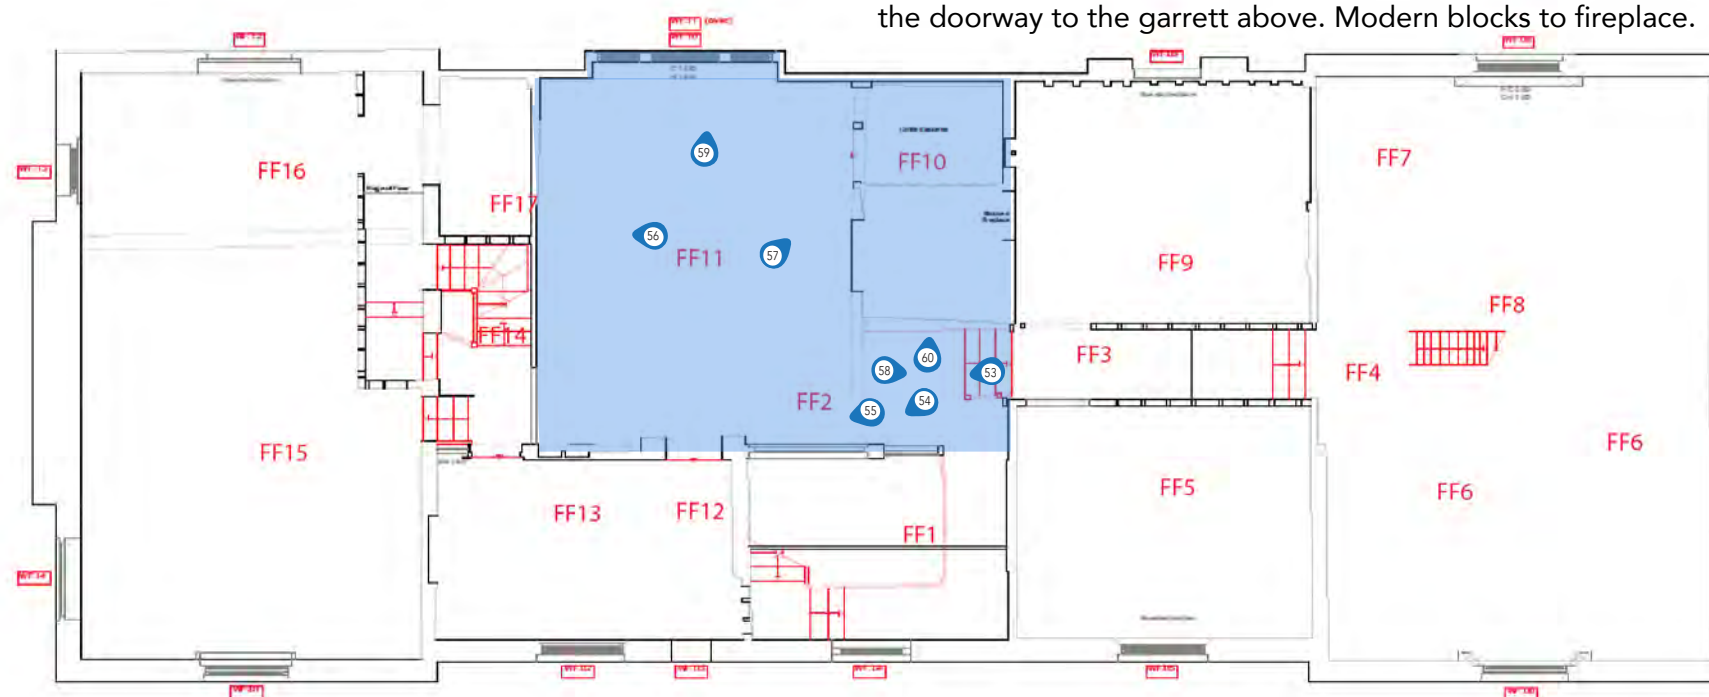

59. The Victorian bay is a mere 'bolt on', not tied in correctly to the main frame. Extensions to floor joists are the method of support. Also concealed with modern coverings.

Notes:

Refer to Dwg MHB-03A, 05A for notes and 07A. Reference should also be made to The Green Oak Carpentry Co details for repairs at FF1/FF2. It is ascertained that the rooms FF5 and FF12/13 pre-dated the insertion of hall / stair bay. There is clear evidence of changes to floor levels and ceiling heights to the southern side of the building and with that changes to the roof to create parallel range adapting to forward gabled projecting to FF5 and FF12/13 which had bay windows rising from the ground floor. As it is considered that stairs rose up from the east side of the fireplace, FF10, another ladder stair may have continued to the garret above this room. Refer to photos for FF12 and 13 for additional images.



60. The original build had a stack but it has been increased in height correlating with roof changes.

SHEET 12
Photographic Record / Inventory:
First Floor: FF2, FF10 & FF11

January 2020