


Before: No images available of this area. Limited evidence of the 'ghost' northern bay. Evidence of fire damage, timber reuse and extensive re-working. Formerly rooms used by care home staff. Both had fireplaces - one modern and the other concealed. Landing for FF14 and stairs to FF15 appear to be later alterations, with modern stud in FF16 more recent.

Current (2018/19):



91. Stairs from FF14 to FF15 with later partition to accommodate landing. Note upturned 'swell' jowl to corner and reused rake. Softwood to east, more recent.

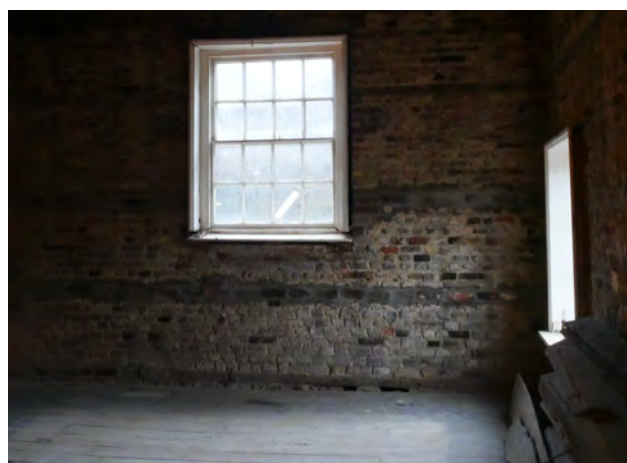


92. FF15 - former staff sitting room with dual aspect and windows in place.



93a/b. South wall of FF15 with evidence of flue for FF13. Also potential evidence of a two stage build at first floor level. Note there is a partition line to the west of the door, not aligned with the paired beam above (reused).



94. East and north walls of FF16 with dual aspect. Room division came off corner of internal partition shown in photo 91.

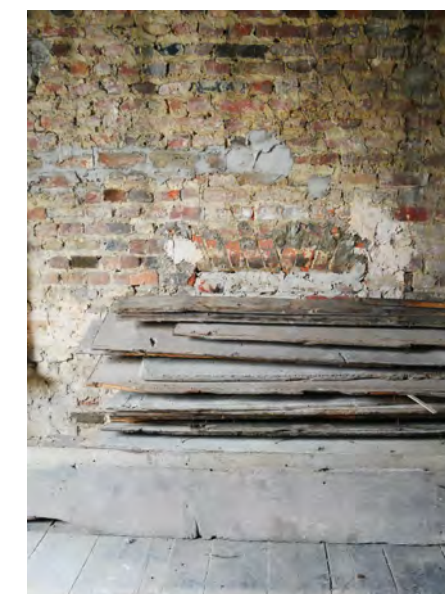

95. Fireplace to FF15 blocked up. Past planning application indicates this had a modern surround.



Notes:
Refer to Dwg MHB-03A, 05A and 07A for notes and O7A. Reference should also be made to The Green Oak Carpentry Co details for repairs. FF14/17 run against the wall between the 'ghost' north bay & middle bay of the post medieval building. Evidence of smoke blackened timbers to structure above including beam above FF17 with FF16. Signs of reused. Apart from this area with the scantlings, wall plate, cross beam and principal rafters, the 'ghost' bay has been lost at this level, presumed firstly as a result of fire damage and/or eradicated with the Victorian works.



97. Fire damage to timbers that have been reused above to FF16 and FF17.



96. Fireplace to FF16 blocked up. Hearth slab cracked.

SHEET 17
Photographic Record / Inventory:
First Floor: FF15 & FF16

January 2020