

Before: No images available of this area. Part of and extension. Originally one room, altered to form two. When the central stair was provided, a door was formed to landing.

Current (2018/19):



76. FF2/3 and Door to FF12. Doorway inserted below the wall-plate to the former external west wall. Door to FF13 is off the landing for FF14 (and ghost bay). Possible window particularly obscured. Staged works with mixture of lath and plaster and brick noggins with plaster over.




77. Door to FF1. Above the wall plate, joists can be seen but do not equate with the actual ceiling joists nor are these visible to FF1.



78. South wall to FF12 shows evidence of intruded stair bay. The roof struture is basic in this position, unlike the roof over FF5.



79a & b. East wall plate height with view of roof over middle bay. Shows evidence of fire damage, reuse added rafters along withraking shores. Rafters are also added to increase the height over the main range. Ashlars indicate ceiling height to FF12/13 raised. The principle post and rafter can be seen as the divide for the original north bay. Studs added to create FF14 partition. Roof over main chamber - rafters are bridle jointed at apex. Marked II and II.

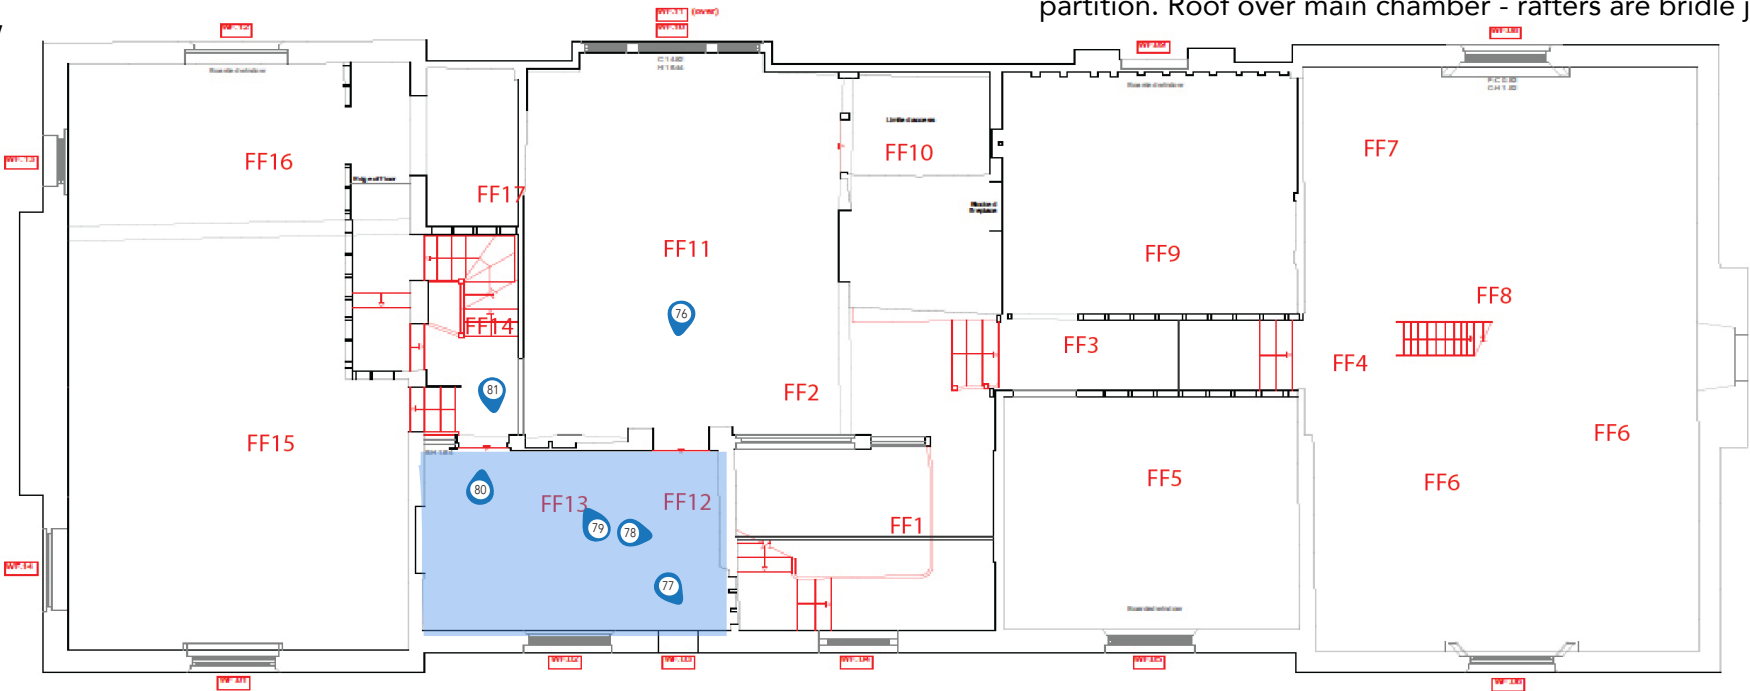

Notes:
Refer to Dwg MHB-03A, 05A for notes and O7A.
Reference should also be made to The Green Oak Carpentry Co details for repairs. FF12/13 pre-dates the insertion of hall / stair bay. Part of the 'ghost' north bay can be seen at the junction of FF11,13,14.



80. West wallplate to 'ghost' north bay and FF14. Note that box frame is visible to the stairway.



81. West wallplate 'interior' face, at pt where the 3rd nrth bay existed. Note evidence of bay window. Former fireplace & flue removed in past.