

Monitoring Details:

Crack and Level Monitoring

Provider Name: CET

Monitoring Interval: Every 8 weeks

Instruction Date: 21/ 12/ 2022

Number of Visits: Level - 7, Crack - 3

Reading Date:

Visits Completed: 4

Date of Issue: 07/ 12/ 2023

Visits Outstanding: 3

Client Details:

Client: Sedgwick

Engineer / Handler: Krystal Plant

Job Reference


Monitored Address:

Occupier:

Address: 2c Padnell Avenue, WATERLOOVILLE, Hampshire, PO8 8DY

Telephone:

Email:

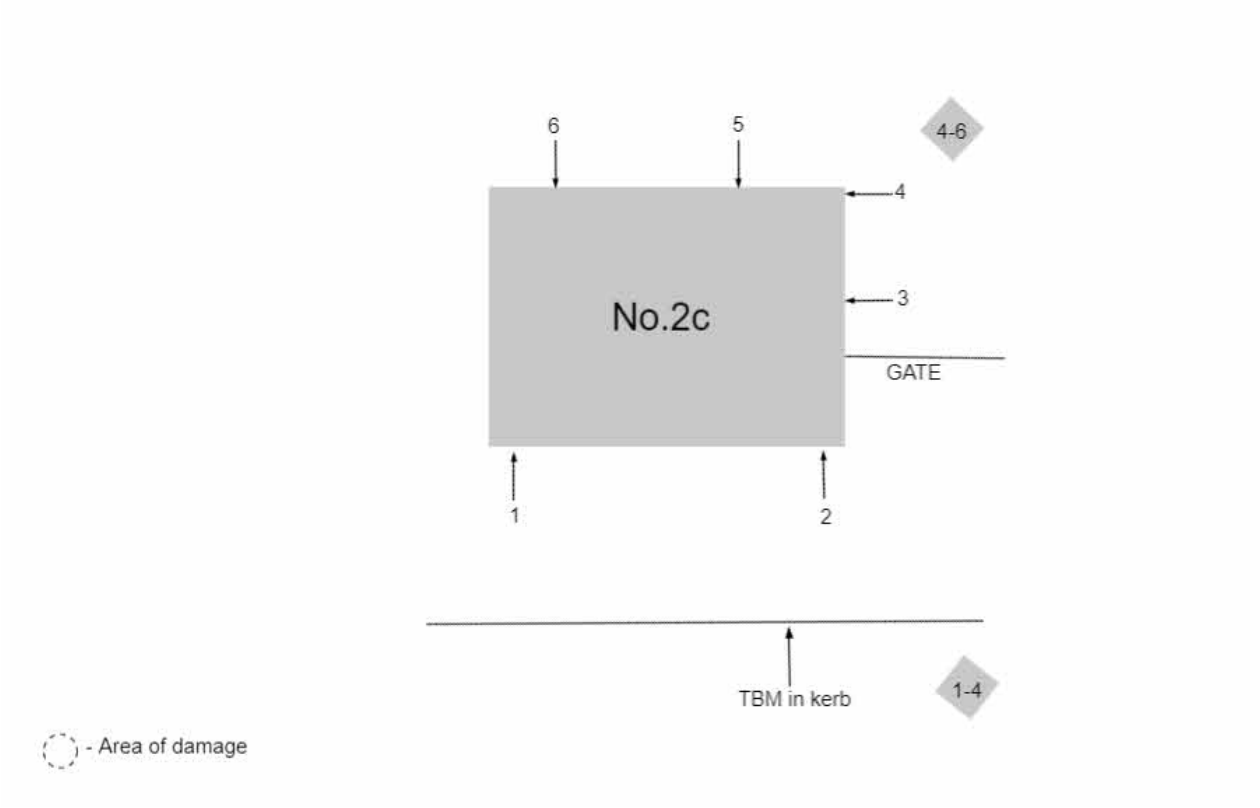

Level Readings


	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	24/04/23	19/06/23	18/08/23	13/10/23	07/12/23					
1	10.7735	10.7736	10.7734	10.7730	10.7749					
2	10.8194	10.8171	10.8141	10.8125	10.8203					
3	10.9573	10.9564	10.9534	10.9518	10.9583					
4	11.0137	11.0142	11.0125	11.0103	11.0150					
5	11.0225	11.0234	11.0220	11.0224	11.0238					
6	11.0350	11.0363	11.0354	11.0355	11.0368					
Taken by	CW	WR	WR	CW	TP					
Serial number	523918	762629	762629	523918	1212418					



Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	24/04/23	19/06/23	18/08/23	13/10/23	07/12/23					
1	0	+0.1	-0.1	-0.5	+1.4					
2	0	-2.3	-5.3	-6.9	+0.9					
3	0	-0.9	-3.9	-5.5	+1					
4	0	+0.5	-1.2	-3.4	+1.3					
5	0	+0.9	-0.5	-0.1	+1.3					
6	0	+1.3	+0.4	+0.5	+1.8					

Level Readings Chart (Points 1 - 6)

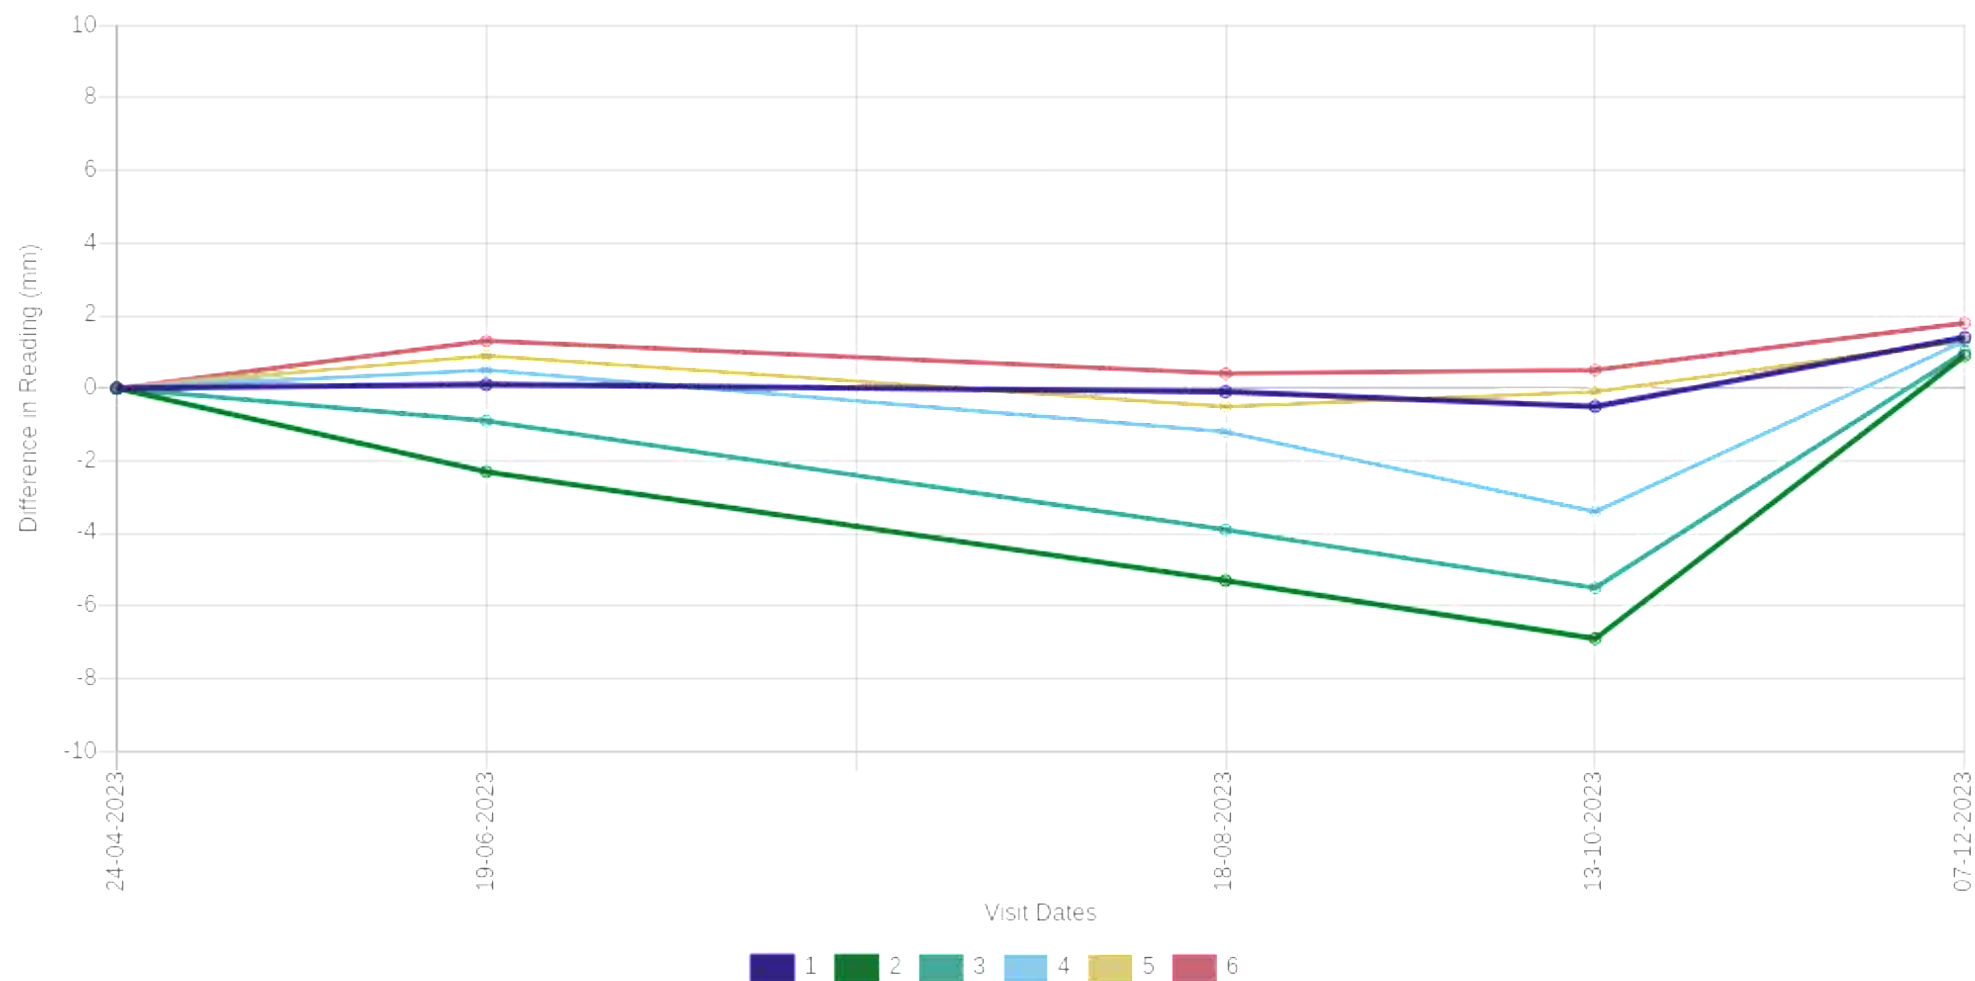


Crack Monitoring

Under window right hand side of front door

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	19/06/23	18/08/23	13/10/23	07/12/23						
H	9623	9654	9714	9641						
Taken by	W.R	W.R	CW	TP						
Callipers	0	0	4044	126						

Under window right hand side of front door - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	19/06/23	18/08/23	13/10/23	07/12/23						
H	0	0.31	0.91	0.18						

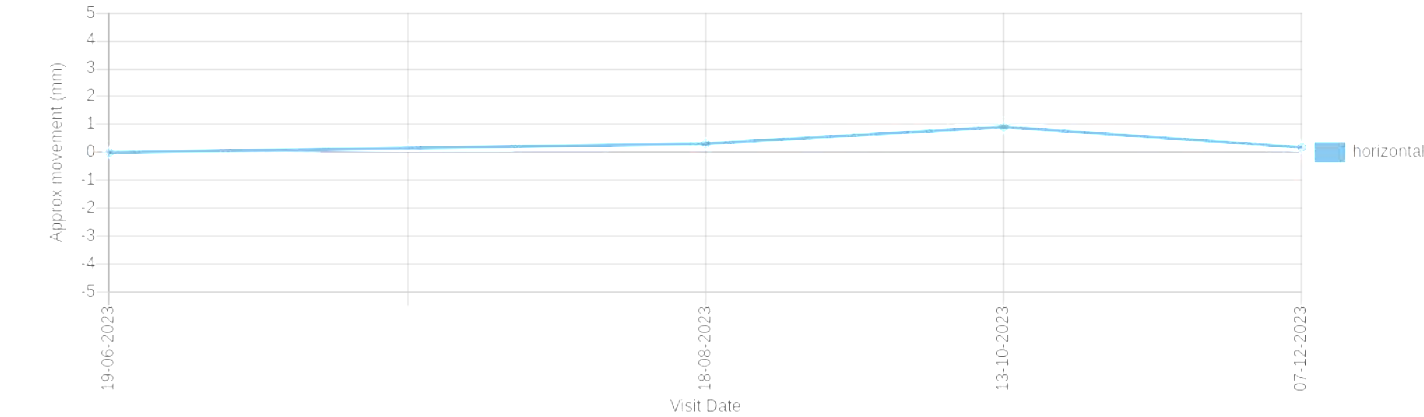

Under window right hand side of front door - Oldest photo



Under window right hand side of front door - Newest photo




Crack Monitoring

Rear right hand side of point 6

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	19/06/23	18/08/23	13/10/23	07/12/23						
H	472	4711	4739	4742						
Taken by	W.R	W.R	CW	TP						
Callipers	0	0	4044	126						

Rear right hand side of point 6 - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	19/06/23	18/08/23	13/10/23	07/12/23						
H	0	-0.08	0.19	0.22						

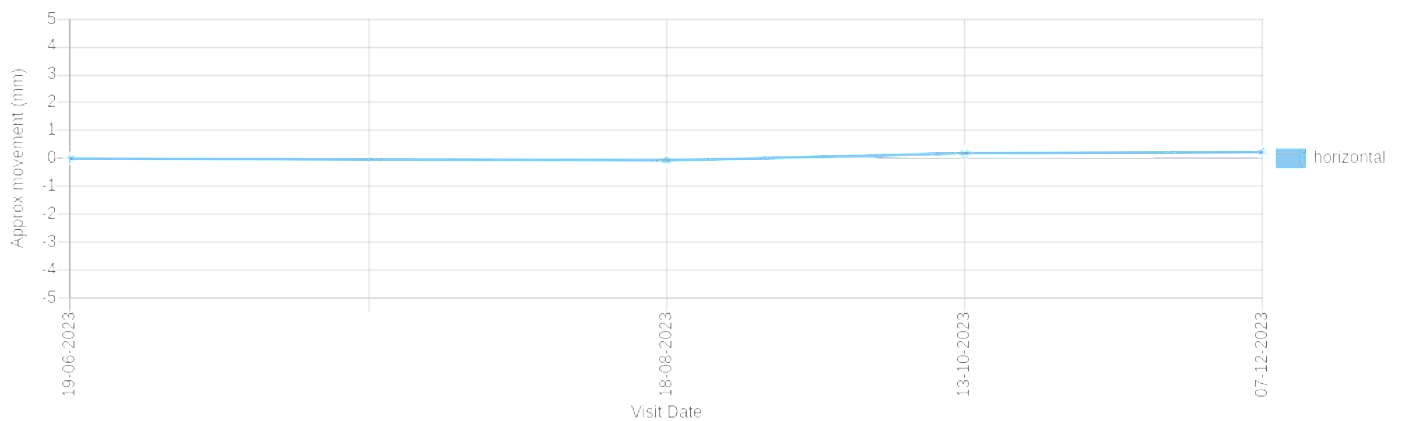

Rear right hand side of point 6 - Oldest photo



Rear right hand side of point 6 - Newest photo




Crack Monitoring

INT right hand side above patio doors

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	19/06/23	18/08/23	13/10/23	07/12/23						
H	32.19	32.41	33.04	32.38						
Taken by	W.R	W.R	CW	TP						
Callipers	0	0	4044	126						

INT right hand side above patio doors - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	19/06/23	18/08/23	13/10/23	07/12/23						
H	0	0.22	0.85	0.19						

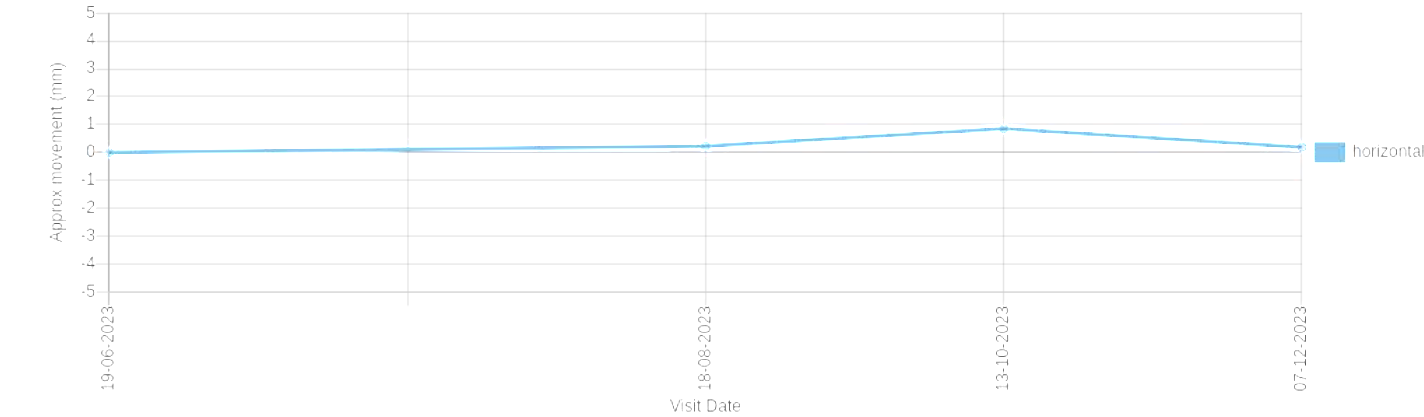

INT right hand side above patio doors - Oldest photo



INT right hand side above patio doors - Newest photo

