



Asbestos Survey Report 03/10/2024

Refurbishment Survey

Refurbishment Survey - Report Reference - FS44123

SNG36022-1

Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT

7-9 London Road, Hampshire

Content Page

3

Survey Details

3

Property Information

3

Client Information

3

Contractor Information

3

Refurbishment Survey Information

3

Document Authorisation

4

Executive Summary

4

Room/locations containing High Risk Material

4

Inaccessible Room/locations

4

Inaccessible Items

5

Property Details

5

Property Construction Details

6

Survey Information

6

Objective & Scope

7

Limitations

9

Specific Exclusions

10

Survey Results

10

Recommendations

10

Sample Summary

10

Key

11

Room/location Details including Construction Details

70

Asbestos Register

75

Summary of Remedial or Removal Works

76

Assessment Information

76

Material Risk Assessment Algorithm

77

Material Classifications

78

Survey Appendices

78

Remedial Options

79

Regulations and Guidance

Survey Details

Property Information

Property Name - Property Reference Number:	PL38163 - Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Address & Postcode:	7-9 London Road, Hampshire, PO7 5AT
Property Coordinator:	
Telephone / Mobile:	
Email:	

Client Information

Client Name - Client Reference Number:	MAC Construction Consultants - CO30918
Address & Postcode:	
Telephone / Mobile:	.
Email:	

Contractor Information

Contractor Name - Contractor Reference Number:	Supernova - CO1
Address & Postcode:	71-75 Shelton Street, Covent Garden, London, WC2H 9JQ
Telephone / Mobile:	020 4586 0680
Email:	Support@supernovagroup.co.uk

Refurbishment Survey Information

Survey Reference:	FS44123
Start Date:	03/10/2024
Completion Date:	03/10/2024
Publish Date:	07/10/2024

Document Authorisation

No
Image
Available

Aaron Mitson
Lead Surveyor

Executive Summary

A Refurbishment Survey was carried out at Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT on the 03/10/2024 - 03/10/2024

The purpose of the survey was to identify, as far as reasonably practicable, the presence and extent of any suspect asbestos containing materials (ACMs) in the areas inspected and assess their condition.

Refurbishment survey information was requested for this building.

This type of survey is intrusive and may involve destructive inspection, as necessary, to gain access to potentially hidden asbestos within the building fabric. The level of intrusion necessary was defined in the scope of works for this project.

Changes to the scope of work identified in this report may necessitate further inspection and sampling. Destructive inspection was only carried out in areas which would be disturbed for this project. ACMs may still be hidden within the building fabric.

Construction/down taking plans appended to this report indicate the areas surveyed within this building.

This report was published on 07/10/2024. Updated information may be present on the asbestos management system which should be checked on a regular basis

During this Survey 4 sample(s) were taken for analysis. There were 14 asbestos items identified or presumed to contain asbestos within the property.

Room/locations containing High Risk Material

Of the areas inspected, there were no locations identified (or presumed) to contain High Risk ACMs.

Inaccessible Room/locations

All areas were accessed as agreed at the pre-survey stage.

Further investigation required beneath any presumed or sampled areas of asbestos containing materials. No invasions can be made past presumed to contain ACMS

Inaccessible Items

There were 2 inaccessible items all of which attract a High Material Score.

Item	Area/floor	Room/location	Reason
001	002	016	Unable to Sample due to Height Restriction
019	003	040	Unable to Sample due to Height Restriction

Property Details

Property Construction Details

Primary Use:	Residential
Secondary Use:	Residential
Date of Construction:	1900's
Construction Type:	Brick
No. Floors:	3.0
No. Staircases:	2.0
No. Lifts:	0.0
Net Area per Floor:	200
Gross Area:	500
Comments:	

Survey Information

Objective & Scope

Supernova Group LTD (Supernova) was requested and authorised by the Client to undertake a Pre-demolition / Pre-refurbishment Asbestos Survey ('Full access sampling and identification survey').

The purpose of this survey was to identify and establish, as far as reasonably practicable, the presence of ACMs and their quantitative extent within the building(s). This is intended to assist the Client in managing and minimising any health & safety risks associated with the refurbishment/demolition of the building(s) and to ensure sufficient information is provided to enable the client to obtain a competitive contract for any necessary abatement works.

The survey has been undertaken with appropriate reference to Health and Safety Executive (HSE) publication HSG264 'Asbestos: The Survey Guide' and is intended to underpin a strategy for compliance with the Control of Asbestos Regulations (CAR) 2012.

This report presents the findings of our site observations, sample analysis results and our recommendations for future actions concerning the materials identified from the Pre-demolition / Pre-refurbishment Asbestos Survey. Unless otherwise stated, these are based upon a **fully intrusive** inspection of an unfamiliar site.

During the Pre-demolition / Pre-refurbishment Asbestos Survey, all reasonable efforts were made to identify the presence of ACMs and 'look alike' materials within accessible areas of the building. This comprised a visual inspection with a confirmatory sampling of suspected ACMs and further intrusive investigations in specific locations. Whilst the survey cannot guarantee to have identified all ACMs potentially hidden or obscured within the building fabric and structure, the information provided by the investigation is intended to be representative of the structure as a whole.

Regarding Pre-demolition / Pre-refurbishment Asbestos Surveys, it must be understood that ACMs may be uncovered in areas where inspection points have not been made. Other than discrete representative sampling, no ACMs have been disturbed or removed during the course of this survey. It is therefore a possibility that additional ACMs may be present behind those identified. These may only be discovered during any subsequent asbestos removal work. **Inaccessible areas will be deemed to contain asbestos until proven otherwise.**

Survey Information

Limitations

Inaccessible Areas and Limitations

The client should refer to the Supernova standard terms and conditions of engagement attached to the works proposal. The HSE publication HSG264 entitled 'Asbestos: The Survey Guide' details guidance on the surveying, assessment and management of ACMs.

Intrusive investigations (Pre-demolition / Pre-refurbishment Asbestos Survey)

This type of survey is used to locate and describe, as far as reasonably practicable, all ACMs and 'look alike' materials in a building and may involve destructive inspections, as necessary, to gain access to all areas, where under normal circumstances it would be reasonable to expect the possible presence of ACMs, including those that may be difficult to reach. The survey scope includes a fully representative sampling programme undertaken in accordance with our technical procedures and estimates of the volume and surface area of ACMs made.

This type of survey is designed to be used as a basis for tendering for removing ACMs from the building before demolition/refurbishment, so it does not assess the condition of the asbestos. However, Supernova undertakes a material assessment for each item to cover areas where damage or debris may be present. If appropriate, these are highlighted in a pre-works hazard statement. Any recommendations are based on the understanding that the site will undergo significant refurbishment and demolition. Therefore, The primary recommendation is the appropriate removal of ACMs as required. No priority assessments or consideration of the ongoing management of ACMs has been provided. A competent person is recommended to be retained by the client to supervise any refurbishment/demolition works and to manage any further inspections or confirmatory identification sampling which might be required upon opening up or discovering any hidden areas or voids.

Intrusive investigations specific to this survey were undertaken using hand-operated power tools only. No allowance was made for destructive works using mobile plant or other heavy equipment. Areas, where intrusive inspections were carried out were not 'made good' afterwards unless by prior arrangement with the client. The locations were selected following a preliminary visual appraisal of the building, a review of relevant information made available by the Client and the professional experience of our survey team. Whilst the survey cannot guarantee to have identified all ACMs potentially hidden or obscured within the building fabric and structure, the investigations were undertaken in locations intended to represent the structure as a whole.

If indicative costs have been included in relation to asbestos abatement works, these must be considered as tentative only and must, in any event, be confirmed by a qualified quantity surveyor or by tender with a licensed asbestos removal contractor. Any person(s) using the report in this way MUST use all reasonable skill and diligence to verify that the contents of the report are accurate and suitable for the intended use, thereby satisfying themselves as to the extent of ACMs within the designated areas and thereby ensure that their tender is sufficient in every respect to remove ALL the asbestos within these areas, including any that may be hidden behind known or presumed asbestos materials, or that may only become apparent during significant refurbishment or demolition works.

The survey scope was selected based on the specific redevelopment proposed by the Client and may be inappropriate to another form of redevelopment or scheme. The opinions provided, inter alia, take into consideration currently available guidance relating to intrusive surveys and our understanding of the proposed redevelopment supplied by the Client; no liability can be accepted for the retrospective effects of any future changes or amendments to these information sources.

Typical exclusions from the intrusive survey (where special arrangements would be required to facilitate access) or specific areas of no access are documented below. It should be noted that the list is not exhaustive. All areas or items not accessed during the survey should be presumed to contain asbestos until proven otherwise.

Areas of No Access	Comments
Live plant and electrical equipment	Enclosed or internal areas of any potentially live plant or equipment may contain asbestos materials. Access to live electrical equipment is only included in the survey scope specifically requested by the Client. Safe access, including copies of isolation certificates, must be provided by the client in the event that such equipment is inspected.
Inspection at height	Representative access to high-level areas will be made so far as is reasonably practicable, provided specialist access equipment has been allowed for in the scope of works. Otherwise, presumptive observations would be made and specified.
Restricted areas	Any area or space requiring specialist access would only be accessed if by prior agreement with the client. Unless the requisite access has been made, e.g., qualified lift engineer, which is stated in the report, it should be assumed that access has yet to be made. Typical examples include: <ul style="list-style-type: none"> • Lift equipment and Shafts • Areas designated as 'Confined Spaces' • Areas where asbestos is present and would need to be disturbed to facilitate an inspection.
Gaskets within pipe joints and plant equipment	Gaskets inserted in pipe joints etc., and bituminous materials such as damp-proof membranes, under sink pads, roof felts, or membranes may contain a trace asbestos content. Under normal conditions, these materials will not give rise to significant airborne fibre concentration due to the fibre being tightly bonded within a well-bound matrix. Representative samples will be taken in accordance with our technical procedures, but in the absence of confirmatory analysis, the presence of asbestos in these materials should be presumed.
Multi-layer or composite structures	Limited representative inspections of multi-layer or composite structures, such as floor slabs, roof structures, etc., will be made. A representative sampling of outer finishes such as floor screeds or other finishes, e.g. renders, bituminous layers or felts, would also be undertaken. However, core sampling or other techniques allowing for a full-depth sample of such elements would only routinely be undertaken if stated in the agreed scope of works. It would be reasonably practicable to allow for such extensive intrusive investigation in instances where information is made available to us prior to the survey planning stage, indicating that such elements may contain asbestos fibre within its inner layers.
Portable plant or equipment	Portable plant or equipment will not be accessed.
General obstructions	Any area or space, which involved the moving of fixed equipment, would not be accessed.
Fire doors	Fire doors may internally contain asbestos. Representative access to fire doors will usually be made so far as is reasonably practicable, and these should be stated in the report.
Fixed ceilings and wall/floor cavities	Limited representative inspections would be made in specific locations in accordance with our technical procedures. There remains the possibility of ACMs remaining in voids that have not been accessed.
Insulation to plant equipment and pipes	Limited representative inspections would be made in specific locations in accordance with our technical procedures. There remains the possibility of ACMs remaining in areas outside of the immediate sampling/inspection point.
Ventilation ducts	No access would be made to ventilation ducting. Asbestos gasket material or an asbestos lining may be present.
Ducts and risers	As stated in the report, limited representative inspections would be made in targeted locations. However, there remains the possibility of ACMs remaining in ducts or risers that have yet to be accessed.
Any area, room or space occupied at the time of the survey	Access to any occupied areas would be presumptive only. Consequently, such areas are excluded from the Pre-demolition / Pre-refurbishment Asbestos Survey scope. The client must provide unrestricted and safe access if such areas are to be inspected at a later date. Supernova reserves the right to charge additional fees for any re-visits as required after consultation with the client.
Any area, room or space flooded at the time of the survey	Access would only be made within flooded areas if the client can ensure unrestricted and safe access. Supernova reserves the right to charge additional fees for any re-visits as required after consultation with the client.

Survey Information

Specific Exclusions

Where detailed, it was agreed at the pre-survey stage that the following room/locations would be excluded from the scope of Survey. The room/locations do not include more general exclusions (i.e. inaccessible room/locations/items) detailed elsewhere.

Area/floor	Room/location
No Room/locations Found.	

No responsibility is accepted for the presence of asbestos in voids (under floor, floor, wall or ceiling) other than those opened up during the investigation (unless agreed at the pre-survey stage).

Areas requiring specialist access arrangements or equipment (other than stepladders) will not be assessed unless otherwise stated and agreed at the pre-survey stage. Fire doors were not inspected internally to ascertain if they are manufactured using ACMs as to do so would entail overly destructive testing procedures.

Survey Results

Recommendations

Item	Sample	Product/debris Type	Area/floor	Room/location	Action/recommendations
001	N/A	Cement Product(s) Flue Pipe	002	016	Remove Remove ACM before Refurb. Work under FCC by FLC
002	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	018	Remove Remove ACM before Refurb. Work under FCC by FLC
003	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	019	Remove Remove ACM before Refurb. Work under FCC by FLC
006	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	023	Remove Remove ACM before Refurb. Work under FCC by FLC
009	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	028	Remove Remove ACM before Refurb. Work under FCC by FLC
010	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	029	Remove Remove ACM before Refurb. Work under FCC by FLC
011	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	031	Remove Remove ACM before Refurb. Work under FCC by FLC
012	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	032	Remove Remove ACM before Refurb. Work under FCC by FLC
013	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	033	Remove Remove ACM before Refurb. Work under FCC by FLC
014	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	034	Remove Remove ACM before Refurb. Work under FCC by FLC
015	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	035	Remove Remove ACM before Refurb. Work under FCC by FLC
016	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	036	Remove Remove ACM before Refurb. Work under FCC by FLC
018	SNG36022-004	Asbestos Board(s) Insulation Board Panel(s)	002	038	Remove Remove ACM before Refurb. Work under FCC by FLC
019	N/A	Cement Product(s) Flue Pipe	003	040	Remove Remove ACM before Refurb. Work under FCC by FLC


Sample Summary

Sample	Product/debris Type	Area/floor	Room/location	Asbestos Type
SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	018	Identified Chrysotile
SNG36022-002	Other Encapsulated Material Textured Coating To Ceiling	002	020	No ACM Detected
SNG36022-003	Other Encapsulated Material Textured Coating To Wall	002	025	No ACM Detected
SNG36022-004	Asbestos Board(s) Insulation Board Panel(s)	002	038	Identified Amphibole (exc. Crocidolite) Chrysotile

Key

Code	Description
FCC	Fully Controlled Conditions
PCC	Partially Controlled Conditions
FLC	Fully Licensed Contractor

Room/location Details including Construction Details

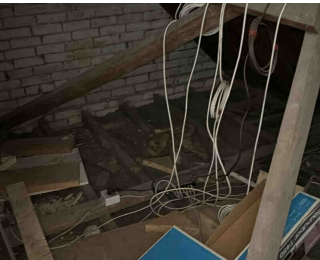


Room/location Details

Room/location Reference:	001
Room/location Description:	Loft Spaces
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Clay, Timber
- Walls:** Brick, Timber, Foam
- Floor:** MMMF, Timber
- Doors:** Plastic, Timber
- Windows:** Out of scope
- Comments:** Restricted access due to lofts not boarded, no safe access.

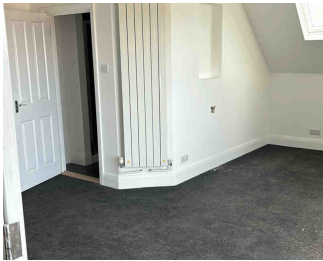


Room/location Details

Room/location Reference:	002
Room/location Description:	Bedroom & Ensuite
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling: Plasterboard
- Walls: Brick, Plasterboard
- Floor: Carpet, Timber
- Doors: Timber
- Windows: Plastic
- Comments:

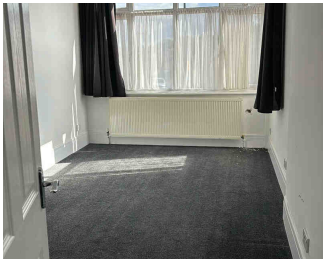


Room/location Details

Room/location Reference:	003
Room/location Description:	Bedroom
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling: Lath and Plaster, Plasterboard
- Walls: Brick, MMMF, Plasterboard
- Floor: Carpet, Timber
- Doors: Timber
- Windows: Plastic
- Comments:

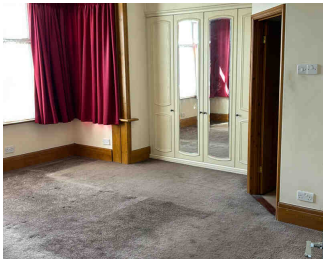

Room/location Details

Room/location Reference:	004
Room/location Description:	Bedroom & Ensuite
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

Ceiling:	Lath and Plaster, Plasterboard
Walls:	Brick, MMMF, Plasterboard
Floor:	Carpet, Timber, Vinyl-Non-Asbestos
Doors:	Timber
Windows:	Plastic
Comments:	




Room/location Details

Room/location Reference:	005
Room/location Description:	Bathroom
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Lath and Plaster, Plasterboard
- Walls:** Brick, MMMF, Plasterboard
- Floor:** Ceramic, Timber
- Doors:** Timber
- Windows:** Plastic
- Comments:**

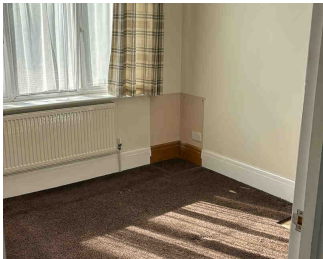

Room/location Details

Room/location Reference:	006
Room/location Description:	Bedroom
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Lath and Plaster, Plasterboard
- Walls:** Brick, MMMF, Plasterboard
- Floor:** Carpet, Timber
- Doors:** Timber
- Windows:** Plastic
- Comments:**




Room/location Details

Room/location Reference:	007
Room/location Description:	Bedroom & Ensuite
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Lath and Plaster, Plasterboard
- Walls:** Brick, MMMF, Plasterboard
- Floor:** Carpet, Timber, Vinyl-Non-Asbestos
- Doors:** Timber
- Windows:** Plastic
- Comments:**

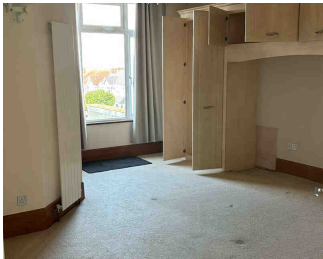


Room/location Details

Room/location Reference:	008
Room/location Description:	Bedroom & Ensuite
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Lath and Plaster, Plasterboard
- Walls:** Brick, MMMF, Plasterboard
- Floor:** Carpet, Timber, Vinyl-Non-Asbestos
- Doors:** Timber
- Windows:** Plastic
- Comments:**

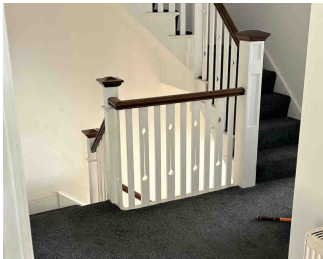


Room/location Details

Room/location Reference:	009
Room/location Description:	Stairs & Landing
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Lath and Plaster, Plasterboard
- Walls:** Brick, MMMF, Plasterboard
- Floor:** Carpet, Timber
- Doors:** Timber
- Windows:** Out of scope
- Comments:**

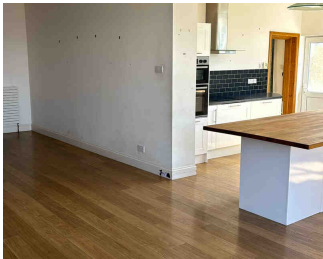

Room/location Details

Room/location Reference:	010
Room/location Description:	Kitchen Diner
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling: Lath and Plaster, Plasterboard
- Walls: Brick, MMMF, Plasterboard
- Floor: Timber, Laminate
- Doors: Plastic, Timber
- Windows: Plastic
- Comments:




Room/location Details

Room/location Reference:	011
Room/location Description:	Dining Room
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

Ceiling:	Lath and Plaster, Plasterboard
Walls:	Brick, Plaster
Floor:	Carpet, Timber
Doors:	Timber
Windows:	Plastic
Comments:	

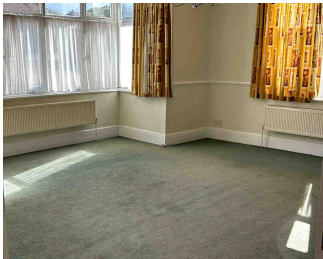

Room/location Details

Room/location Reference:	012
Room/location Description:	Lounge
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling: Lath and Plaster, Plasterboard
- Walls: Brick, Plaster
- Floor: Carpet, Timber
- Doors: Timber
- Windows: Plastic
- Comments:




Room/location Details

Room/location Reference:	013
Room/location Description:	Toilet
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling: Lath and Plaster, Plasterboard
- Walls: Brick, MMMF, Plasterboard
- Floor: Timber, Vinyl-Non-Asbestos
- Doors: Timber
- Windows: Out of scope
- Comments:

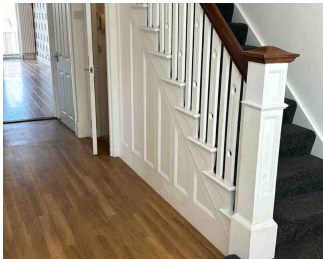

Room/location Details

Room/location Reference:	014
Room/location Description:	Hallway
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Lath and Plaster, Plasterboard
- Walls:** Brick, Plaster
- Floor:** Timber, Vinyl-Non-Asbestos
- Doors:** Timber
- Windows:** Timber
- Comments:**




Room/location Details

Room/location Reference:	015
Room/location Description:	Porch
Area/floor Reference:	001
Area/floor Description:	Number 7
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** MMMF, Plasterboard
- Walls:** Brick, Plaster
- Floor:** Ceramic, Concrete
- Doors:** Plastic, Timber
- Windows:** Plastic
- Comments:**

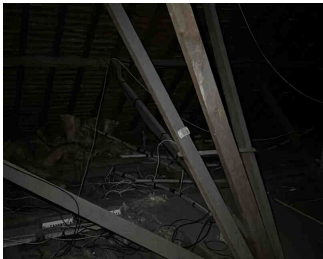


Room/location Details

Room/location Reference:	016
Room/location Description:	Loft
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Clay, Timber
- Walls:** Brick
- Floor:** MMMF, Timber
- Doors:** Timber
- Windows:** Out of scope
- Comments:** Restricted access due to loft only partially boarded

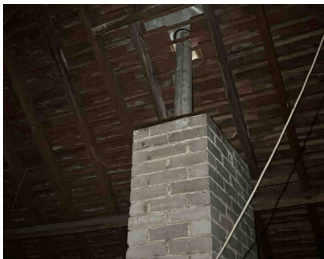

Item Detail

Item ID	001
Item Assessment	Limited Assessment Inaccessible Item
Reason for No Access	Unable to Sample due to Height Restriction
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	016
Specific location	Other Flue from chimney breast
Product/debris type	Cement Product(s) Flue Pipe
Asbestos type	Presumed Chrysotile
Extent	1 m


Material Assessment

Product Type (a)	N/A
Extent of Damage (b)	N/A
Surface Treatment (c)	N/A
Asbestos Fibre (d)	N/A
Total (a+b+c+d)	12
Material Risk Assessment	<div></div> High

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--

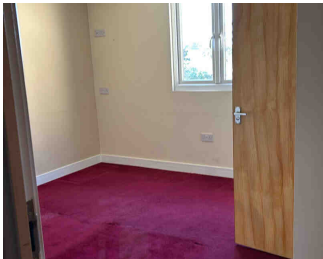

Room/location Details

Room/location Reference:	017
Room/location Description:	Room 7
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling: Plasterboard
- Walls: Brick, MMMF, Plasterboard
- Floor: Carpet, Timber, Vinyl-Non-Asbestos
- Doors: Timber
- Windows: Plastic
- Comments:





Room/location Details

Room/location Reference:	018
Room/location Description:	Room 8
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Lath and Plaster, Plasterboard
- Walls:** Brick, MMMF, Plasterboard
- Floor:** Carpet, Timber
- Doors:** Timber
- Windows:** Plastic
- Comments:**

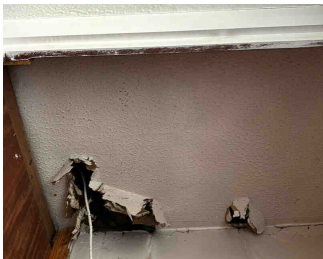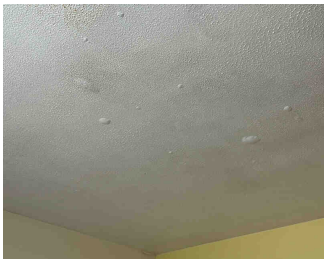

Item Detail

Item ID	002(OS)
Referenced to	SNG36022-001
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	018
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	Identified Chrysotile
Extent	20 m²
Licensed/non-licensed	N/A
Air Test	

Material Assessment

Product Type (a)	1
Extent of Damage (b)	2
Surface Treatment (c)	0
Asbestos Fibre (d)	1
Total (a+b+c+d)	04
Material Risk Assessment	<div></div> Very Low

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--





Room/location Details

Room/location Reference:	019
Room/location Description:	Bedroom
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	0

Room/location Construction Details

- Ceiling: Lath and Plaster, Plasterboard
- Walls: Brick, MMMF, Plasterboard
- Floor: Carpet, Timber
- Doors: Timber
- Windows: Plastic
- Comments:

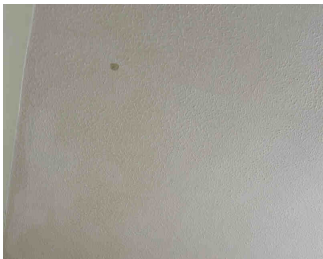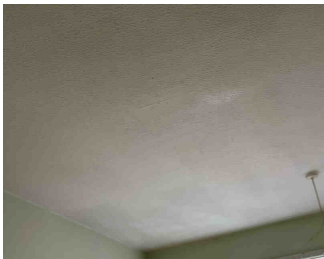

Item Detail

Item ID	003(VRS)
Sample Linked/ID	SNG36022-001
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	019
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	Strongly Presumed Chrysotile
Extent	8 m²
Licensed/non-licensed	N/A
Air Test	

Material Assessment

Product Type (a)	1
Extent of Damage (b)	0
Surface Treatment (c)	0
Asbestos Fibre (d)	1
Total (a+b+c+d)	02
Material Risk Assessment	<div></div> Very Low

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--




Room/location Details

Room/location Reference:	020
Room/location Description:	Bedroom
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	1

Room/location Construction Details

- Ceiling:** Lath and Plaster
- Walls:** Brick, Lath and Plaster
- Floor:** Timber
- Doors:** Timber
- Windows:** Plastic
- Comments:**

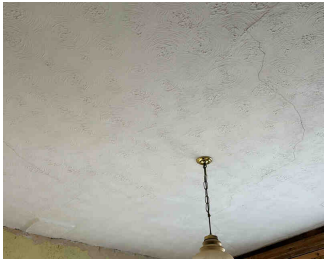

Item Detail

Item ID	004(OS)
Referenced to	SNG36022-002
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	020
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	No ACM Detected
Extent	12 m²
	<div></div> No Risk

Comments





Room/location Details

Room/location Reference:	021
Room/location Description:	Bathroom & Toilet
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	1

Room/location Construction Details


- Ceiling: Plasterboard
- Walls: Brick, MMMF, Plasterboard
- Floor: Timber, Vinyl-Non-Asbestos
- Doors: Timber
- Windows: Plastic
- Comments:

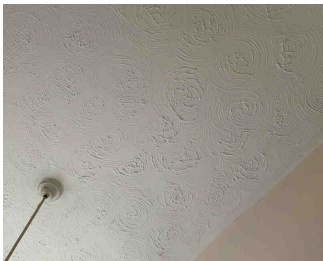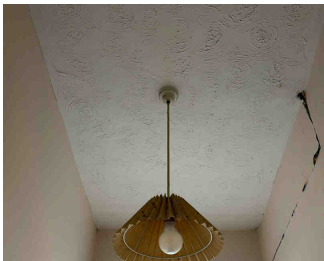

Item Detail

Item ID	005(VRS)
Sample Linked/ID	SNG36022-002
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	021
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	No ACM Detected
Extent	2 m²
	<div></div> No Risk

Comments

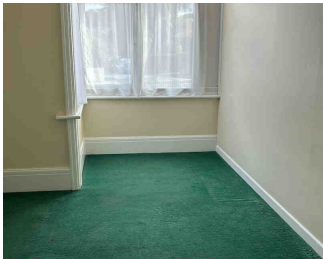


Room/location Details

Room/location Reference:	022
Room/location Description:	Room 11
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

Ceiling:	Plasterboard
Walls:	Brick, MMMF, Plasterboard
Floor:	Carpet, Timber
Doors:	Timber
Windows:	Plastic
Comments:	


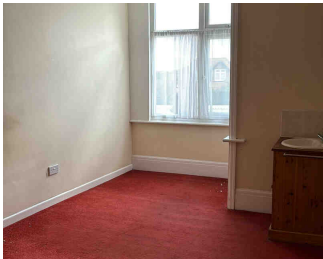


Room/location Details

Room/location Reference:	023
Room/location Description:	Room 10
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	0

Room/location Construction Details

- Ceiling: Lath and Plaster, Plasterboard
- Walls: Brick, MMMF, Plasterboard
- Floor: Carpet, Timber
- Doors: Timber
- Windows: Plastic
- Comments:

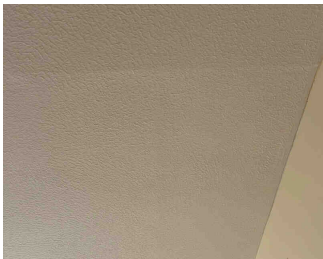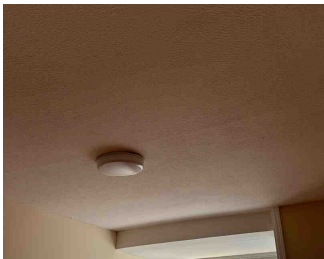

Item Detail

Item ID	006(VRS)
Sample Linked/ID	SNG36022-001
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	023
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	Strongly Presumed Chrysotile
Extent	25 m²
Licensed/non-licensed	N/A
Air Test	

Material Assessment

Product Type (a)	1
Extent of Damage (b)	0
Surface Treatment (c)	0
Asbestos Fibre (d)	1
Total (a+b+c+d)	02
Material Risk Assessment	<div></div> Very Low

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--




Room/location Details

Room/location Reference:	024
Room/location Description:	Room 9
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

Ceiling:	Plasterboard
Walls:	Brick, MMMF, Plasterboard
Floor:	Carpet, Timber
Doors:	Timber
Windows:	Plastic
Comments:	


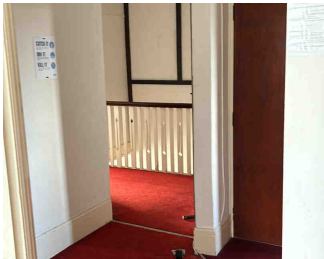


Room/location Details

Room/location Reference:	025
Room/location Description:	Landing & Stairs
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	2

Room/location Construction Details



Ceiling:	Lath and Plaster
Walls:	Brick, Lath and Plaster, Plasterboard
Floor:	Carpet, Timber
Doors:	Timber
Windows:	Out of scope
Comments:	

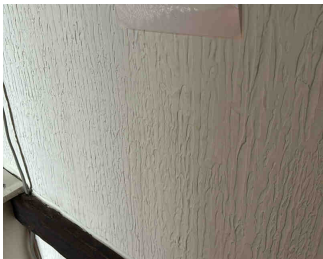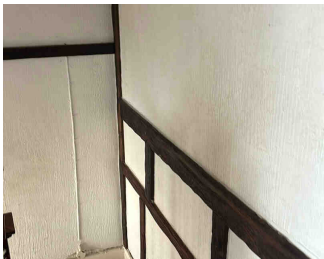

Item Detail

Item ID	008(OS)
Referenced to	SNG36022-003
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	025
Specific location	Other Walls
Product/debris type	Other Encapsulated Material Textured Coating To Wall
Asbestos type	No ACM Detected
Extent	25 m²
	<div></div> No Risk


Comments

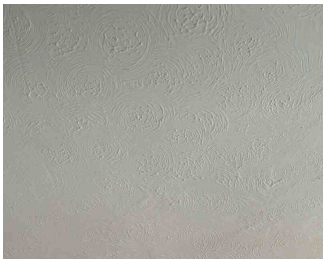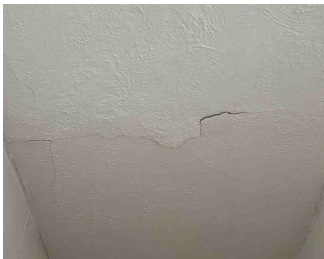

Item Detail

Item ID	007(VRS)
Sample Linked/ID	SNG36022-002
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	025
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	No ACM Detected
Extent	35 m²
	<div></div> No Risk

Comments

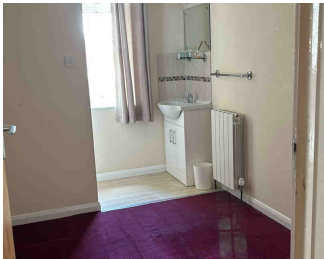


Room/location Details

Room/location Reference:	026
Room/location Description:	Room 6
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Lath and Plaster, Plasterboard
- Walls:** Brick, MMMF, Plasterboard
- Floor:** Carpet, Timber
- Doors:** Timber
- Windows:** Plastic
- Comments:**

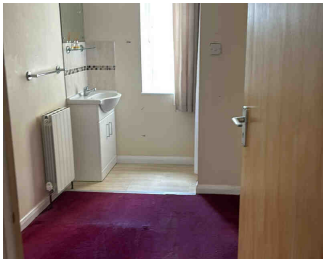


Room/location Details

Room/location Reference:	027
Room/location Description:	Room 5
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Lath and Plaster, Plasterboard
- Walls:** Brick, MMMF, Plasterboard
- Floor:** Carpet, Timber
- Doors:** Timber
- Windows:** Plastic
- Comments:**


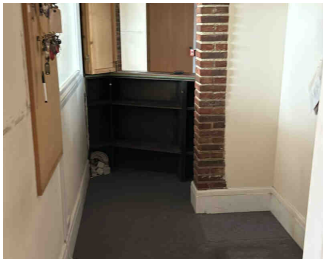


Room/location Details

Room/location Reference:	028
Room/location Description:	Reception
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	0

Room/location Construction Details

- Ceiling: Lath and Plaster
- Walls: Brick, MMMF, Plasterboard
- Floor: Ceramic, Timber
- Doors: Timber
- Windows: Timber
- Comments:

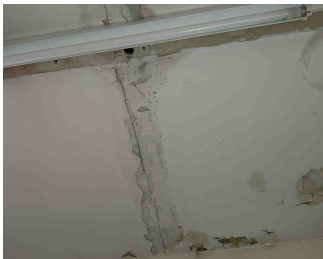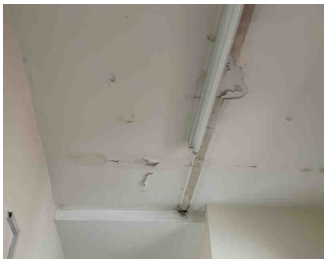

Item Detail

Item ID	009(VRS)
Sample Linked/ID	SNG36022-001
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	028
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	Strongly Presumed Chrysotile
Extent	8 m²
Licensed/non-licensed	N/A
Air Test	

Material Assessment

Product Type (a)	1
Extent of Damage (b)	1
Surface Treatment (c)	0
Asbestos Fibre (d)	1
Total (a+b+c+d)	03
Material Risk Assessment	<div></div> Very Low

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--





Room/location Details

Room/location Reference:	029
Room/location Description:	Kitchen
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Lath and Plaster, Plasterboard, Modern suspended ceiling tiles
- Walls:** Brick, MMMF, Paper, Plasterboard
- Floor:** Timber, Vinyl-Non-Asbestos
- Doors:** Plastic, Timber
- Windows:** Plastic
- Comments:**

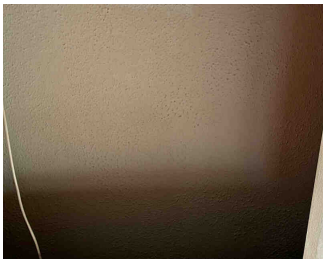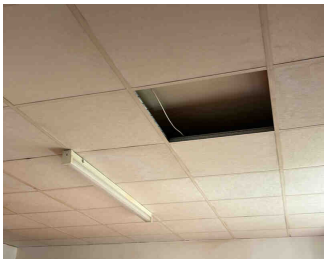

Item Detail

Item ID	010(VRS)
Sample Linked/ID	SNG36022-001
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	029
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	Strongly Presumed Chrysotile
Extent	40 m²
Licensed/non-licensed	N/A
Air Test	


Material Assessment

Product Type (a)	1
Extent of Damage (b)	0
Surface Treatment (c)	0
Asbestos Fibre (d)	1
Total (a+b+c+d)	02
Material Risk Assessment	<div></div> Very Low

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--

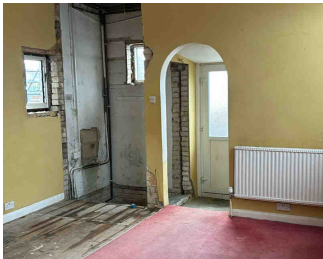


Room/location Details

Room/location Reference:	030
Room/location Description:	Back Room
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling: Plasterboard
- Walls: Brick, Plaster
- Floor: Carpet, Concrete, Timber, Vinyl-Non-Asbestos
- Doors: Plastic, Timber
- Windows: Plastic
- Comments:


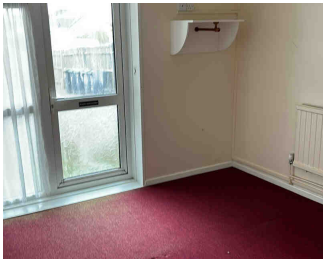


Room/location Details

Room/location Reference:	031
Room/location Description:	Room 4
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Plasterboard
- Walls:** Brick, MMMF, Plasterboard
- Floor:** Carpet, Concrete
- Doors:** Plastic, Timber
- Windows:** Plastic
- Comments:**

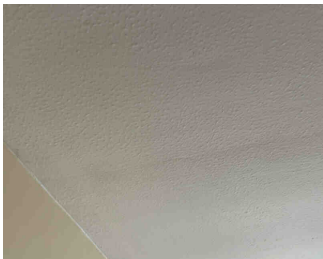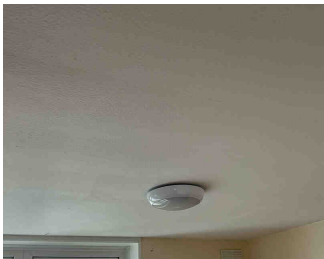

Item Detail

Item ID	011(VRS)
Sample Linked/ID	SNG36022-001
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	031
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	Strongly Presumed Chrysotile
Extent	10 m²
Licensed/non-licensed	N/A
Air Test	


Material Assessment

Product Type (a)	1
Extent of Damage (b)	0
Surface Treatment (c)	0
Asbestos Fibre (d)	1
Total (a+b+c+d)	02
Material Risk Assessment	<div></div> Very Low

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--


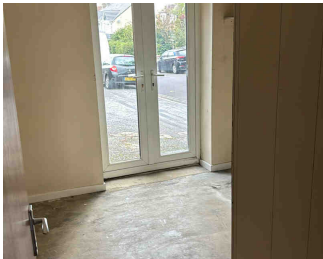


Room/location Details

Room/location Reference:	032
Room/location Description:	Room 3
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Plasterboard
- Walls:** Brick, MMMF, Plasterboard, Timber
- Floor:** Concrete
- Doors:** Plastic, Timber
- Windows:** Plastic
- Comments:**

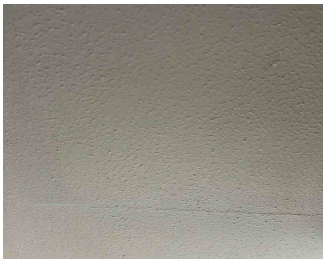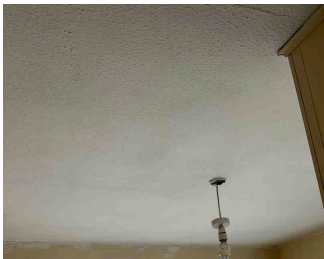

Item Detail

Item ID	012(VRS)
Sample Linked/ID	SNG36022-001
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	032
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	Strongly Presumed Chrysotile
Extent	8 m²
Licensed/non-licensed	N/A
Air Test	

Material Assessment

Product Type (a)	1
Extent of Damage (b)	0
Surface Treatment (c)	0
Asbestos Fibre (d)	1
Total (a+b+c+d)	02
Material Risk Assessment	<div></div> Very Low

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--




Room/location Details

Room/location Reference:	033
Room/location Description:	Bathroom
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Plasterboard
- Walls:** Brick, Plasterboard
- Floor:** Ceramic, Concrete
- Doors:** Timber
- Windows:** Out of scope
- Comments:**

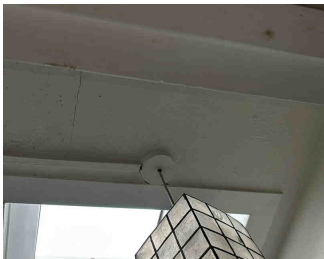

Item Detail

Item ID	013(VRS)
Sample Linked/ID	SNG36022-001
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	033
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	Strongly Presumed Chrysotile
Extent	4 m²
Licensed/non-licensed	N/A
Air Test	


Material Assessment

Product Type (a)	1
Extent of Damage (b)	0
Surface Treatment (c)	0
Asbestos Fibre (d)	1
Total (a+b+c+d)	02
Material Risk Assessment	<div></div> Very Low

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--


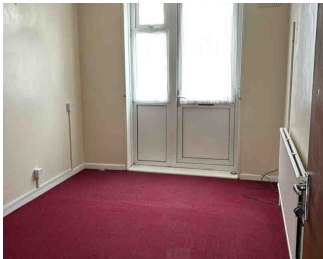


Room/location Details

Room/location Reference:	034
Room/location Description:	Room 2
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	0

Room/location Construction Details

- Ceiling: Plasterboard
- Walls: Brick, MMMF, Plasterboard
- Floor: Carpet, Concrete
- Doors: Plastic, Timber
- Windows: Plastic
- Comments:

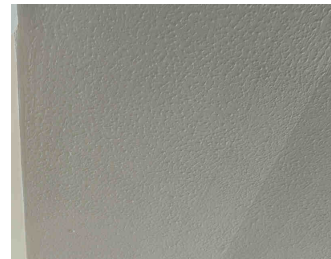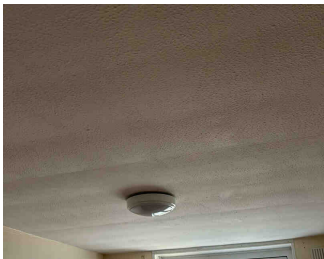

Item Detail

Item ID	014(VRS)
Sample Linked/ID	SNG36022-001
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	034
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	Strongly Presumed Chrysotile
Extent	10 m²
Licensed/non-licensed	N/A
Air Test	

Material Assessment

Product Type (a)	1
Extent of Damage (b)	0
Surface Treatment (c)	0
Asbestos Fibre (d)	1
Total (a+b+c+d)	02
Material Risk Assessment	<div></div> Very Low

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--




Room/location Details

Room/location Reference:	035
Room/location Description:	Room 1
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	0

Room/location Construction Details

Ceiling:	Plasterboard
Walls:	Brick, MMMF, Plasterboard
Floor:	Carpet, Concrete
Doors:	Plastic, Timber
Windows:	Plastic
Comments:	

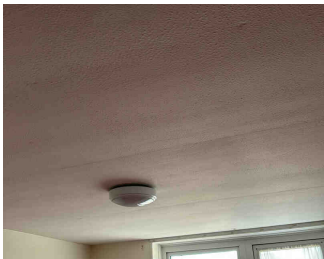

Item Detail

Item ID	015(VRS)
Sample Linked/ID	SNG36022-001
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	035
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	Strongly Presumed Chrysotile
Extent	12 m²
Licensed/non-licensed	N/A
Air Test	


Material Assessment

Product Type (a)	1
Extent of Damage (b)	0
Surface Treatment (c)	0
Asbestos Fibre (d)	1
Total (a+b+c+d)	02
Material Risk Assessment	<div></div> Very Low

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--


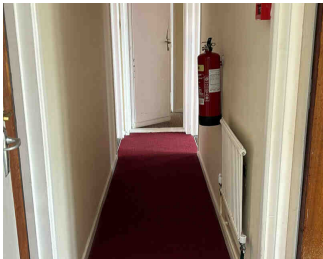


Room/location Details

Room/location Reference:	036
Room/location Description:	Hallway
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	0

Room/location Construction Details

- Ceiling: Plasterboard
- Walls: Brick, MMMF, Plasterboard
- Floor: Carpet, Concrete
- Doors: Timber, Supalux
- Windows: Out of scope
- Comments:

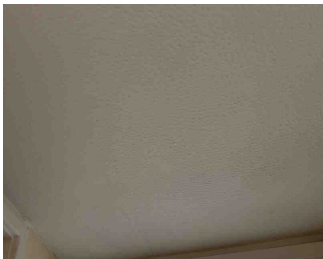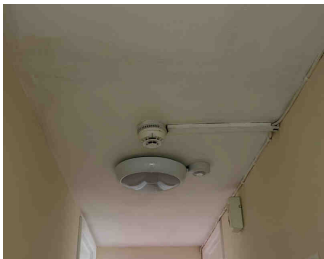

Item Detail

Item ID	016(VRS)
Sample Linked/ID	SNG36022-001
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	036
Specific location	Ceiling
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling
Asbestos type	Strongly Presumed Chrysotile
Extent	5 m²
Licensed/non-licensed	N/A
Air Test	

Material Assessment

Product Type (a)	1
Extent of Damage (b)	0
Surface Treatment (c)	0
Asbestos Fibre (d)	1
Total (a+b+c+d)	02
Material Risk Assessment	<div></div> Very Low

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--




Room/location Details

Room/location Reference:	037
Room/location Description:	Lounge Diner
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling:** Lath and Plaster, Plasterboard
- Walls:** Brick, MMMF, Plasterboard
- Floor:** Timber, Laminate
- Doors:** Timber
- Windows:** Plastic
- Comments:**

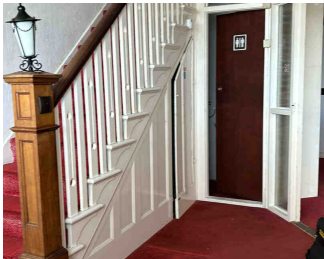


Room/location Details

Room/location Reference:	038
Room/location Description:	Hallway & Toilet
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	1

Room/location Construction Details

Ceiling:	Lath and Plaster, Plasterboard
Walls:	Brick, Plaster
Floor:	Carpet, Timber
Doors:	Timber
Windows:	Timber
Comments:	

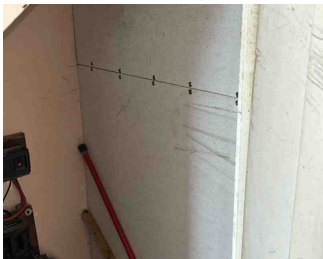

Item Detail

Item ID	018(OS)
Referenced to	SNG36022-004
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	038
Specific location	Other Lining USC
Product/debris type	Asbestos Board(s) Insulation Board Panel(s)
Asbestos type	Identified Amphibole (exc. Crocidolite) Chrysotile
Extent	5 m²
Licensed/non-licensed	N/A
Air Test	




Material Assessment

Product Type (a)	2
Extent of Damage (b)	0
Surface Treatment (c)	2
Asbestos Fibre (d)	2
Total (a+b+c+d)	06
Material Risk Assessment	<div><div></div>Low</div>

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--

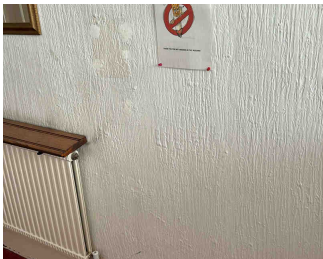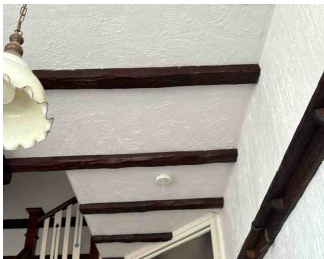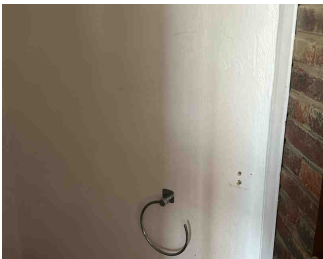

Item Detail

Item ID	017(VRS)
Sample Linked/ID	SNG36022-003
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	002
Room/location	038
Specific location	Other Ceiling and Walls
Product/debris type	Other Encapsulated Material Textured Coating To Wall and Ceiling
Asbestos type	No ACM Detected
Extent	35 m²
	<div></div> No Risk

Comments



Room/location Details

Room/location Reference:	039
Room/location Description:	Porch
Area/floor Reference:	002
Area/floor Description:	Number 9
Accessibility:	Accessible
Total ACMs:	0
Total NoACMs:	0

Room/location Construction Details

- Ceiling: MMMF, Plasterboard
- Walls: Brick, Plaster
- Floor: Concrete, Vinyl-Non-Asbestos
- Doors: Plastic, Timber
- Windows: Plastic
- Comments:



Room/location Details

Room/location Reference:	040
Room/location Description:	External
Area/floor Reference:	003
Area/floor Description:	External
Accessibility:	Accessible
Total ACMs:	1
Total NoACMs:	0

Room/location Construction Details

- Ceiling: Clay
- Walls: Brick, Render
- Floor: Concrete
- Doors: Plastic, Timber
- Windows: Plastic
- Comments:



Item Detail

Item ID	019
Item Assessment	Limited Assessment Inaccessible Item
Reason for No Access	Unable to Sample due to Height Restriction
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT
Area/floor	003
Room/location	040
Specific location	Other Flue cowl
Product/debris type	Cement Product(s) Flue Pipe
Asbestos type	Presumed Chrysotile
Extent	<1 m

Material Assessment

Product Type (a)	N/A
Extent of Damage (b)	N/A
Surface Treatment (c)	N/A
Asbestos Fibre (d)	N/A
Total (a+b+c+d)	12
Material Risk Assessment	<div></div> High

Comments

Actions/recommendations

Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC
------------------------	--


Asbestos Register




Location	Item	
Item ID	002(OS)	
Referenced to	SNG36022-001	
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT	
Area/floor	002	
Room/location	018	
Specific location	Ceiling	
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling	
Asbestos type	Identified Chrysotile	
Extent	20 m²	
Licensed/non-licensed	N/A	
Air Test		
Actions/recommendations		
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC	
		Material Assessment
		Product Type (a) 1
		Extent of Damage (b) 2
		Surface Treatment (c) 0
		Asbestos Fibre (d) 1
		Total (a+b+c+d) 04
		Material Risk Assessment <div></div> Very Low
		Comments




Location	Item	
Item ID	018(OS)	
Referenced to	SNG36022-004	
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT	
Area/floor	002	
Room/location	038	
Specific location	Other Lining USC	
Product/debris type	Asbestos Board(s) Insulation Board Panel(s)	
Asbestos type	Identified Amphibole (exc. Crocidolite) Chrysotile	
Extent	5 m²	
Licensed/non-licensed	N/A	
Air Test		
Actions/recommendations		
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC	
		Material Assessment
		Product Type (a) 2
		Extent of Damage (b) 0
		Surface Treatment (c) 2
		Asbestos Fibre (d) 2
		Total (a+b+c+d) 06
		Material Risk Assessment <div></div> Low
		Comments

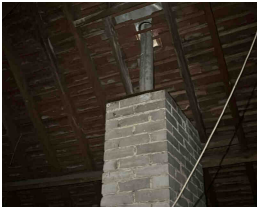

Location	Item	
Item ID	001	
Item Assessment	Limited Assessment Inaccessible Item	
Reason for No Access	Unable to Sample due to Height Restriction	
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT	
Area/floor	002	
Room/location	016	
Specific location	Other Flue from chimney breast	
Product/debris type	Cement Product(s) Flue Pipe	
Asbestos type	Presumed Chrysotile	
Extent	1 m	
Actions/recommendations		
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC	
		Material Assessment
		Product Type (a) N/A
		Extent of Damage (b) N/A
		Surface Treatment (c) N/A
		Asbestos Fibre (d) N/A
		Total (a+b+c+d) 12
		Material Risk Assessment <div></div> High
		Comments

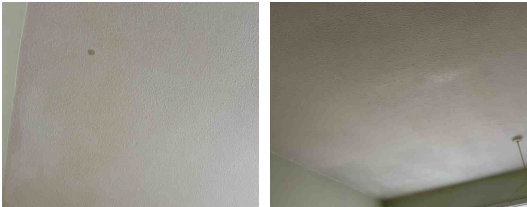



Location	Item		
Item ID	003(VRS)		
Sample Linked/ID	SNG36022-001		
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT		
Area/floor	002		
Room/location	019		
Specific location	Ceiling		
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling		
Asbestos type	Strongly Presumed Chrysotile		
Extent	8 m²		
Licensed/non-licensed	N/A		
Air Test			
Actions/recommendations			
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC		
		Material Assessment	
		Product Type (a)	1
		Extent of Damage (b)	0
		Surface Treatment (c)	0
		Asbestos Fibre (d)	1
		Total (a+b+c+d)	02
		Material Risk Assessment	<div></div> Very Low
		Comments	

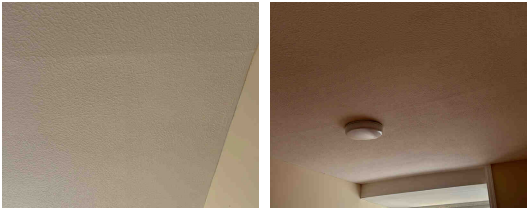



Location	Item		
Item ID	006(VRS)		
Sample Linked/ID	SNG36022-001		
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT		
Area/floor	002		
Room/location	023		
Specific location	Ceiling		
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling		
Asbestos type	Strongly Presumed Chrysotile		
Extent	25 m²		
Licensed/non-licensed	N/A		
Air Test			
Actions/recommendations			
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC		
		Material Assessment	
		Product Type (a)	1
		Extent of Damage (b)	0
		Surface Treatment (c)	0
		Asbestos Fibre (d)	1
		Total (a+b+c+d)	02
		Material Risk Assessment	<div></div> Very Low
		Comments	




Location	Item		
Item ID	009(VRS)		
Sample Linked/ID	SNG36022-001		
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT		
Area/floor	002		
Room/location	028		
Specific location	Ceiling		
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling		
Asbestos type	Strongly Presumed Chrysotile		
Extent	8 m²		
Licensed/non-licensed	N/A		
Air Test			
Actions/recommendations			
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC		
		Material Assessment	
		Product Type (a)	1
		Extent of Damage (b)	1
		Surface Treatment (c)	0
		Asbestos Fibre (d)	1
		Total (a+b+c+d)	03
		Material Risk Assessment	<div></div> Very Low
		Comments	

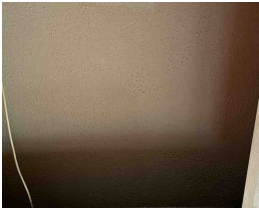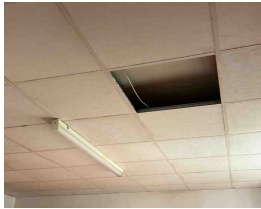

Location	Item		
Item ID	010(VRS)		
Sample Linked/ID	SNG36022-001		
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT		
Area/floor	002		
Room/location	029		
Specific location	Ceiling		
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling		
Asbestos type	Strongly Presumed Chrysotile		
Extent	40 m²		
Licensed/non-licensed	N/A		
Air Test			
Actions/recommendations			
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC		
		Material Assessment	
		Product Type (a)	1
		Extent of Damage (b)	0
		Surface Treatment (c)	0
		Asbestos Fibre (d)	1
		Total (a+b+c+d)	02
		Material Risk Assessment	<div></div> Very Low
		Comments	

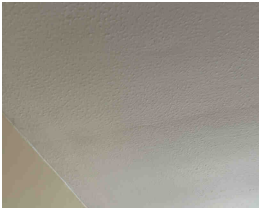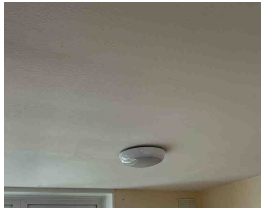



Location	Item		
Item ID	011(VRS)		
Sample Linked/ID	SNG36022-001		
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT		
Area/floor	002		
Room/location	031		
Specific location	Ceiling		
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling		
Asbestos type	Strongly Presumed Chrysotile		
Extent	10 m²		
Licensed/non-licensed	N/A		
Air Test			
Actions/recommendations			
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC		
		Material Assessment	
		Product Type (a)	1
		Extent of Damage (b)	0
		Surface Treatment (c)	0
		Asbestos Fibre (d)	1
		Total (a+b+c+d)	02
		Material Risk Assessment	<div></div> Very Low
		Comments	

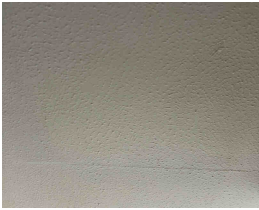


Location	Item		
Item ID	012(VRS)		
Sample Linked/ID	SNG36022-001		
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT		
Area/floor	002		
Room/location	032		
Specific location	Ceiling		
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling		
Asbestos type	Strongly Presumed Chrysotile		
Extent	8 m²		
Licensed/non-licensed	N/A		
Air Test			
Actions/recommendations			
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC		
		Material Assessment	
		Product Type (a)	1
		Extent of Damage (b)	0
		Surface Treatment (c)	0
		Asbestos Fibre (d)	1
		Total (a+b+c+d)	02
		Material Risk Assessment	<div></div> Very Low
		Comments	




Location	Item		
Item ID	013(VRS)		
Sample Linked/ID	SNG36022-001		
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT		
Area/floor	002		
Room/location	033		
Specific location	Ceiling		
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling		
Asbestos type	Strongly Presumed Chrysotile		
Extent	4 m²		
Licensed/non-licensed	N/A		
Air Test			
Actions/recommendations			
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC		
		Material Assessment	
		Product Type (a)	1
		Extent of Damage (b)	0
		Surface Treatment (c)	0
		Asbestos Fibre (d)	1
		Total (a+b+c+d)	02
		Material Risk Assessment	<div></div> Very Low
		Comments	

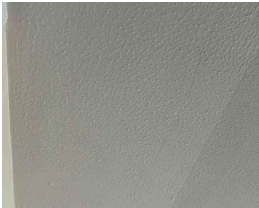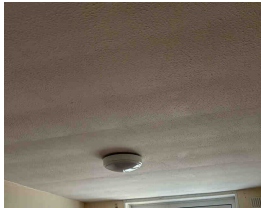

Location	Item		
Item ID	014(VRS)		
Sample Linked/ID	SNG36022-001		
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT		
Area/floor	002		
Room/location	034		
Specific location	Ceiling		
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling		
Asbestos type	Strongly Presumed Chrysotile		
Extent	10 m²		
Licensed/non-licensed	N/A		
Air Test			
Actions/recommendations			
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC		
		Material Assessment	
		Product Type (a)	1
		Extent of Damage (b)	0
		Surface Treatment (c)	0
		Asbestos Fibre (d)	1
		Total (a+b+c+d)	02
		Material Risk Assessment	<div></div> Very Low
		Comments	

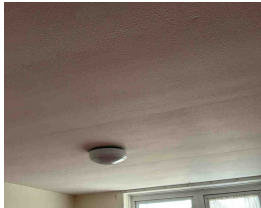

Location	Item		
Item ID	015(VRS)		
Sample Linked/ID	SNG36022-001		
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT		
Area/floor	002		
Room/location	035		
Specific location	Ceiling		
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling		
Asbestos type	Strongly Presumed Chrysotile		
Extent	12 m²		
Licensed/non-licensed	N/A		
Air Test			
Actions/recommendations			
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC		
		Material Assessment	
		Product Type (a)	1
		Extent of Damage (b)	0
		Surface Treatment (c)	0
		Asbestos Fibre (d)	1
		Total (a+b+c+d)	02
		Material Risk Assessment	<div></div> Very Low
		Comments	

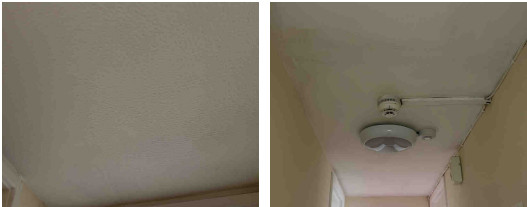

Location	Item		
Item ID	016(VRS)		
Sample Linked/ID	SNG36022-001		
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT		
Area/floor	002		
Room/location	036		
Specific location	Ceiling		
Product/debris type	Other Encapsulated Material Textured Coating To Ceiling		
Asbestos type	Strongly Presumed Chrysotile		
Extent	5 m²		
Licensed/non-licensed	N/A		
Air Test			
Actions/recommendations			
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC		
		Material Assessment	
		Product Type (a)	1
		Extent of Damage (b)	0
		Surface Treatment (c)	0
		Asbestos Fibre (d)	1
		Total (a+b+c+d)	02
		Material Risk Assessment	<div></div> Very Low
		Comments	



Location	Item		
Item ID	019		
Item Assessment	Limited Assessment Inaccessible Item		
Reason for No Access	Unable to Sample due to Height Restriction		
Property Name	Specified areas of -7-9 London Road, Widley Waterlooville, Hampshire, PO7 5AT		
Area/floor	003		
Room/location	040		
Specific location	Other Flue cowl		
Product/debris type	Cement Product(s) Flue Pipe		
Asbestos type	Presumed Chrysotile		
Extent	<1 m		
Actions/recommendations			
Action/recommendations	Remove Remove ACM before Refurb. Work under FCC by FLC		
		Material Assessment	
		Product Type (a)	N/A
		Extent of Damage (b)	N/A
		Surface Treatment (c)	N/A
		Asbestos Fibre (d)	N/A
		Total (a+b+c+d)	12
		Material Risk Assessment	<div></div> High
		Comments	

Survey Results

Summary of Remedial or Removal Works

Item	Sample	Product/debris Type	Area/floor	Room/location	Action/recommendations
002	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	018	Remove Remove ACM before Refurb. Work under FCC by FLC
018	SNG36022-004	Asbestos Board(s) Insulation Board Panel(s)	002	038	Remove Remove ACM before Refurb. Work under FCC by FLC
001		Cement Product(s) Flue Pipe	002	016	Remove Remove ACM before Refurb. Work under FCC by FLC
003	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	019	Remove Remove ACM before Refurb. Work under FCC by FLC
006	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	023	Remove Remove ACM before Refurb. Work under FCC by FLC
009	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	028	Remove Remove ACM before Refurb. Work under FCC by FLC
010	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	029	Remove Remove ACM before Refurb. Work under FCC by FLC
011	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	031	Remove Remove ACM before Refurb. Work under FCC by FLC
012	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	032	Remove Remove ACM before Refurb. Work under FCC by FLC
013	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	033	Remove Remove ACM before Refurb. Work under FCC by FLC
014	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	034	Remove Remove ACM before Refurb. Work under FCC by FLC
015	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	035	Remove Remove ACM before Refurb. Work under FCC by FLC
016	SNG36022-001	Other Encapsulated Material Textured Coating To Ceiling	002	036	Remove Remove ACM before Refurb. Work under FCC by FLC
019		Cement Product(s) Flue Pipe	003	040	Remove Remove ACM before Refurb. Work under FCC by FLC

Assessment Information

Material Risk Assessment Algorithm

Material assessments consider the type and condition of the ACM and the ease with which it will release fibres when subject to disturbance. The main parameters are:

- a. Product Type
- b. Extent of Damage & Deterioration
- c. Surface Treatments
- d. Asbestos Types

The material assessment will give a good initial guide to the priority for management as it will identify the materials which will most readily release airborne fibres if disturbed. It does not automatically follow that those materials assigned the highest score will be the priority for remedial action, such priorities must be determined by conducting and subsequently considering the results of a priority assessment.

To achieve some form of standardisation of the risk rating and action level, the assessment algorithm contained within HSG264 has been adopted, which is based upon a numerical rating given to each of the parameters considered above. The addition of each number results in a score that falls into one of four possible risk categories, which can assist the duty holder to prioritise the need for action as part of the plan for managing asbestos.

Assessment Factor	Score	Score Variables
Product Type (a)	1	Asbestos Reinforced Composites (Plastics, Resins, Mastics, Roofing Felts, Vinyl Floor Tiles, Semi-Rigid Paints, Decorative Finishes, Asbestos Cement)
	2	Asbestos Insulating Board (AIB), Millboards, Other Low-Density Insulation Boards, Asbestos Textiles, Gaskets, Ropes, Woven Textiles and Asbestos Paper or Felt
	3	Thermal Insulating (e.g. Pipe and Boiler Lagging) Sprayed Asbestos, Loose Asbestos, Asbestos Mattresses and Packing
Extent of Damage (b)	0	Good Condition: No Visible Damage
	1	Low Damage: A Few Scratches or Surface Marks, Broken Edges on Boards or Tiles
	2	Medium Damage: Significant Breakage of Material or Several Small Areas where Material has been Damaged Revealing Loose Asbestos Fibre
	3	High Damage: Delaminating of Materials, Sprays and Thermal Insulation, Visible Asbestos Debris
Surface Treatment (c)	0	Composite Materials Containing Asbestos: Reinforced Plastics, Resins, Vinyl Tiles
	1	Enclosed Sprays and lagging, AIB with Exposed Face Painted or Encapsulated, Asbestos Cement Sheets etc
	2	Unsealed AIB or Encapsulated Lagging and Sprays
	3	Unsealed Lagging and Sprays
Asbestos Type (d)	1	Chrysotile (White)
	2	Amphibole Asbestos, Amosite (Brown), Actinolite, Anthophyllite and Tremolite
	3	Crocidolite (Blue)

Assessment Information

Material Classifications

The following material assessment categories are used within this survey and indicate the level of hazard each material presents.

(10≥) High

ACMs in this category are regarded as having a significant potential to release fibres if disturbed. Such ACMs require urgent consideration to ensure people are not exposed to the hazard. In most circumstances plans for removal should be implemented and in the interim, the affected area should be sealed off.

(7-9) Medium

ACMs within this category do not always pose an imminent threat and the likelihood of fibre release is moderate under existing conditions. A decision regarding how these ACMs are to be managed should be made promptly and most likely as part of an overall management plan. Such situations should be regularly inspected to ascertain any change to circumstances unless serious damage is present or debris is visible, then this will require action which could involve removal or encapsulation.

(5-6) Low

ACMs within this category should be regarded as providing a low risk to people exposed to them but precautions should be followed and the situation should be monitored through regular re-inspections to ascertain any deterioration in condition which may occur with the passage of time. These ACMs generally have no or very little sign of historic damage.

(≤4) Very Low

ACMs within this category do not generally present a significant risk. They should be managed and only considered to be removed if the item falls within a refurbishment and demolition area and the works are likely to disturb the material.

(0) No Risk

No ACM present.

Survey Appendices

Remedial Options

There are a variety of remedial options available. In many cases the ACMs can be protected or enclosed, sealed or encapsulated, or repaired and these options should be considered first. Where such actions are not practical, ACMs should be removed. Recommended action in the Refurbishment Survey will normally involve one or more of the following:

Removal

ACMs vulnerable to damage should often be removed. Where they are in such poor condition, removal is often the only practical option. Removal is required where refurbishment or demolition works are planned that will impinge on the ACMs present.

Management

Management of the ACMs present (where these are not in poor condition or vulnerable to damage) is achieved by labelling, registering and monitoring as necessary. Such management should be undertaken in compliance with CAR 2012.

Monitor

Re-inspection of ACMs should be undertaken at regular intervals determined by the risk priority and by a trained, suitably experienced and competent person. This may be accompanied by air testing where relevant to determine whether any asbestos fibres are present.

Label

Where an ACM is detected, regardless of its risk categorisation, it is recommended that approved industry specific warning labels are positioned to prevent accidental damage to the material.

Protection/enclosure

Undertake enclosure where the ACM is in poor condition or vulnerable to damage. This involves protection by a physical barrier, such as a timber casing. The casing is sealed and as airtight as possible to prevent the migration of fibres.

Sealed/encapsulate

There are two methods of encapsulation: applying a durable layer adhered to the surface of the ACM, or applying a material that penetrates the ACM before hardening which locks the material together.

Repair

All repairs should be undertaken by a competent person with the relevant training and equipment. Repair should only be undertaken if the damage is slight. There are a number of methods including filling, wrapping and isolated encapsulation. All repairs will be carried out using non-asbestos containing materials and appropriate precautions undertaken to prevent the release of any asbestos fibres.

Remove

The HSE recommend against removal of asbestos if the removal is undertaken without due consideration of the potential to increase the risk of harm. ACMs should be removed where found to be in poor condition, if it is not possible to undertake maintenance works without disturbance, or refurbishment works are due to be undertaken. Only HSE licensed contractors may be appointed to deal with work that contains 'high risk' ACMs.

Periodic Air Test

Where there is a large amount of ACMs in a confined space with a history of unauthorised disturbance, periodic air tests may be undertaken to monitor asbestos fibre levels to confirm that it is safe to access the area.

Survey Appendices

Regulations and Guidance

Legislation

The Health & Safety at Work Act (1974) and The Management of Health and Safety at Work Regulations (1999) collectively require employers to provide a safe workplace for all their employees and those affected by their activities.

Asbestos specifically and work with asbestos is covered by specialist regulations known as The Control of Asbestos Regulations 2012 (CAR 2012). The duty to manage requires those in control of the premises to:

1. Take reasonable steps to determine the location and condition of ACMs.
2. Presume materials contain asbestos unless there is strong evidence that they do not.
3. Set up and maintain a record of the location and condition of the ACMs or presumed ACMs in premises.
4. Assess the risk of the likelihood of anyone being exposed to fibres from these ACMs.
5. Prepare a plan setting out how the risks from the ACMs are to be managed.
6. Take the necessary steps to put the plan into action.
7. Review and monitor the plan periodically.
8. Provide information on the location and condition of the materials to anyone who is liable to work on or disturb them.

Approved Codes of Practice and Guidance Documents

There is a raft of publications that disseminate advice and information relating to asbestos which should be consulted by those who work with or have an obligation to manage ACMs (please note this list is not exhaustive).

1. L143 'Managing and Work with asbestos'
2. HSG210 'Asbestos essentials task manual'
3. HSG227 'A comprehensive guide to managing asbestos in premises'
4. HSG247 'Asbestos: The licensed contractors' guide'
5. HSG248 'Asbestos: The analysts' guide for sampling, analysis and clearance procedures'
6. HSG264 'Asbestos: The survey guide'
7. INDG223 'Managing asbestos in building: A brief guide'

The HSE has also published 38 'Asbestos essentials task sheets' and 10 'Equipment and Method sheets' which can help ensure compliance with CAR 2012 and illustrate 'good practice'.



CERTIFICATE FOR IDENTIFICATION OF ASBESTOS FIBRES

PREMIUM
EMERGENCY

Client:	SUPERNOVA GROUP
Address:	71-75 SHELTON STREET COVENT GARDEN LONDON WC2H 9JQ
Attention:	TECHNICAL MANAGER
Site Address:	7-9 LONDON ROAD
Date sample taken:	UNKNOWN
Date sample received:	07/10/24
Date of Analysis:	07/10/24

Analysis Report No.

SCO/24/30621

Report Date.

07/10/24

Site Ref No.

SNG36022

Page No:

1 Of 1

No. of Samples:

4

Obtained:

DELIVERED

Samples of material, referenced below, have been examined to determine the presence of asbestos fibres, using Scopes Asbestos Analysis "in house" method of transmitted/polarised light microscopy and centre stop dispersion staining, based on HSE's HSG248.
If samples have been DELIVERED the site address and actual sample location is as given by the client at the time of delivery. Scopes Asbestos Analysis Services Limited are not responsible for the accuracy or competence of the sampling by third parties. Under these circumstances Scopes Asbestos Analysis Services Limited cannot be held responsible for the interpretation of the results shown. Results relate only to the items tested.

SCOPE SAMPLE No.	CLIENT SAMPLE No.	Sample Location	Fibre Type Detected
1	001	ROOM 8 – TEXTURED COATING TO CEILING	CHRYSTILE
2	002	ROOM 1 – TEXTURED COATING TO CEILING	NADIS
3	003	LANDING + STAIRS – TEXTURED COATING TO WALL	NADIS
4	004	UNDERSTAIRS CUPBOARD – INSULATION BOARD	AMOSITE/CHRYSTILE

KEY: NADIS – No Asbestos Detected in Sample

Note: All samples will be retained for a minimum of six months. Reports & Records are retained for a minimum of 5 years.

Note: This Certificate for Identification of Asbestos Fibres shall not be reproduced except in full without the written approval of the Laboratory.

Note: All Analysis is performed in House on the registered premises (below).

Note: Where an 'A' appears at the end of the analysis report number this means an amendment has been made to the original report. Information that has been amended will be marked with an *

Analysed by:	T CROOT	Authorised signatory:	
		Print name:	S.BOLTON – Q.C.M

BULK 001-VER 8 14-JUN-22-QCM

Unit 14 Britannia Court, Burnt Mills Industrial Estate, Basildon, Essex, SS13 1EU
Tel: 01268 724785 **Fax:** 01268 724796 **Mob:** 07765 685132 **E-Mail:** enquiries@scopesaasl.co.uk

Company Reg No: 5191390 Reg Address: As above