

Tree protection plan
Location of trees, categorisation & protection/management proposals

Harbour Place (former Forty Acres Farm), Havant
Road, Bedhampton, Hampshire



Barrell Plan Ref: 10270-5




barrell
TREE CONSULTANCY

Permission is granted to scale from this drawing for Local Authority Planning Approval purposes relating to tree protection measures only. Where applicable this drawing is to be read in conjunction with the arboricultural report. This drawing is the copyright of Barrell Tree Consultancy 2021. ©

This drawing is to be reproduced in colour only.
www.barrelltreecare.co.uk

-  BS category B Trees of moderate quality
-  BS category C Trees of low quality
-  BS category U Trees unsuitable for retention
-  Trees to be removed
-  Proposed layout
-  Boundary Line
-  Estimated tree positions not included on original land survey and/or adjusted crown spreads
-  Construction exclusion zone (CEZ) to be protected by fencing and/or ground protection
-  Construction exclusion zone (CEZ) to be protected by fencing and/or ground protection
-  Root protection area (RPA) boundaries for category A and B trees
-  Root protection area (RPA) boundaries for category C trees

Proposed drainage route to be installed through this gap created by the loss of two dead trees. Two additional trees proposed for removal to create 6m easement are subject to a separate TPO application.

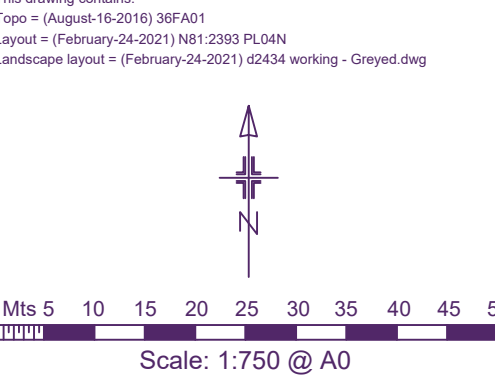

Tree No	Species	Category	RPA Radius	Tree Works
All retained trees				Carry out safety check and lift over site to 3.4m as necessary.
G1	Sycamore	B	4.8	-
G2	Sycamore, cherry, ash, elm, hawthorn	C	3.6	Fell part
G3	White poplar	B	3.6	-
T4	Purple plum	C	5.4	-
G5	Alder	B	3.6	Fell one tree
G6	Alder	C	3.0	Fell
G7	Alder	C	3.0	Fell
G8	Alder	B	4.2	Fell one tree
G9	Sycamore, ash, alder	B	4.8	-
G10	Alder	B	4.2	-
G11	Alder	B	4.8	Fell part
T12	Alder	C	3.6	-
T13	Alder	C	3.0	-
T14	Alder	C	3.0	Fell
G15	Alder	C	4.2	Fell
T16	Hawthorn	C	1.8	Fell
T17	Alder	U	4.2	Fell for management
T18	Alder	C	3.0	Fell
T19	Hawthorn	C	1.8	Fell
T20	Alder	C	1.2	Fell
T21	Ash	C	1.2	Fell
T22	Alder	U	2.4	Fell for management
T23	Alder	C	1.8	Fell
T24	Alder	U	2.4	Fell for management
T25	Alder	U	3.0	Fell
T26	Alder	C	3.6	Fell
T27	Alder	U	3.6	Fell for management
G28	Alder	C	3.6	Fell
G29	Alder	B	3.6	-
G30	Alder	B	3.6	-
T31	Goat willow	C	4.2	-
T32	Alder	U	3.0	Fell for management
T33	Alder	U	3.0	Fell for management
T34	Alder	C	3.0	-
G35	Alder	C	3.6	-
G36	Elm	C	3.0	-
G37	Elm, alder, willow	C	3.6	Fell part
G38	Elm	C	3.0	-
G39	Alder	C	3.0	-
T40	Alder	U	3.0	Fell for management
T41	Alder	U	3.0	Fell for management
G42	Lime	C	2.4	Fell
G43	Alder	B	3.0	Fell
G44	Shrub sp	C	1.2	Fell
G45	Hawthorn	C	3.0	Fell
G46	Hawthorn	C	3.0	Fell
G47	Hawthorn	C	2.4	Fell
G48	Alder	C	3.6	-
G49	Alder	U	2.4	Fell for management
G50	Alder	U	2.4	Fell for management
G51	Alder	C	2.4	Fell part
G52	Alder	B	3.0	Fell part
G53	Elm	C	2.4	Fell
T54	Hawthorn	C	1.8	Fell
G55	Elder	C	2.4	Fell
T56	Elder	C	4.8	-
G57	Alder	C	2.4	-
T58	Palm	C	2.4	-
T59	Maple	C	2.4	-
T60	Walnut	C	3.0	-
T61	Lawson cypress	C	3.0	-
G62	Alder	B	4.8	-
G63	Alder	U	3.6	Fell for management
G64	Alder	C	1.8	-
G65	Goat willow	C	3.6	-
T66	Goat willow	C	4.2	-
G67	Alder	U	2.4	Fell for management

SGN 1 Monitoring tree protection



Always:

- have a pre-commencement meeting with the tree consultant before development starts
- use the tree consultant to regularly check that protection remains fit for purpose
- use the tree consultant to supervise work in RPAs
- keep a written record of supervision




SGN 11 Installing services in RPAs



Always:

- use the tree consultant to supervise work in RPAs
- select the least damaging option when installing services, so prioritise trenchless, over broken trench over continuous trench
- hand-dig trenches if trenchless is not feasible

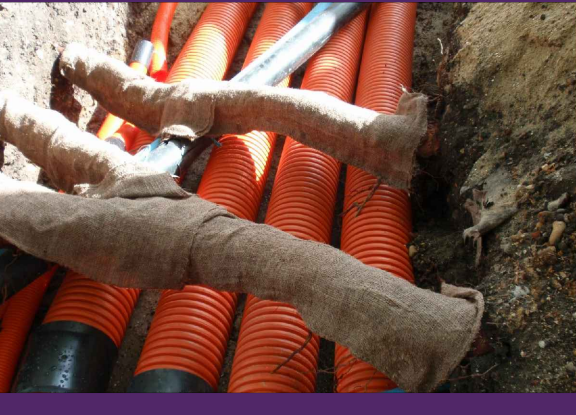

SGN 2 Fencing protected trees



Always:

- install protection before development starts
- make sure protection is fit for purpose, i.e. it prevents damage to trees and soil
- keep protection in place until there is no risk to trees
- get written permission to move or remove any protection



SGN 12 Landscaping in RPAs



Always:

- use the tree consultant to supervise work in RPAs
- avoid raising ground levels within 1m of the trunks of retained trees



SGN 4 Pollution control



Always:

- keep toxic products away from RPAs



How to use plan

More detailed guidance on each Site Guidance Note (SGN) can be found in a printed hard copy compilation of all the SGNs, *Manual for Managing Trees On Development Sites* version 2.1, issued to the Site Manager at the pre-commencement site meeting. (Note: This should be retained on site throughout the duration of works). Additionally, an electronic pdf compilation of all the SGNs, was submitted with this drawing to the local planning authority and the client. Alternatively, a pdf of each SGN can be downloaded by:

- clicking the image links in the electronic pdf version of this plan;
- holding a mobile phone QR (Quick Response) code reader over the QR code in the paper version of this plan; or,
- visiting our website at <https://www.barrelltreecare.co.uk/resources/technical-guidance>