


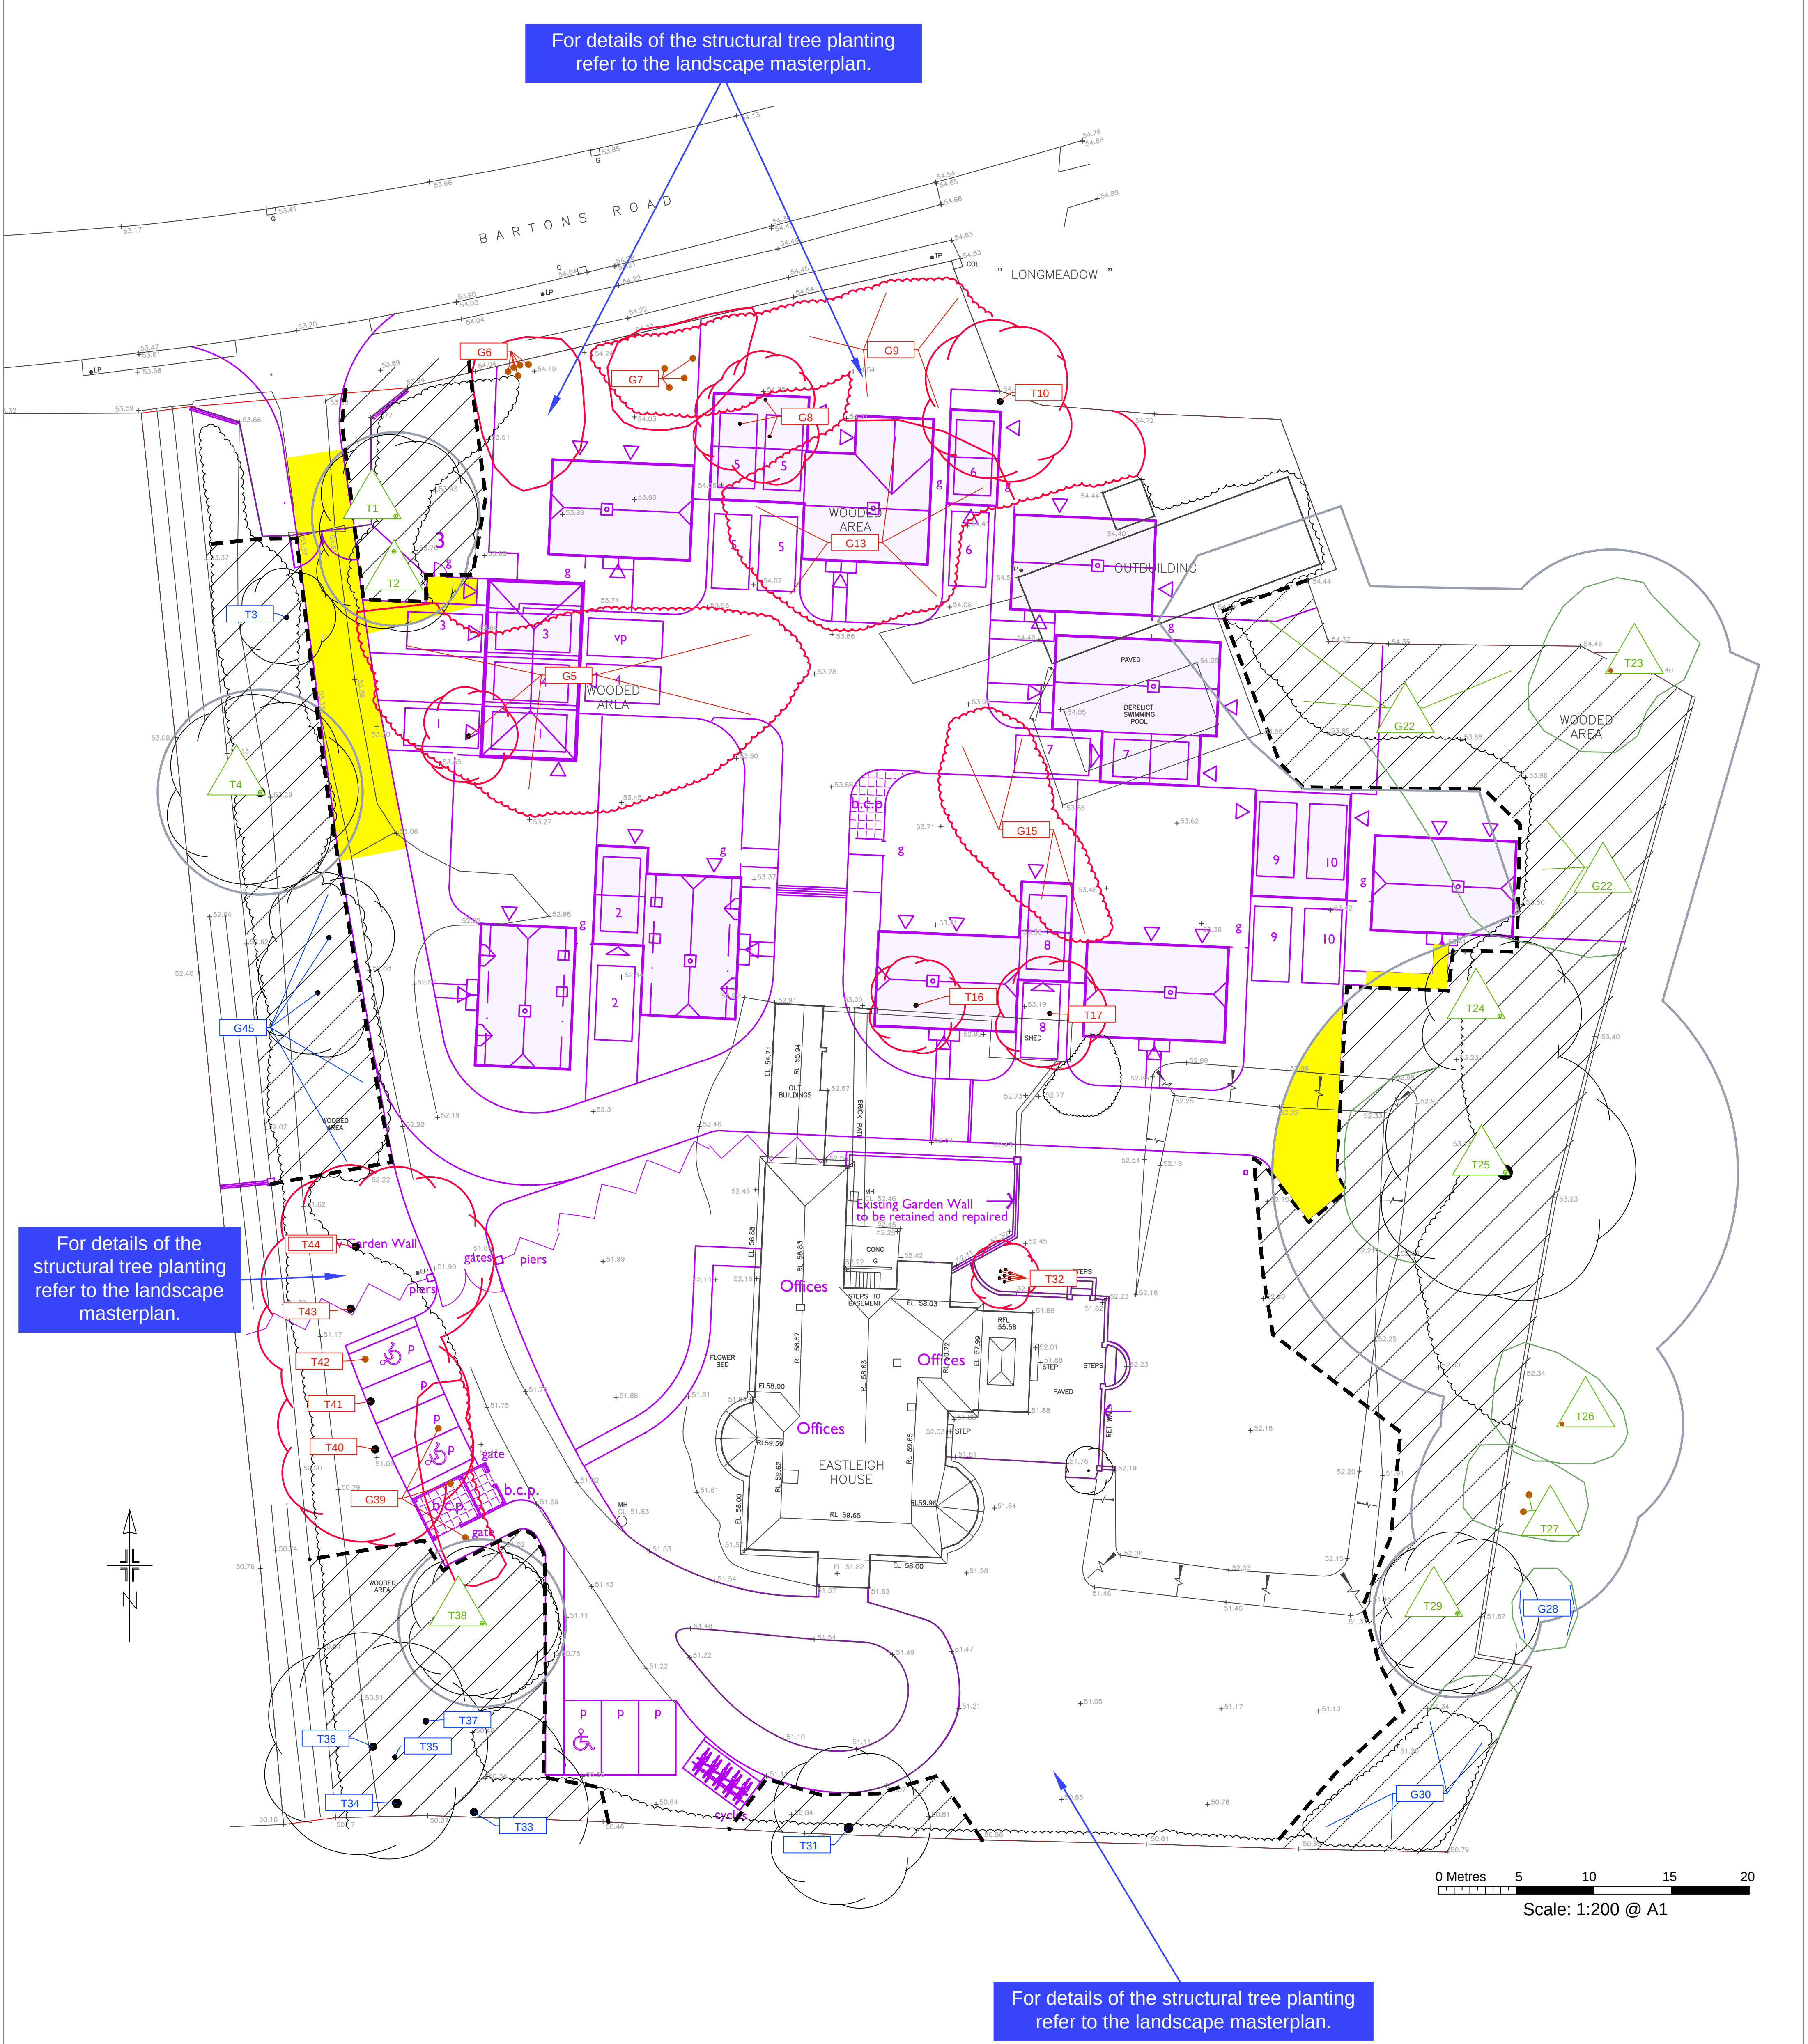

**Tree protection plan**  
Location of trees, categorisation & protection/management proposals at East Leigh House, Bartons Road, Havant

Permission is granted to scale from this drawing for Local Authority Planning Approval purposes relating to tree protection measures only. Where applicable this drawing is to be read in conjunction with the arboricultural report. This drawing is the copyright of Barrell Tree Consultancy 2016. ©

This drawing to be reproduced in colour only.

Barrell Plan Ref: 15362-BT2

Provided Plan Refs: 12852 & 14-1096-050

**barrell**  
TREE CONSULTANCY

Field House, Fordingbridge Business Park,  
Ashford Road, Fordingbridge SP6 1BY  
Tel: 01425 651470 Fax: 01425 653449  
www.barrelltreecare.co.uk

| Tree Schedule               |                                   |          |            |                                                                 |   |   |   |   |   |
|-----------------------------|-----------------------------------|----------|------------|-----------------------------------------------------------------|---|---|---|---|---|
| Tree No                     | Species                           | Category | RPA Radius | Tree Works                                                      |   |   |   |   |   |
| All retained trees & hedges |                                   |          |            | Carry out safety check and lift over site to 3-4m as necessary. |   |   |   |   |   |
| T1                          | Sycamore                          | B        | 5.4        | -                                                               | - | - | - | - | - |
| T2                          | Sycamore                          | B        | 4.8        | -                                                               | - | - | - | - | - |
| T3                          | Yew                               | C        | 4.8        | -                                                               | - | - | - | - | - |
| T4                          | Yew                               | B        | 6.6        | -                                                               | - | - | - | - | - |
| G5                          | Yew, laurel, cypress, bay, cherry | C        | 6.0        | Fell                                                            | - | - | - | - | - |
| G6                          | Sycamore                          | C        | 8.4        | Fell                                                            | - | - | - | - | - |
| G7                          | Sycamore                          | C        | 7.2        | Fell                                                            | - | - | - | - | - |
| G8                          | Acacia                            | C        | 3.0        | Fell                                                            | - | - | - | - | - |
| G9                          | Sycamore                          | C        | 5.4        | Fell                                                            | - | - | - | - | - |
| T10                         | Acacia                            | C        | 6.6        | Fell                                                            | - | - | - | - | - |
| G13                         | Laurel, bay, buddleia             | C        | 3.6        | Fell                                                            | - | - | - | - | - |
| G15                         | Laurel, goat willow               | C        | 7.2        | Fell                                                            | - | - | - | - | - |
| T16                         | Ash                               | C        | 4.8        | Fell                                                            | - | - | - | - | - |
| T17                         | Beech                             | C        | 3.6        | Fell                                                            | - | - | - | - | - |
| G22                         | Bay, holly, sycamore, yew, oak    | B        | 7.2        | -                                                               | - | - | - | - | - |
| T23                         | Yew                               | B        | 7.8        | -                                                               | - | - | - | - | - |
| T24                         | Oak                               | B        | 3.6        | -                                                               | - | - | - | - | - |
| T25                         | Cedar                             | B        | 15.0       | -                                                               | - | - | - | - | - |
| T26                         | Sycamore                          | B        | 7.8        | -                                                               | - | - | - | - | - |
| All retained trees & hedges |                                   |          |            | Carry out safety check and lift over site to 3-4m as necessary. |   |   |   |   |   |
| T27                         | Sycamore                          | B        | 7.2        | -                                                               | - | - | - | - | - |
| G28                         | Sycamore                          | C        | 6.0        | -                                                               | - | - | - | - | - |
| T29                         | Ash                               | B        | 5.4        | -                                                               | - | - | - | - | - |
| G30                         | Lime, cherry, ash, cypress        | C        | 12.0       | -                                                               | - | - | - | - | - |
| T31                         | Cherry                            | C        | 7.2        | -                                                               | - | - | - | - | - |
| T32                         | Bay                               | C        | 15.0       | Fell                                                            | - | - | - | - | - |
| T33                         | Poplar                            | C        | 6.0        | -                                                               | - | - | - | - | - |
| T34                         | Poplar                            | C        | 7.2        | -                                                               | - | - | - | - | - |
| T35                         | Poplar                            | C        | 3.6        | -                                                               | - | - | - | - | - |
| T36                         | Monterey cypress                  | C        | 6.0        | -                                                               | - | - | - | - | - |
| T37                         | Monterey cypress                  | C        | 5.4        | -                                                               | - | - | - | - | - |
| T38                         | Western red cedar                 | B        | 5.4        | -                                                               | - | - | - | - | - |
| G39                         | Western red cedar, cypress        | C        | 4.2        | Fell                                                            | - | - | - | - | - |
| T40                         | Poplar                            | C        | 7.2        | Fell                                                            | - | - | - | - | - |
| T41                         | Poplar                            | C        | 5.4        | Fell                                                            | - | - | - | - | - |
| T42                         | Poplar                            | C        | 5.4        | Fell                                                            | - | - | - | - | - |
| T43                         | Poplar                            | C        | 5.4        | Fell                                                            | - | - | - | - | - |
| T44                         | Poplar                            | U        | 7.2        | Fell for management                                             | - | - | - | - | - |
| G45                         | Sycamore, cherry                  | C        | 5.4        | -                                                               | - | - | - | - | - |

BS category B Trees of moderate quality

BS category C Trees of low quality

BS category U Trees unsuitable for retention

Trees to be removed

Proposed layout

Estimated tree positions not included on original land survey and/or adjusted crown spreads

Construction exclusion zone (CEZ) to be protected by fencing and/or ground protection

Precautionary area where new surfacing will be installed using a three dimensional cell base and porous wearing course

Root protection area (RPA) boundaries for category B trees