


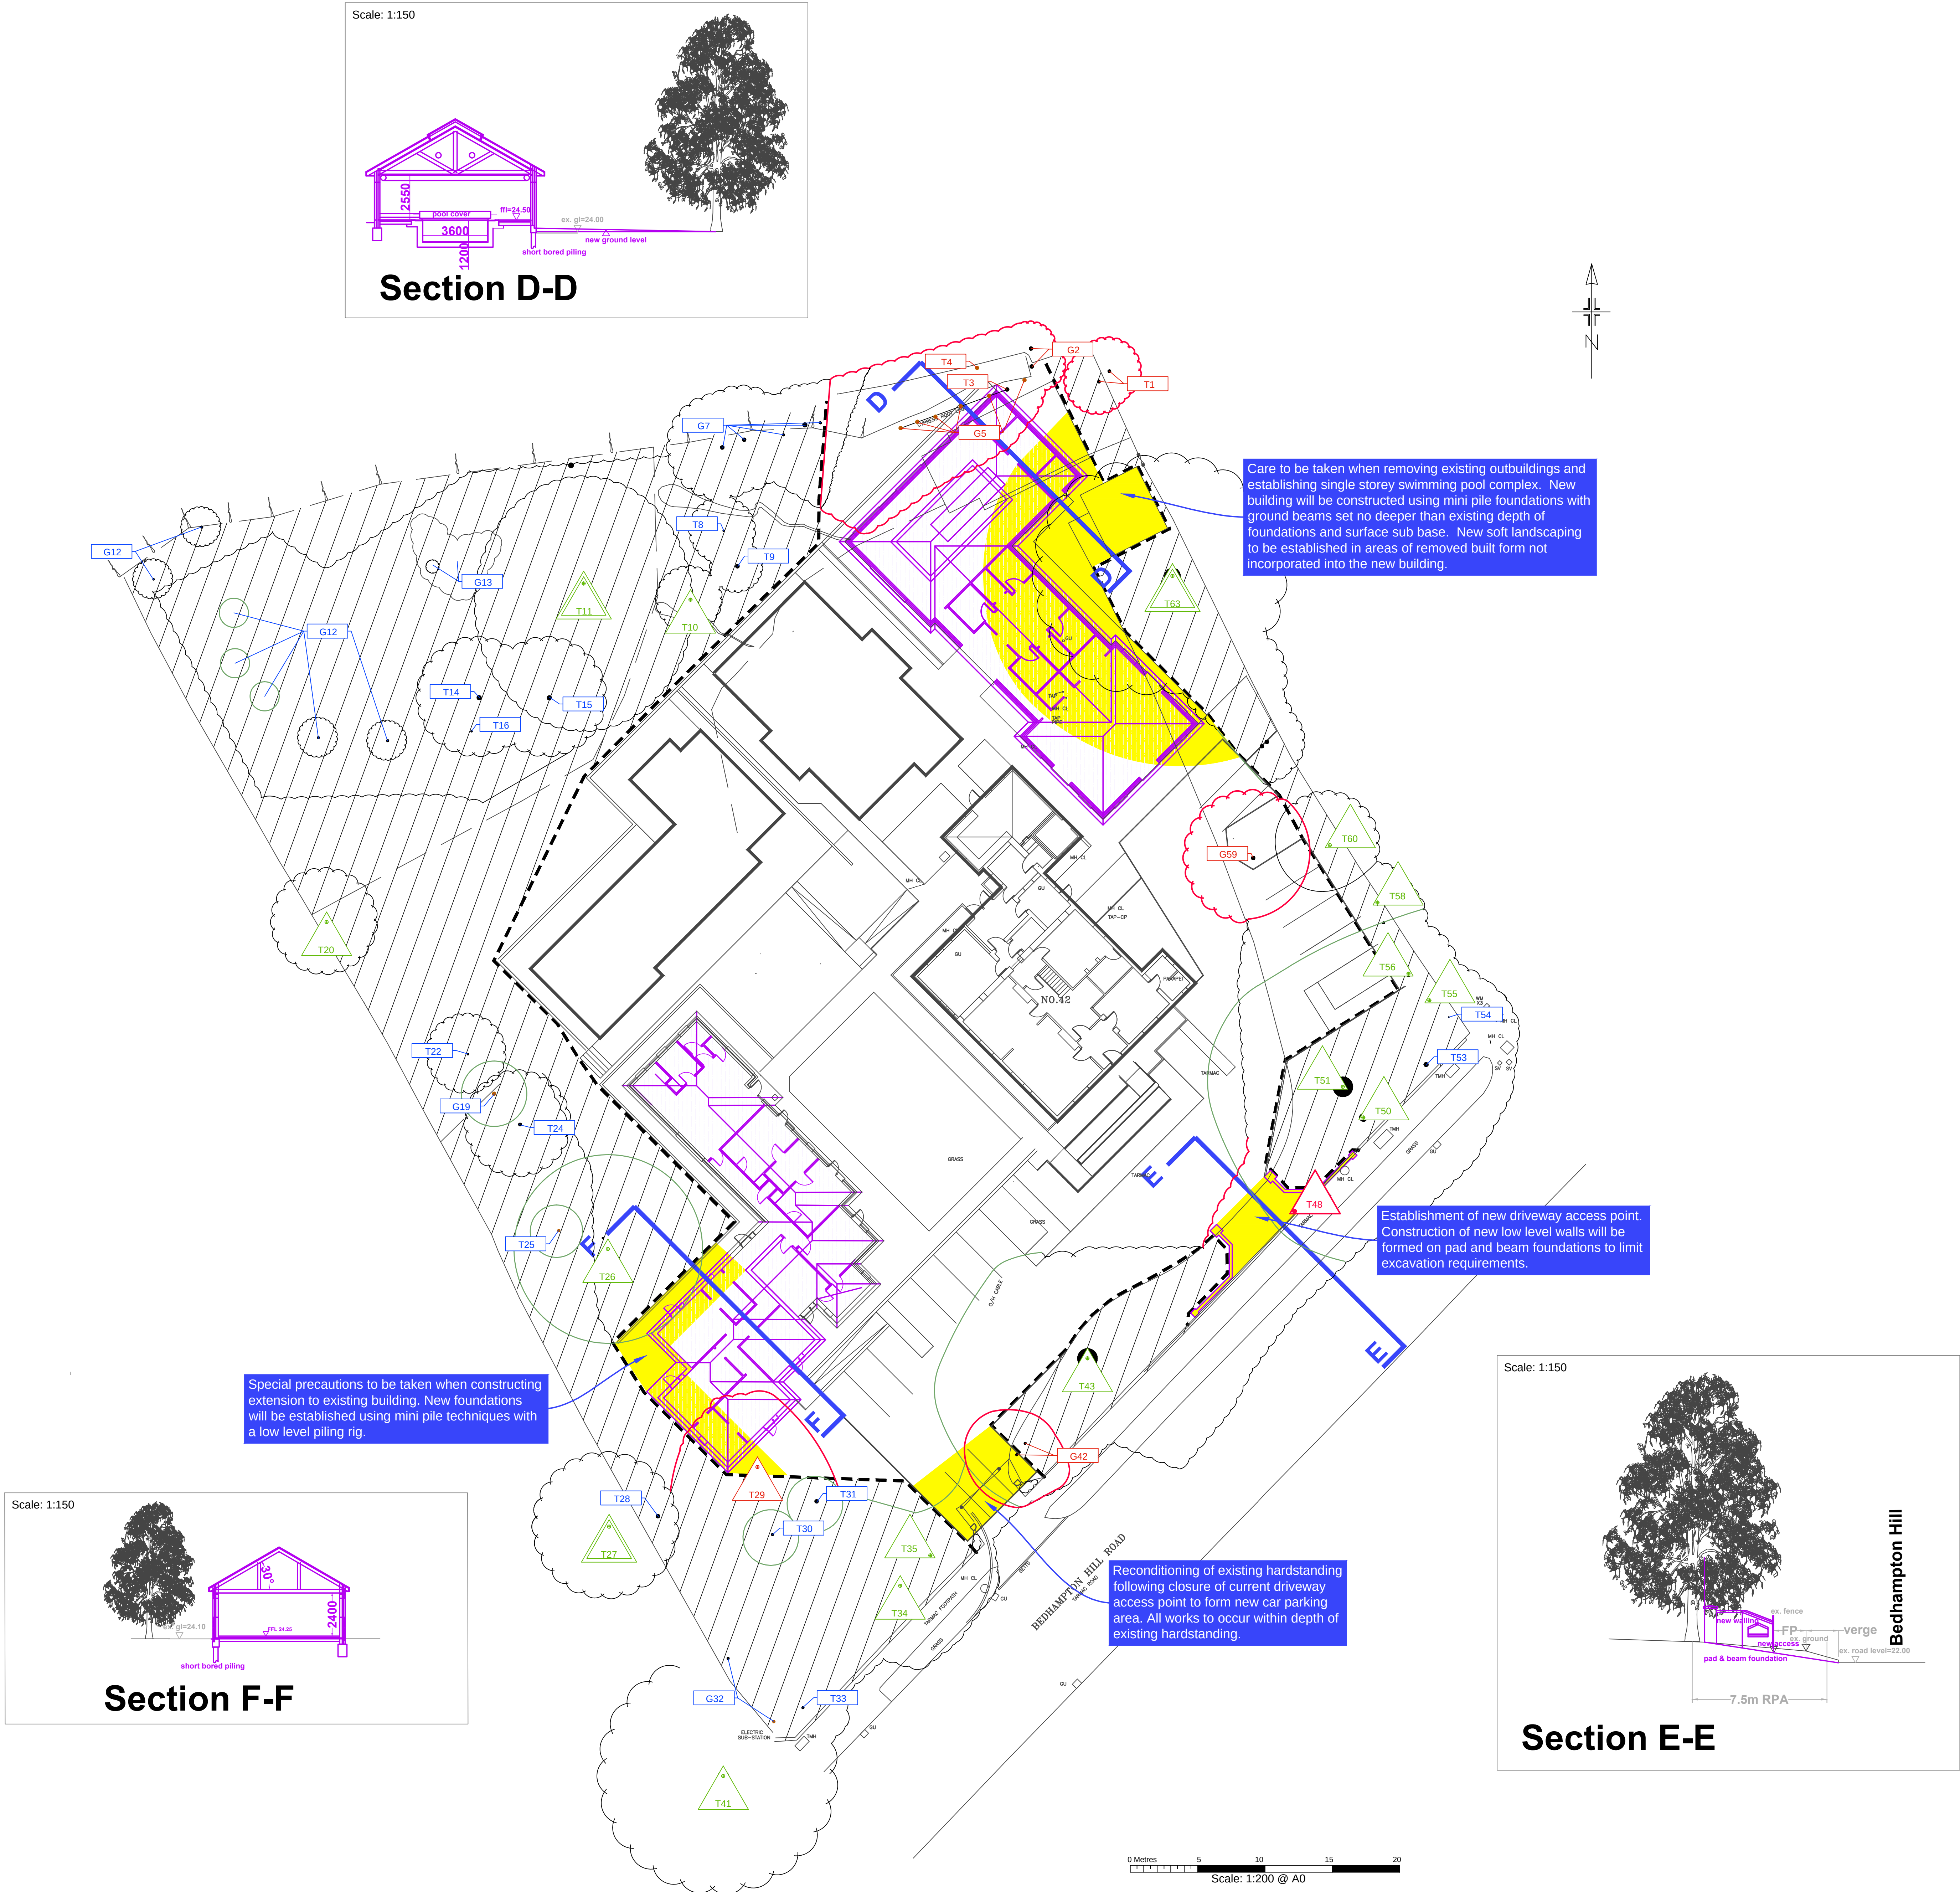

- BS category A Trees of high quality
- BS category B Trees of moderate quality
- BS category C Trees of low quality
- BS category U Trees unsuitable for retention
- Trees to be removed
- Proposed layout
- Estimated tree positions not included on original land survey and/or adjusted crown spreads
- Construction exclusion zone (CEZ) to be protected by fencing and/or ground protection
- Precautionary Area
 - Removal of existing structures
 - Construction of new structures on piled foundations
 - Construction of new driveway entrance
 - Reconditioning existing surfacing
 - Installation of new soft landscape

Tree schedule				
Tree No	Species	Category	RPA Radius	Tree Works
T1	Fruit	C	4.8	Fell
G2	Fruit	C	3.0	Fell
T3	Sycamore	C	3.9	Fell
T4	Sycamore	C	3.0	Fell
G5	Cypress	C	4.8	Fell
G7	Fruit	C	4.2	-
T8	Hazel	C	4.2	-
T9	Sycamore	C	4.5	-
T10	Plum	B	4.8	-
T11	Beech	A	11.7	-
G12	Holm oak, ash, oak, fruit	C	3.0	-
G13	Sycamore	C	3.0	-
T14	Norway maple	C	4.5	-
T15	Sycamore	C	5.7	-
T16	Oak	C	1.8	-
T20	Elm	B	3.9	-
T22	Acacia	C	2.1	-
T24	Acacia	C	3.6	-
T25	Cypress	C	6.0	-
T26	Sycamore	B	8.1	-
T27	Sycamore	A	12.6	-
T28	Cypress	C	4.8	-
T29	Holly	B	5.7	Fell
T30	Bay	C	5.4	-
T31	Holly	C	3.3	-
G32	Sycamore	C	1.8	-
T33	Sycamore	C	2.4	-
T34	Hornbeam	B	4.5	-
T35	Lime	B	4.8	-
T41	Beech	B	10.8	-
G42	Purple plum, bay	C	3.0	Fell
T43	Monterey cypress	B	15.0	-
T46	Fruit	C	3.6	-
T48	Lime	B	4.8	Fell
T50	Sycamore	B	7.5	-
T51	Monterey cypress	B	15.0	-
T53	Norway maple	C	5.7	-
T54	Horse chestnut	C	2.1	-
T55	Horse chestnut	B	4.2	-
T56	Lime	B	5.7	-
T58	Lime	B	3.9	-
G59	Laurel, bay	C	6.6	Fell
T60	Lime	B	5.1	-
T63	Horse chestnut	A	15.0	-