

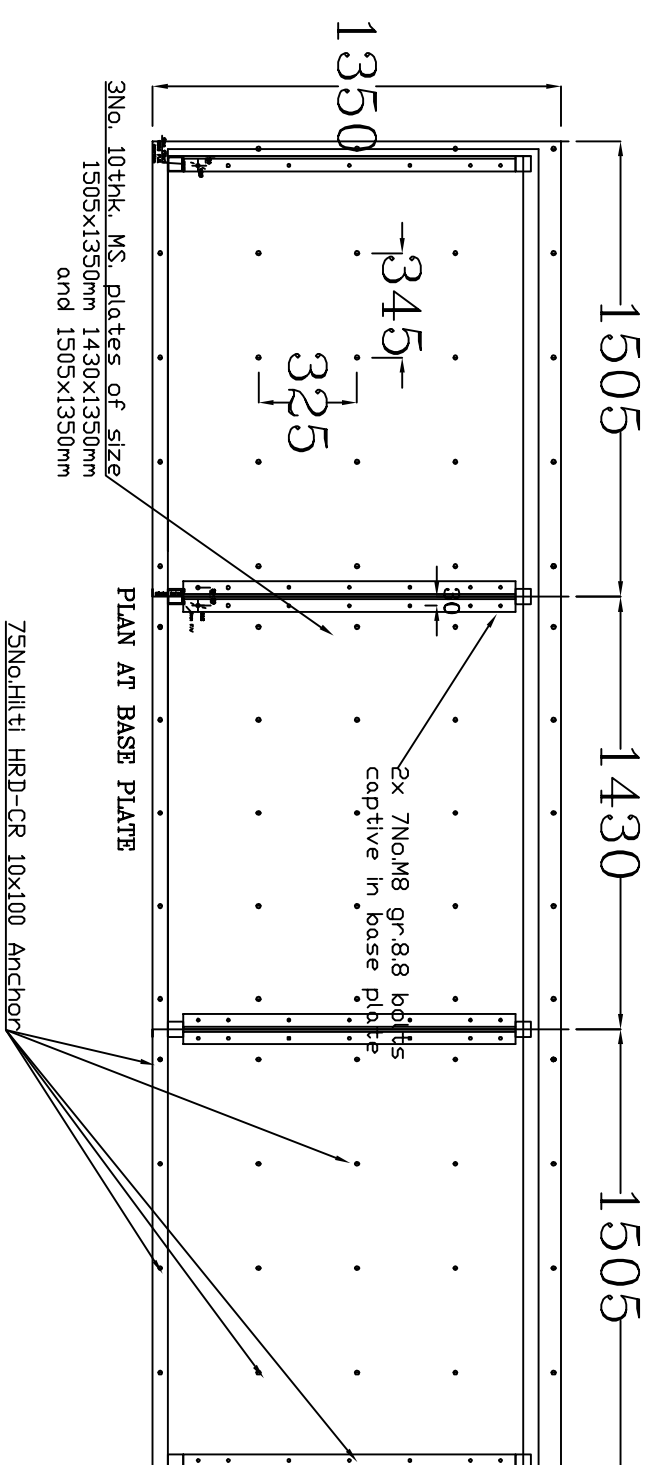
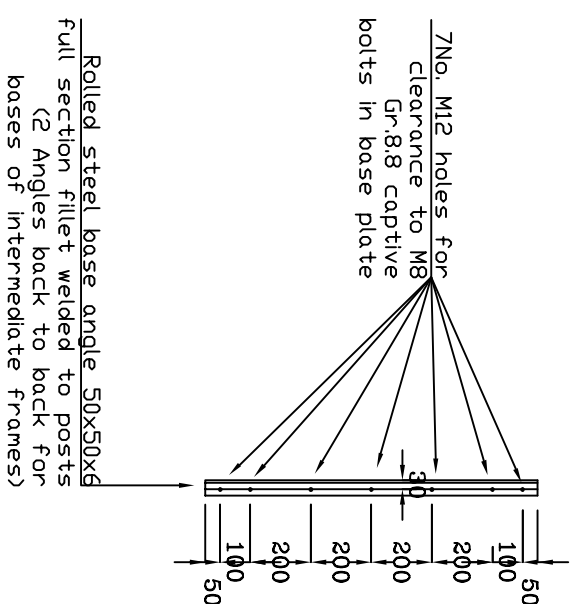


NOTES

- 1) Paving flags to be min. 40mm thick.
- 2) Flags to be re-levelled by client prior to setting of steel plate.
- 3) Steel plates to be either pointed with 2 part paint treatment or galvanised to 85 micron.
- 4) Refer to FJF /BIR/02 for frame bracing details.
- 5) Refer to Hilti website for fixing instructions HRD—CR anchors.

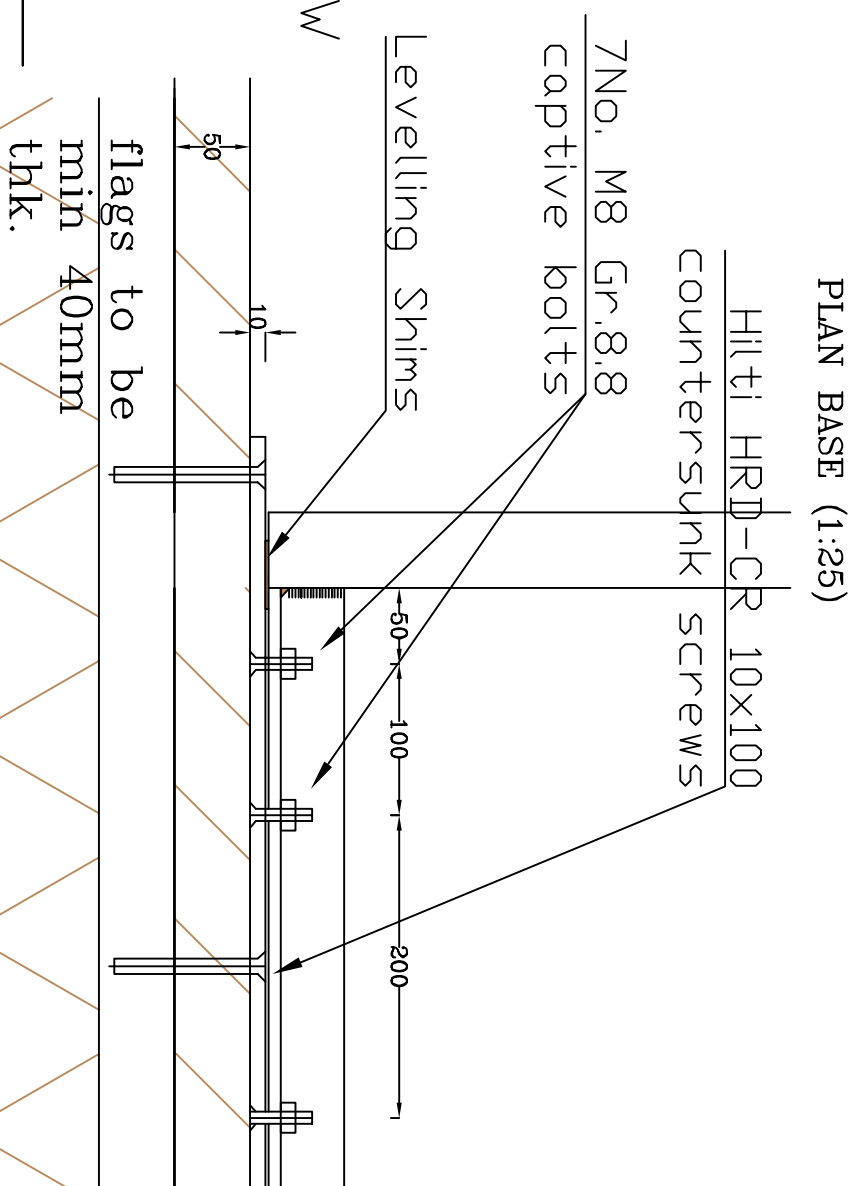

DETAIL—PLAN ROLLED STEEL ANGLE
BASE (1:25)

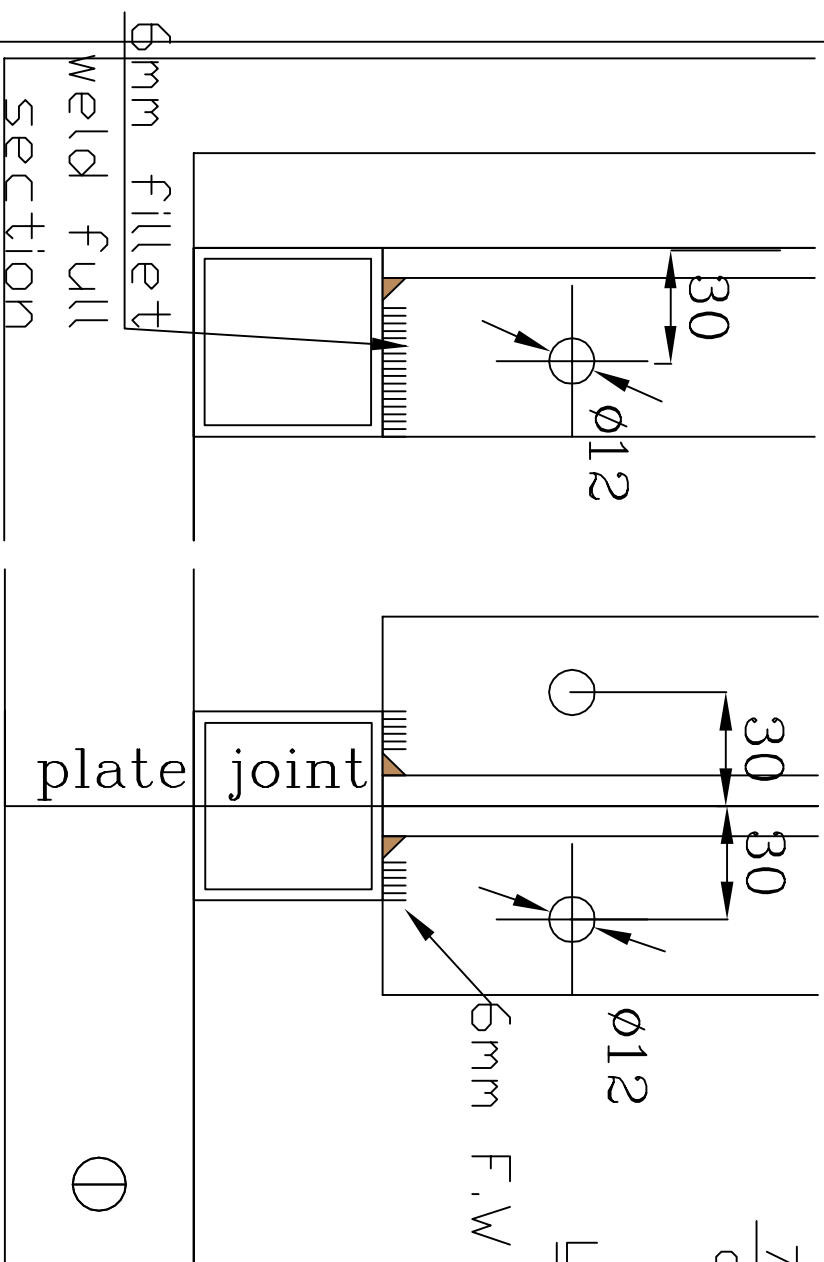

8) Where the flagstones are found to be uneven. Utilise Conbextra HF by Fosroc UK Ltd Tel. 01827-262222. Seal all round the base plate edges with foam rubber strips to prevent grout loss.

PRELIMINARY

F.M.Finnegan Consulting Engineers Ltd...
64 Cortworth Road
Sheffield S11 9LP
tel/fax 0114 2352225
www.fmtconsultingengineers.co.uk
www.fmtconsultingengineers.com

This drawing is copyright. It must not be reproduced either in whole or in part without the written permission of F&M Finegan Consulting Engineers Ltd.
© 2013 F&M Finegan Consulting Engineers Ltd.

PLAN CORNER COLUMN (1:5)

PLAN INTERMEDIATE COLUMN (1:5)

SECTION THROUGH COLUMN BASE (1:10)

Nothing in this document is to be reproduced or stored in a retrieval system without the written permission of F&M Finnegan Consulting Engineers Ltd.

	Client	Birley Manufacturing	Rev. A	Notes added	Drawn	Drg. No. FMM/BIR/03	
	Title	Details of base plate and holding down anchors	Date	9-11-2013			
			Rev. B	base Angles added	Scale	Date	Rev. B
			Date	27-11-2013	1:5 1:10 & 1:25	8-11-2013	