
Key Plan NTS

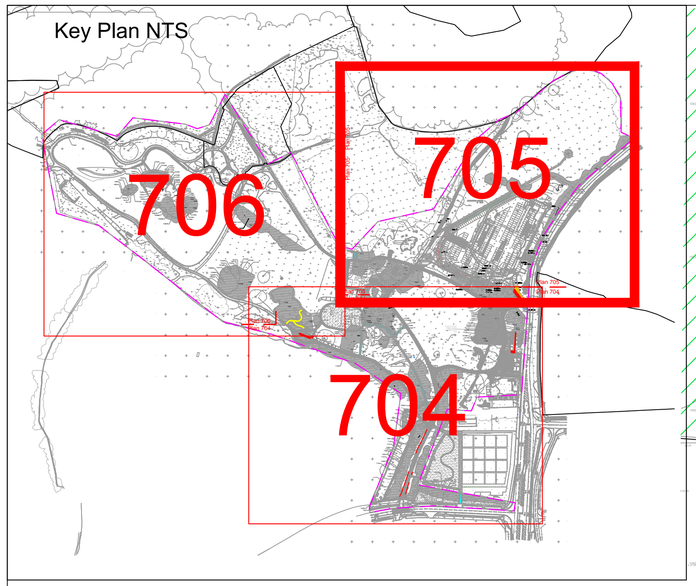

Plan 706
Plan 705

Plan 705
Plan 704

Plan 705
Plan 704

©2016 RPS Group

Notes

1. This drawing has been prepared in accordance with the scope of RPS's appointment with its client and is subject to the terms and conditions of that appointment. RPS accepts no liability for any use of this document other than by its client and only for the purposes for which it was prepared and provided.
2. If received electronically it is the recipients responsibility to print to correct scale. Only written dimensions should be used.
3. Where applicable Ordnance Survey (c) Crown Copyright 2016 All rights reserved. Licence number 0100031673

Key

- Survey boundary.
- T1 — Tree with numbered reference. Canopy spread and BS5837:2012 tree quality category as shown below.
- T1# — Tree (in off-site or estimated location) with numbered reference. Canopy spread and BS5837:2012 tree quality category.
- G1 — Vegetation group with numbered reference. Canopy extents and BS5837:2012 tree quality category as shown below.

BS 5837:2012 Tree Quality Categories - Table 1

- Category A - High quality
- Category B - Moderate quality
- Category C - Low quality
- Category U - Unsuitable for retention

- Area designated as Ancient Woodland
- Root protection area (RPA) Calculated in accordance with Section 4.6 - BS5837:2012
- Tree to be removed with numbered reference. Canopy spread and BS5837:2012 tree quality category.
- Vegetation group or hedge to be removed with numbered reference. Canopy spread and BS5837:2012 tree quality category.
- Dense area of shrub vegetation proposed for selective thinning/ trees proposed for crown reduction/ lifting. See Allen Scott Vegetation Clearance and Restoration Method Statement
- Temporary protective fencing in accordance with Section 6.2 - BS5837:2012. See AMS Appendix 5 (details A & B) for example barrier.
- High Visibility Plastic Mesh Barrier. See AMS Appendix 5 detail C for example barrier.
- Above ground construction requiring "No-dig" design principles in accordance with APN12.
- 'No-dig' bark mulch path, to be installed by hand.
- Existing hard surfaced area to be restored to soft landscape. Breaking out to be completed using hand-held machinery under arboricultural supervision.
- Excavation to be completed by hand and/ or light, pedestrian operated plant not exceeding 2t (see AMS for details) under arboricultural supervision. Any required root pruning to be in accordance with BS 3998.

NOTES:

- Refer to RPS Tree Survey Report & Schedule for further details.
- Survey based on a visual inspection from the ground and is not intended as a full arboricultural inspection.
- Plan produced in accordance with recommendations set out in BS 5837:2012 - 'Trees in Relation to design, demolition and construction'.
- Due to the legal protection afforded to breeding birds vegetation removal should not take place during the bird nesting period; generally, although not restricted to, March - August inclusive.
- Survey based upon topographic survey produced by Sumo Survey services in September, 2016
- Pedestrian/ vehicular emergency access routes to be maintained at all times.
- All protective fencing to be completed and approved by LPA / CA prior to commencement of any site works.
- All works to conform with requirements of:
  - BS 3998:2010 - Tree Works
  - BS 5837:2012 - Trees in relation to design, demolition and construction
  - NJUG 4 - Guidelines for Utility Services in Proximity to Trees
  - APN 12 - 'Through the Trees to Development'

Scale Bar

0m 25m 50m

B	Scheme revised and layout updated	03.2018	JB	DC
A	Minor amends	06.2017	JB	DC
Rev	Description	Date	Initial	Checked

RPS

Lakesbury House, Hiltingbury Road, Chandlers Ford.
Hampshire SO53 5SS
T: 02380 810 440 E: rpsso@rpsgroup.com F: 02380 810 449

Client: Hampshire County Council

Project: Staunton Park, Havant


Title: Tree Protection & Removal Plan Sheet 2 of 3

Status	Drawn By	PM/Checked by
For Planning	JB	DC

Job Ref	Scale @ A1	Date Created
JSL2635	1:500	30/09/2016

Drawing Number	Rev
705	B

rpsgroup.com/uk

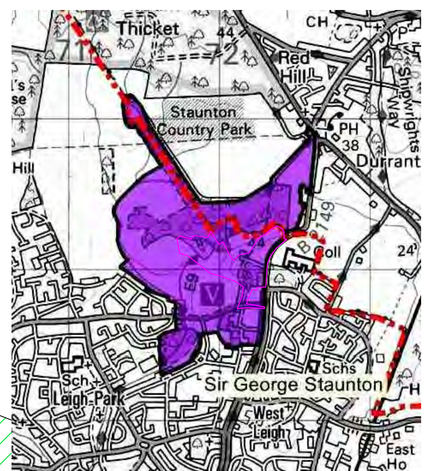

Survey boundary line within Conservation Area Extents. Image taken from Havant Borough Council website.

P:\2600 Series\JSL2635 - Staunton Park\Tech\Acad\Current\Trees\JSL2635_704-706B.dwg