

LEVEL MONITORING

for Subsidence Management Services

Longacre, Emsworth, PO10 7UR

Client:	Subsidence Management Services
Client Contact:	John Morrison
Claim Number:	102318106
Client Reference:	IFS-LBG-SUB-20-0089388
Policy Holder:	Mr Andrew Hunnibal
Report Date:	2 September 2022
Our Ref:	M16551

Level Monitoring Readings

The following table shows the reading levels of the various Level Monitoring Station points.

Date	1	2	3	4	5	6	7	8	9	
15/04/2021	9.9589	9.8615	9.8181	9.4282	10.0000	9.9746	9.9508	9.9483	9.9466	
25/06/2021	9.9589	9.8608	9.8182	9.4294	10.0000	9.9741	9.9501	9.9499	9.9489	
24/08/2021	9.9589	9.8595	9.8148	9.4291	10.0000	9.9748	9.9485	9.9492	9.9478	
18/10/2021	9.9599	9.8554	9.8114	9.4290	10.0000	9.9757	9.9498	9.9505	9.9491	
20/12/2021	9.9602	9.8599	9.8161	9.4288	10.0000	9.9760	9.9499	9.9511	9.9495	
08/02/2022	9.9593	9.8601	9.8161	9.4286	10.0000	9.9763	9.9516	9.9507	9.9497	
01/04/2022	9.9600	9.8608	9.8176	9.4290	10.0000	9.9759	9.9500	9.9511	9.9499	
24/05/2022	9.9598	9.8593	9.8165	9.4292	10.0000	9.9758	9.9504	9.9509	9.9492	
11/07/2022	9.9593	9.8439	9.8051	9.4287	10.0000	9.9755	9.9499	9.9502	9.9488	
31/08/2022	9.9576	9.8283	9.7913	9.4269	10.0000	9.9768	9.9508	9.9509	9.9485	



Level Monitoring Difference Graphs

The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.



Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

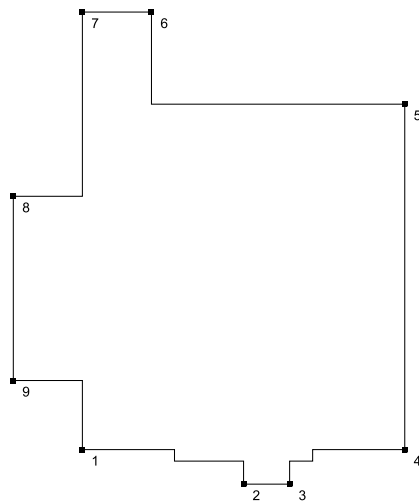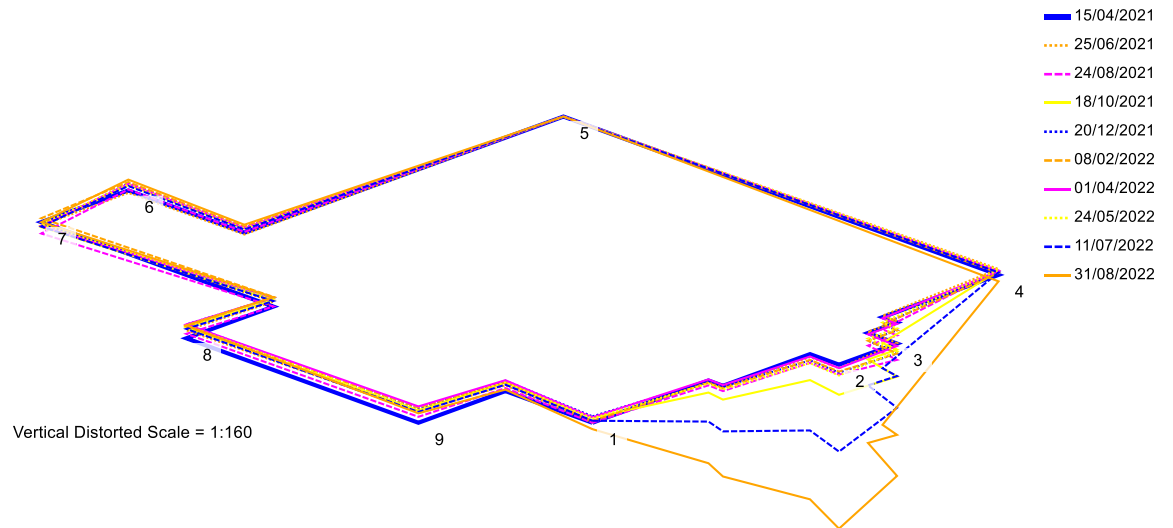

Site Visit Notes

Datum is relative to point 5. It has an assumed value of 10.0000m. There are no remote datums available. If this is not suitable, a deep datum is recommended.

Site Visit: 24 August 2021

Downwards movement on dwarf wall noted and checked.