

Monitoring Details:

Provider Name: CET

Monitoring Interval: Every 6 weeks

Instruction Date: 14/10/2022

Number of Visits: Level - 9, Crack - 8

Reading Date:

Visits Completed: 6

Date of Issue: 18/08/2023

Visits Outstanding: 3

Client Details:

Client: Sedgwick

Engineer / Handler: Patrick Walker

Job Reference: 9637588

Monitored Address:


Occupier:

Address: 49 Park Lane, Cowplain, Waterlooville, Hampshire, PO8 8BB

Telephone:

Email: -

Site Plan

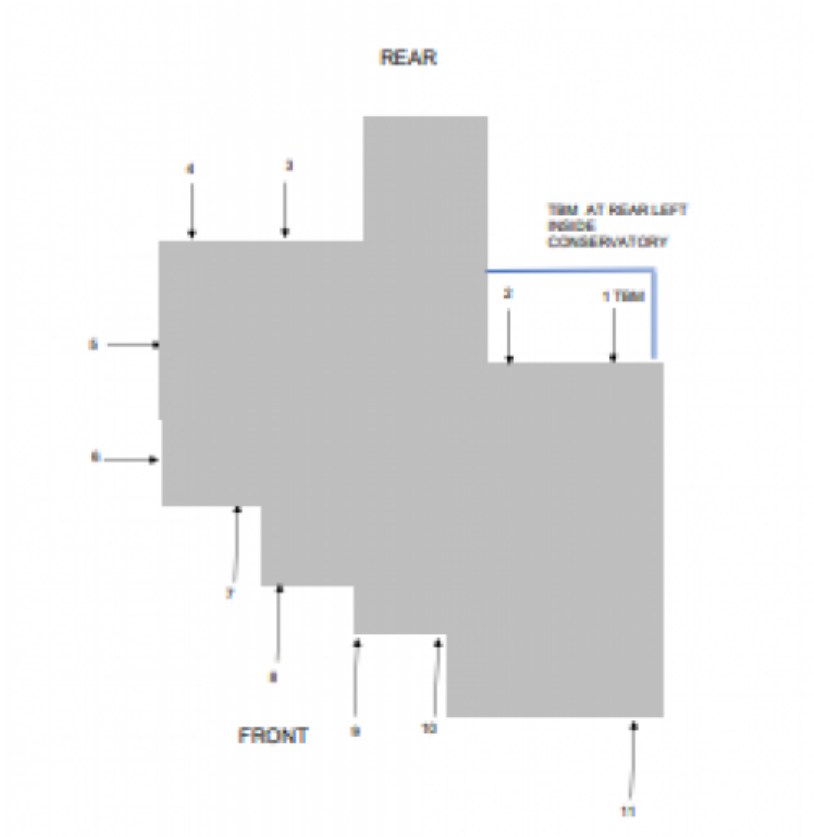

Visit Notes

Visit	Surveyors Note
Visit 1	
Visit 2	
Visit 3	Crack points refitted, as they had been removed
Visit 4	
Visit 5	
Visit 6	
Visit 7	
Visit 8	
Visit 9	
Visit 10	


Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	01/11/22	05/01/23	27/02/23	24/04/23	20/06/23	18/08/23				
1	10.0000	10.0001	10.0000		10.0003					
2	9.9872	9.9873	9.9870	9.9872	9.9872	9.9873				
3	9.8537	9.8534	9.8527	9.8527	9.8526	9.8541				
4	9.9404	9.9407	9.9402	9.9401	9.9406	9.9411				
5	10.0907	10.0913	10.0909	10.0911	10.0913	10.0920				
6	10.0203	10.0203	10.0194	10.0201	10.0198	10.0204				
7	9.8432	9.8526	9.8520	9.8529	9.8511	9.8493				
8	9.8412	9.8511	9.8503	9.8513	9.8489	9.8466				
9	9.6698	9.6818	9.6813	9.6822	9.6794	9.6745				
10	9.8596	9.8682	9.8672	9.8683	9.8654	9.8629				
11	9.6842	9.6875	9.6871	9.6877	9.6863	9.6860				


Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	01/11/22	05/01/23	27/02/23	24/04/23	20/06/23	18/08/23				
1	0	+0.1	0		+0.3					
2	0	+0.1	-0.2	0	0	+0.1				
3	0	-0.3	-1	-1	-1.1	+0.4				
4	0	+0.3	-0.2	-0.3	+0.2	+0.7				
5	0	+0.6	+0.2	+0.4	+0.6	+1.3				
6	0	0	-0.9	-0.2	-0.5	+0.1				
7	0	+9.4	+8.8	+9.7	+7.9	+6.1				
8	0	+9.9	+9.1	+10.1	+7.7	+5.4				
9	0	+12	+11.5	+12.4	+9.6	+4.7				
10	0	+8.6	+7.6	+8.7	+5.8	+3.3				
11	0	+3.3	+2.9	+3.5	+2.1	+1.8				

Level Readings Chart (Points 1 - 8)

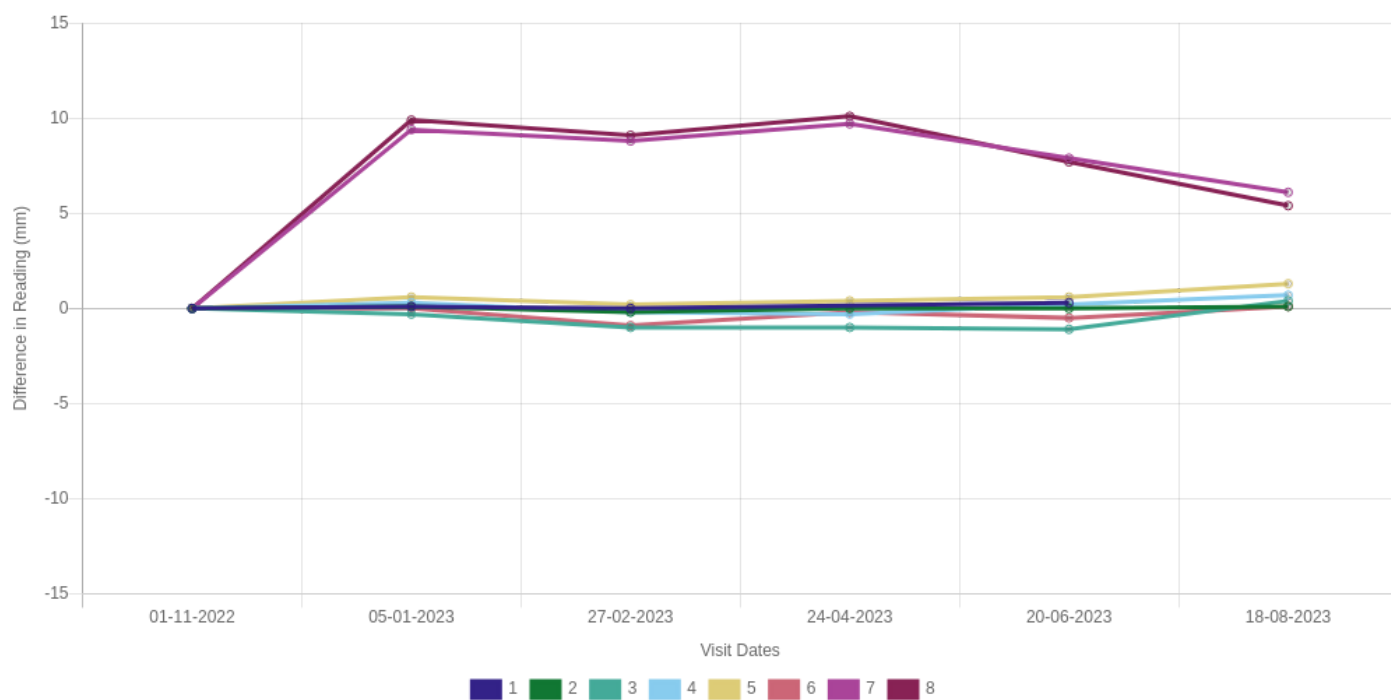

Level Readings Chart (Points 9 - 11)

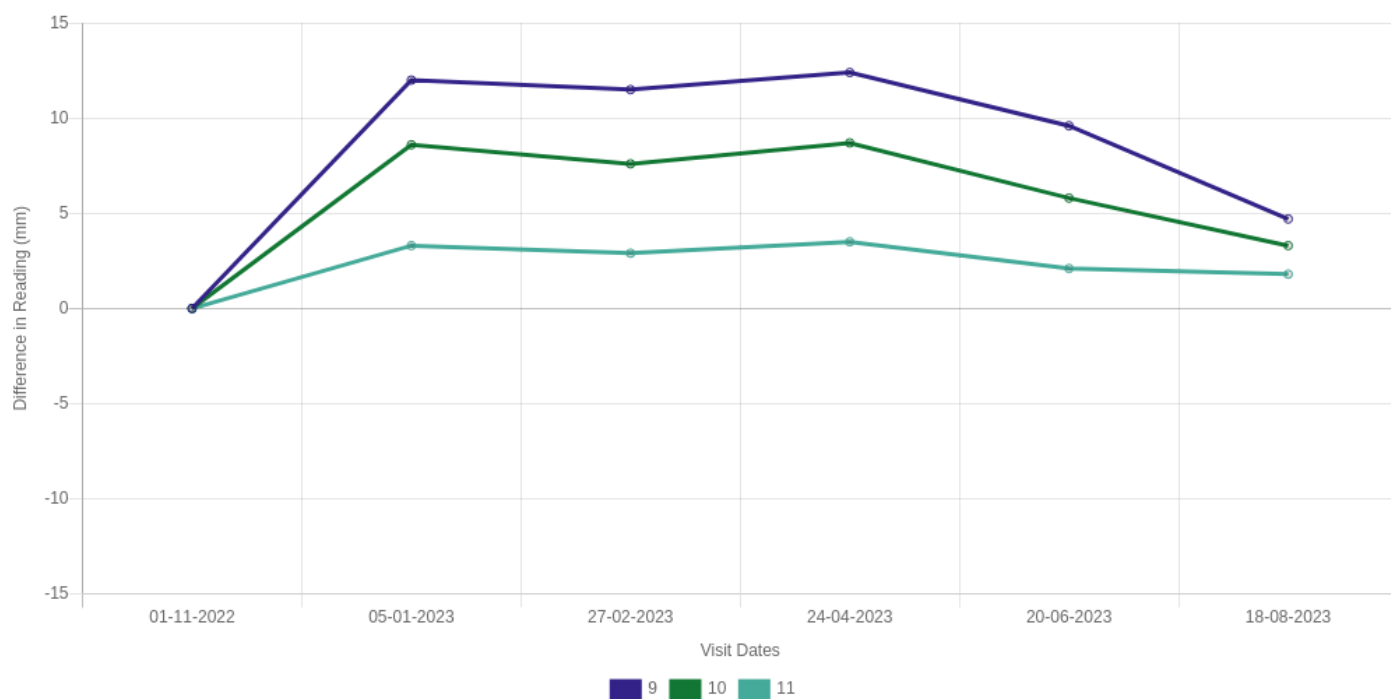


Crack Monitoring

Internal LANDING Left Hand Side LOW

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	27/02/23	24/04/23	20/06/23	18/08/23						
H	51.32	51.24	51.29	51.24						

Internal LANDING Left Hand Side LOW - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	27/02/23	24/04/23	20/06/23	18/08/23						
H	0	-0.08	-0.03	-0.08						

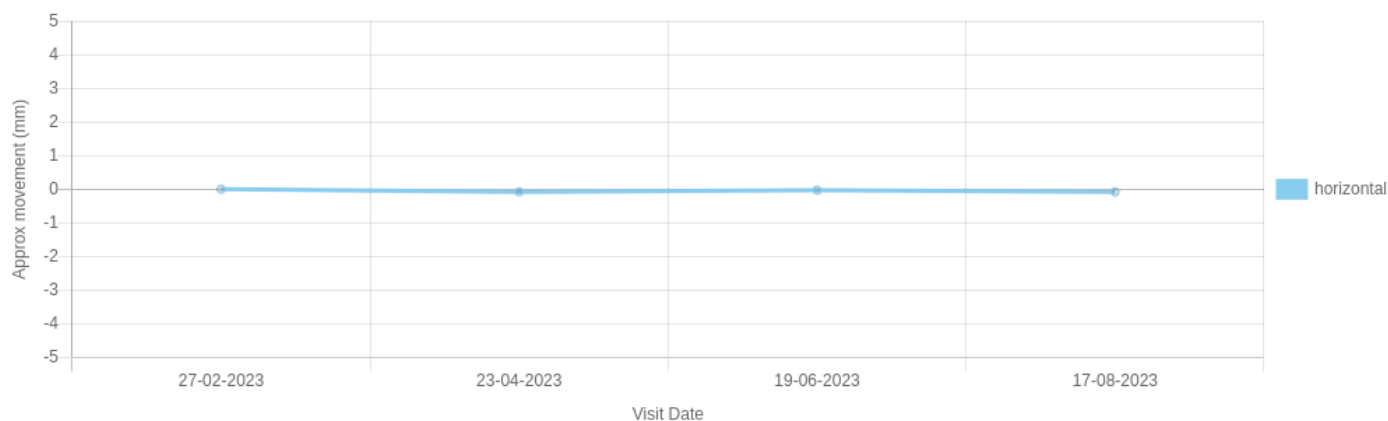


Crack Monitoring

Internal LANDING Light Hand Side HIGH

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	27/02/23	24/04/23	20/06/23	18/08/23						
H	79.6	79.45	79.14	78.95						
D	90.9	90.79	90.41	90.3						
C	77.6	77.77	75.69	75.68						

Internal LANDING Light Hand Side HIGH - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	27/02/23	24/04/23	20/06/23	18/08/23						
H	0	-0.15	-0.46	-0.65						
D	0	-0.11	-0.49	-0.6						
C	0	0.17	-1.91	-1.92						

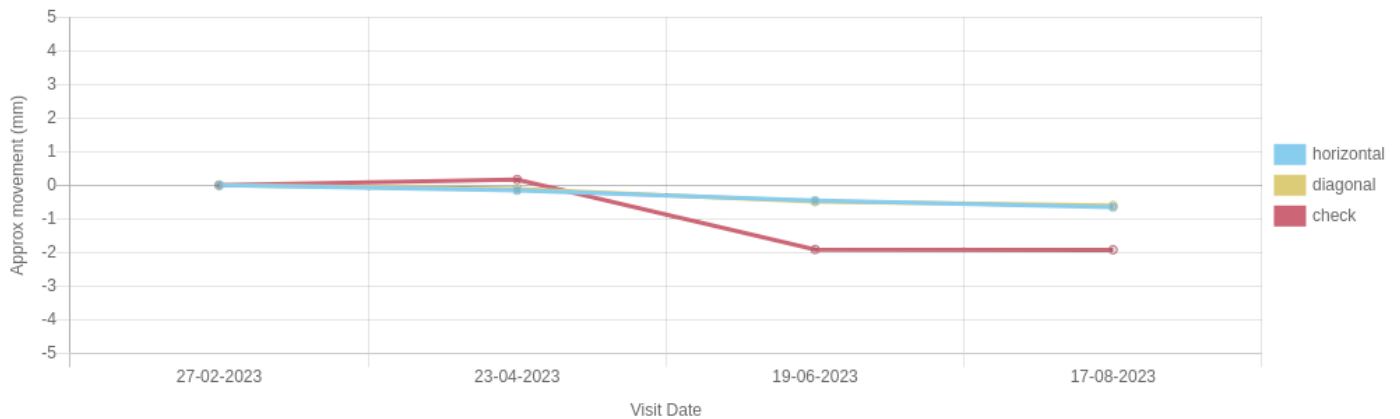


Crack Monitoring

Internal LANDING Right Hand Side LOW

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	27/02/23	24/04/23	20/06/23	18/08/23						
H	81.76	81.6	81.5	81.43						

Internal LANDING Right Hand Side LOW - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	27/02/23	24/04/23	20/06/23	18/08/23						
H	0	-0.16	-0.26	-0.33						

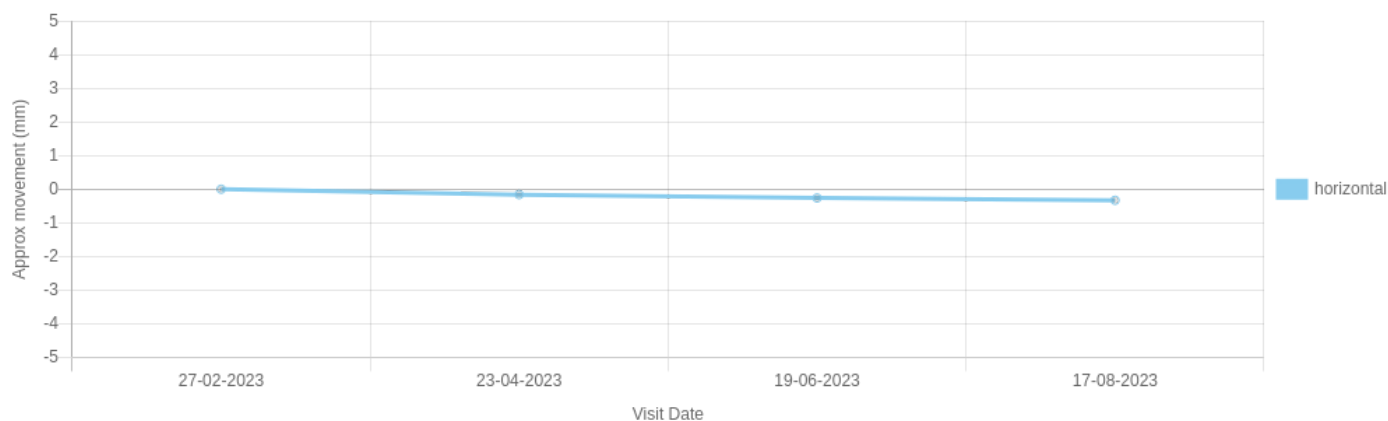

Crack Monitoring

Internal LANDING Right Hand Side HIGH (LJ)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	27/02/23	24/04/23	20/06/23	18/08/23						
V	54.72	54.92	54.96	54.78						

Internal LANDING Right Hand Side HIGH (LJ) - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	27/02/23	24/04/23	20/06/23	18/08/23						
V	0	0.2	0.24	0.06						

