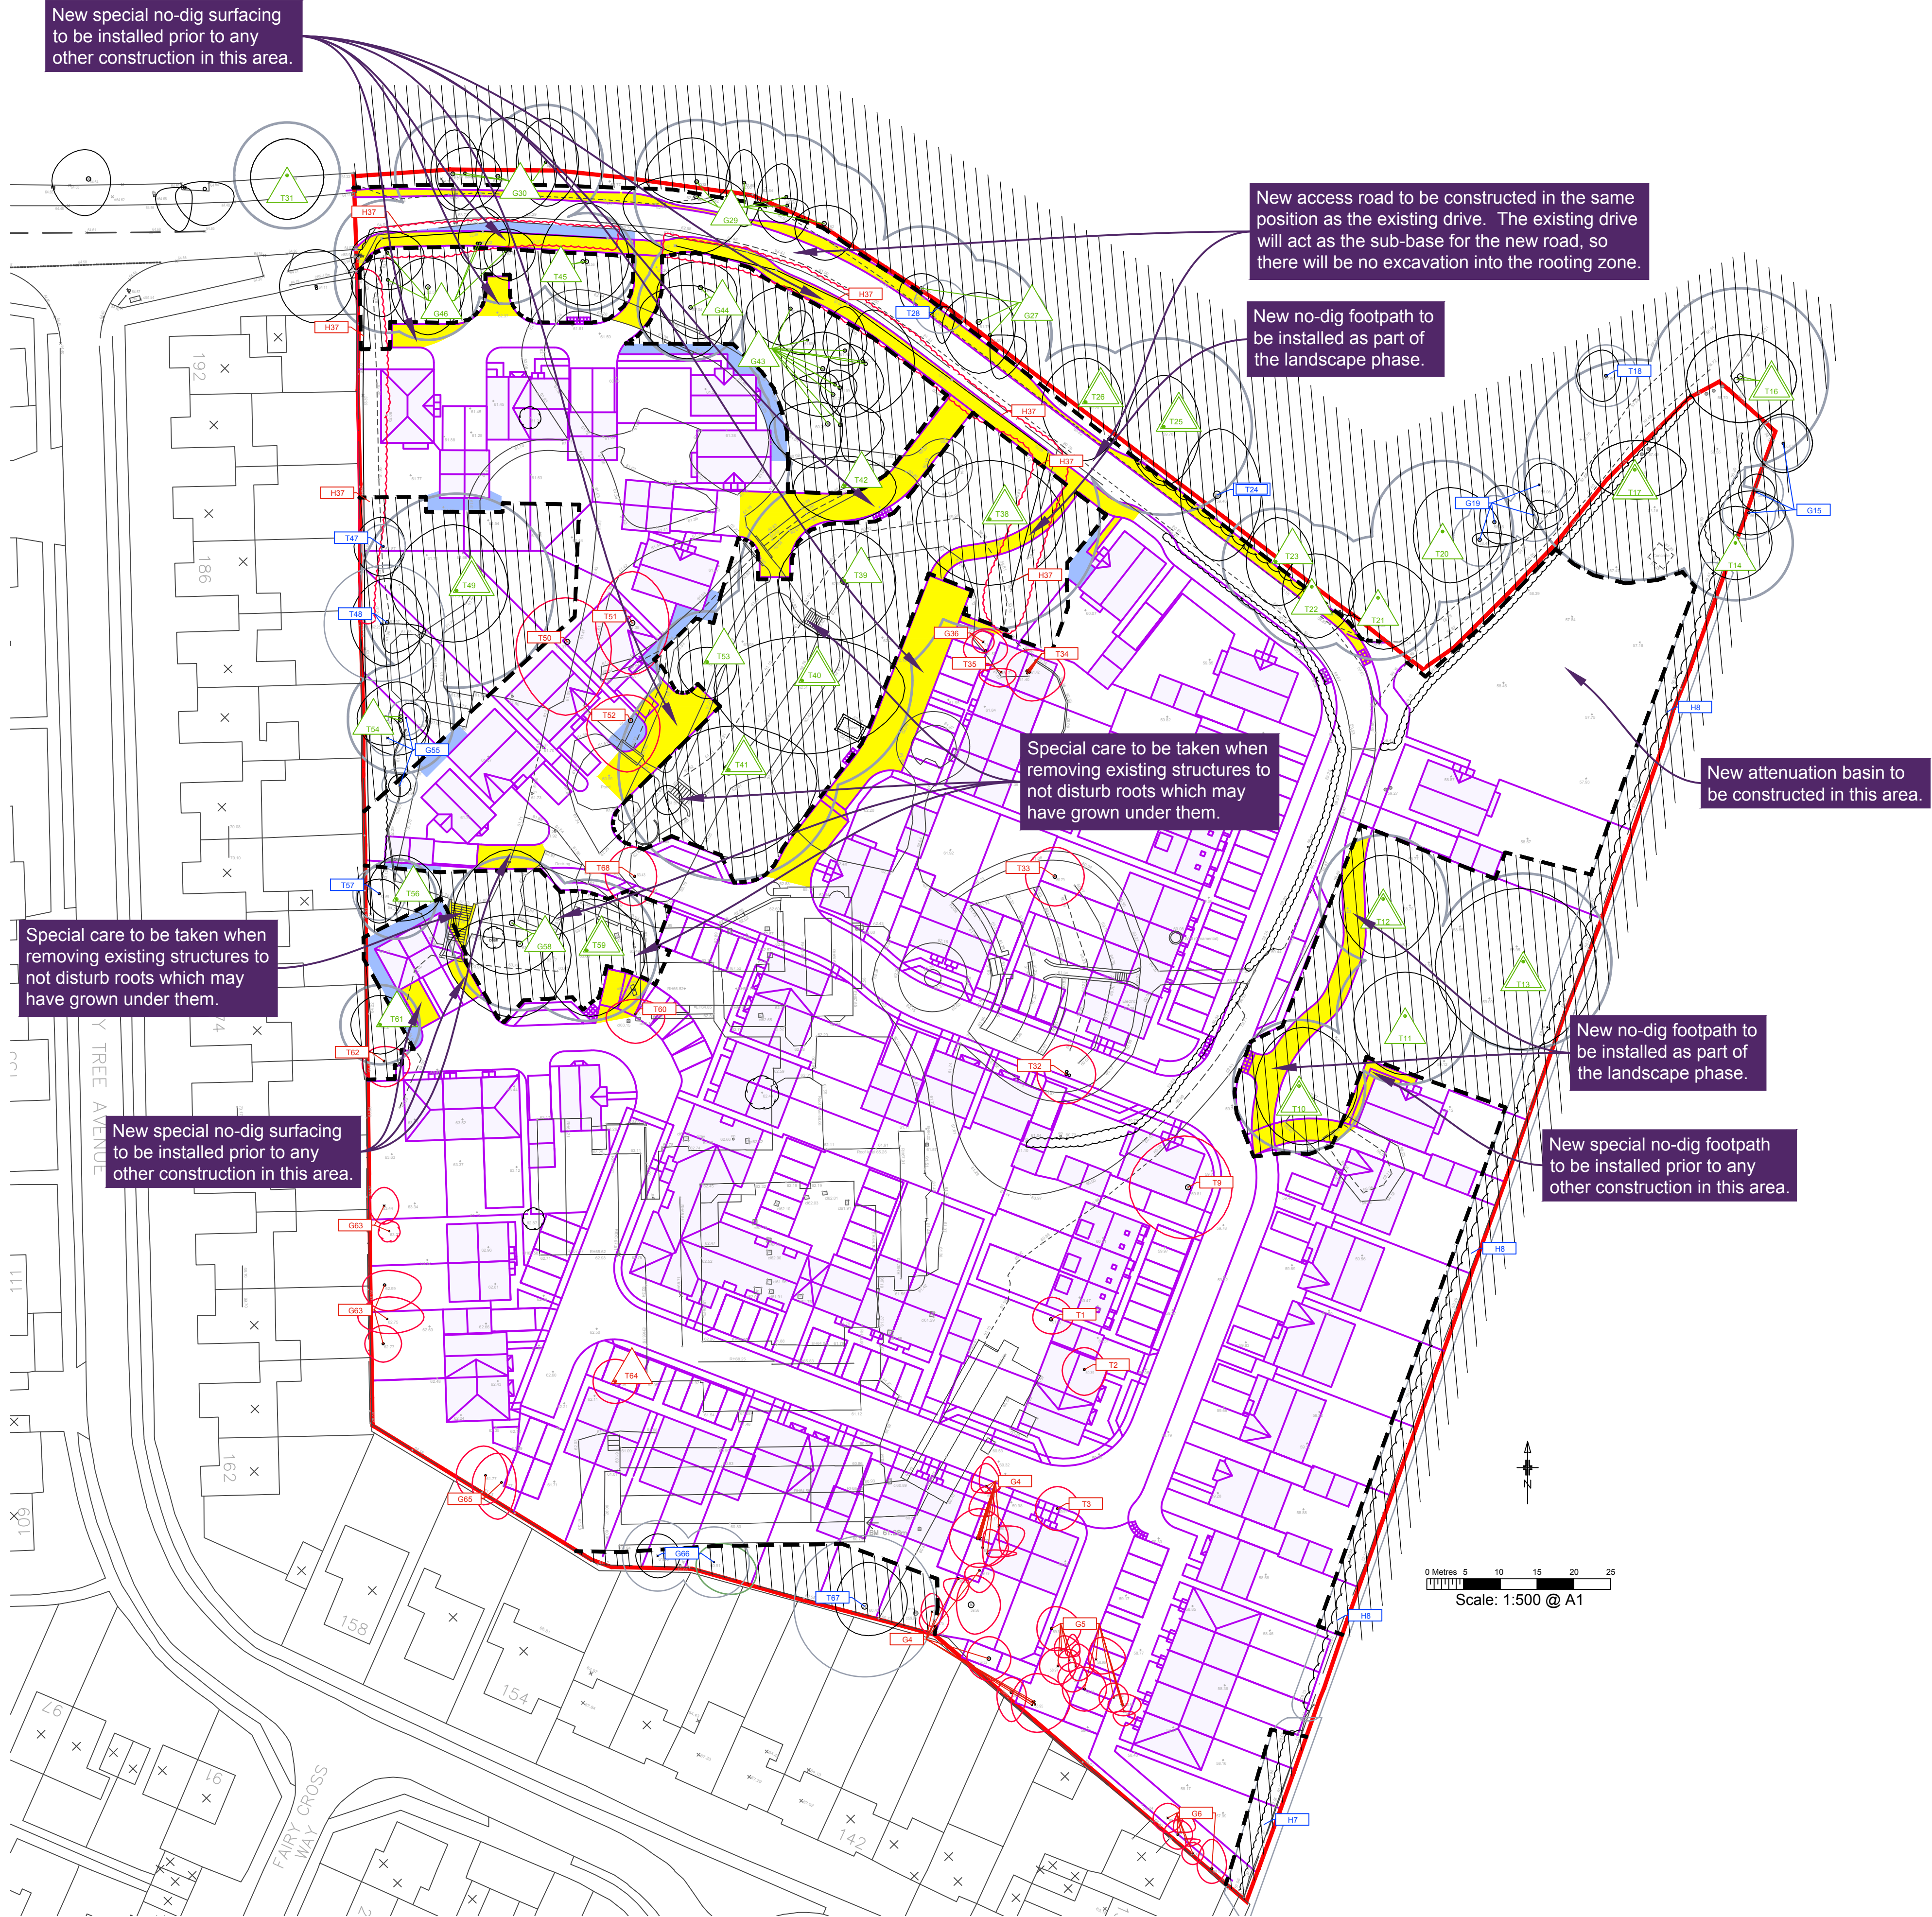


Tree schedule				
Tree No	Species	Category	RPA Radius	Tree Works
All retained trees & hedges				Carry out safety check and lift over site to 3-4m as necessary.
T1	Juniper	C	5.4	Fell
T2	Crab apple	C	3.0	Fell
T3	Hawthorn	C	2.4	Fell
G4	Blackthorn, elder	C	6.0	Fell
G5	Blackthorn, cherry, hawthorn	C	3.0	Fell
G6	Hawthorn	C	4.8	Fell
H7	Leyland cypress	C	3.6	-
H8	Hawthorn	C	3.0	-
T9	Oak	C	10.2	Fell
T10	Oak	A	9.0	-
T11	Oak	B	9.3	-
T12	Oak	A	8.7	-
T13	Oak	A	12.0	-
T14	Oak	B	7.8	-
G15	Oak	C	3.6	-
T16	Oak	A	12.0	-
T17	Oak	A	15.0	-
T18	Oak	C	4.2	-
G19	Oak, birch	C	3.6	-
T20	Oak	B	9.6	-
T21	Oak	B	8.4	-
T22	Oak	B	8.4	-
T23	Oak	B	7.2	-
T24	Oak	U	12.0	-
T25	Oak	A	12.0	-
T26	Oak	A	7.8	-
G27	Oak	B	8.4	-
T28	Oak	C	3.6	-
G29	Oak	B	8.4	-
G30	Oak, yew	B	7.8	-
T31	Turkey oak	B	7.2	-
T32	Monterey cypress	C	9.6	Fell
T33	Monterey cypress	C	7.8	Fell
T34	Holly	C	8.4	Fell
T35	Oak	C	2.4	Fell
G36	Holly, laurel	C	8.4	Fell
H37	Leyland cypress	C	5.4	Fell
T38	Oak	A	15.0	-
T39	Oak	B	14.4	-
T40	Oak	A	15.0	-
T41	Oak	A	15.0	-
T42	Oak	B	7.8	-
G43	Oak	B	7.2	-
G44	Oak	B	6.0	-
T45	Oak	B	6.6	-
G46	Oak	B	7.2	-
T47	Oak	C	3.0	-
T48	Willow	C	7.8	-
T49	Oak	A	13.2	-
T50	Oak	C	10.2	Fell
T51	Oak	C	10.2	Fell
T52	Oak	C	7.2	Fell
T53	Oak	B	6.9	-
T54	Oak	B	7.2	-
G55	Cherry, juniper, pittosporum	C	2.4	-
T56	Oak	B	5.4	-
T57	Hawthorn	C	3.6	-
G58	Oak	B	9.0	-
T59	Oak	A	9.6	-
T60	Birch	C	3.0	Fell
T61	Norway maple	B	5.4	-
T62	Willow	C	4.2	Fell
G63	Whitebeam, blackthorn, hawthorn, elder	C	4.2	Fell
T64	Oak	B	4.2	Fell
G65	Cherry, thorn	C	4.2	Fell
G66	Cherry	C	4.8	-
T67	Oak	C	9.6	-
T68	Cherry	C	3.6	Fell



Tree protection plan
Location of trees, categorisation and development constraints at Padnell Grange, Padnell Road, Cowplain, Waterlooville

Barrell Plan Ref: 17165-BT3

Provided Plan Refs: 14002 - Padnell Grange Survey rev B.dwg & BELL170217 SL.01 Rev P8




Permission is granted to scale from this drawing for Local Authority Planning Approval purposes relating to tree protection measures only. Where applicable this drawing is to be read in conjunction with the arboricultural report. This drawing is the copyright of Barrell Tree Consultancy 2019. ©
This drawing to be reproduced in colour only.
www.barrelltreecare.co.uk

 BS category A


 BS category B


 BS category C

 BS category U

 Trees to be removed

 Proposed layout

 Estimated tree positions not included on original land survey and/or adjusted crown spreads

 Protective barrier/fencing

 Construction exclusion zone (CEZ)

 Precautionary Areas

 Construction exclusion zone protected by ground protection

 Root protection area (RPA) boundaries for category A and B trees

 Root protection area (RPA) boundaries for category C trees

Trees of high quality

Trees of moderate quality

Trees of low quality

Trees unsuitable for retention