


Plan 706
Plan 705



Survey boundary line within Conservation Area Extents. Image taken from Havant Borough Council website.

B	Scheme revised and layout updated	03.2018	JB	DC
A	Minor amendments	06.2017	JB	DC
Rev	Description	Date	Initial	Checked

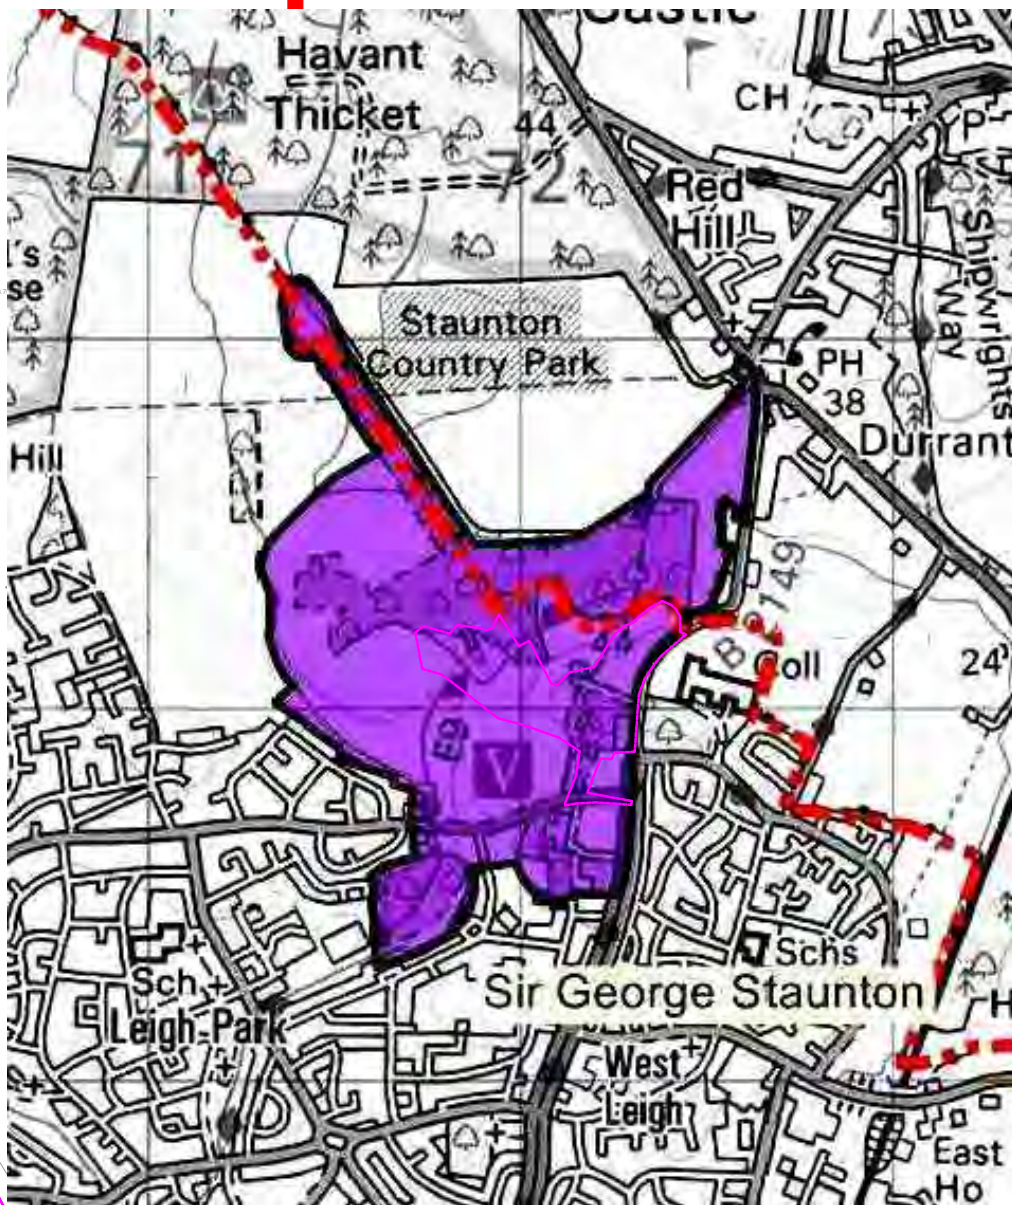

Lakesbury House, Hiltbury Road, Chandlers Ford,
Hampshire SO53 5SS
T: 02380 810 440 E: rpsso@rpsgroup.com F: 02380 810 449

Client Hampshire County Council

Project Staunton Park,
Havant

Title Tree Protection & Removal Plan
Sheet 3 of 3

Status Drawn By PM/Checked by
For Planning JB DC

Job Ref Scale @ A1 Date Created
JSL2635 1:500 30/09/2016

Drawing Number Rev
706 B

rpsgroup.com/uk



Key

- Survey boundary.
- Tree with numbered reference. Canopy spread and BS5837:2012 tree quality category as shown below.
- Tree (in off-site or estimated location) with numbered reference. Canopy spread and BS5837:2012 tree quality category.
- Vegetation group with numbered reference. Canopy extents and BS5837:2012 tree quality category as shown below.
- BS 5837:2012 Tree Quality Categories - Table 1
- Category A - High quality
- Category B - Moderate quality
- Category C - Low quality
- Category U - Unsuitable for retention
- Area designated as Ancient Woodland
- Root protection area (RPA) Calculated in accordance with Section 4.6 - BS5837:2012
- Tree to be removed with numbered reference. Canopy spread and BS5837:2012 tree quality category.
- Dense area of shrub vegetation proposed for selective thinning/ trees proposed for crown reduction/ lifting. See Allen Scott Vegetation Clearance and Restoration Method Statement
- Temporary protective fencing in accordance with Section 6.2 - BS5837:2012. See AMS Appendix 5 (details A & B) for example barrier.
- High Visibility Plastic Mesh Barrier. See AMS Appendix 5 detail C for example barrier.
- Above ground construction requiring 'No-dig' design principles in accordance with APN12
- 'No-dig' bark mulch path, to be installed by hand.
- Existing hard surfaced area to be restored to soft landscape. Breaking out to be completed using hand-held machinery under arboricultural supervision.
- Excavation to be completed by hand and/ or light, pedestrian operated plant not exceeding 2t (see AMS for details) under arboricultural supervision. Any required root pruning to be in accordance with BS 3998.

NOTES:

- Refer to RPS Tree Survey Report & Schedule for further details.
- Survey based on a visual inspection from the ground and is not intended as a full arboricultural inspection.
- Plan produced in accordance with recommendations set out in BS 5837:2012 - 'Trees in Relation to design, demolition and construction'.
- Due to the legal protection afforded to breeding birds vegetation removal should not take place during the bird nesting period, generally, although not restricted to, March - August inclusive.
- Survey based upon topographic survey produced by Sumo Survey services in September, 2016
- Pedestrian/ vehicular emergency access routes to be maintained at all times.
- All protective fencing to be completed and approved by LPA / CA prior to commencement of any site works.
- All works to conform with requirements of:
BS 3998:2010 - Tree Works
BS 5837:2012 - Trees in relation to design, demolition and construction
Guidelines for Utility Services in Proximity to Trees
APN 12 - 'Through the Trees to Development'

Key Plan NTS

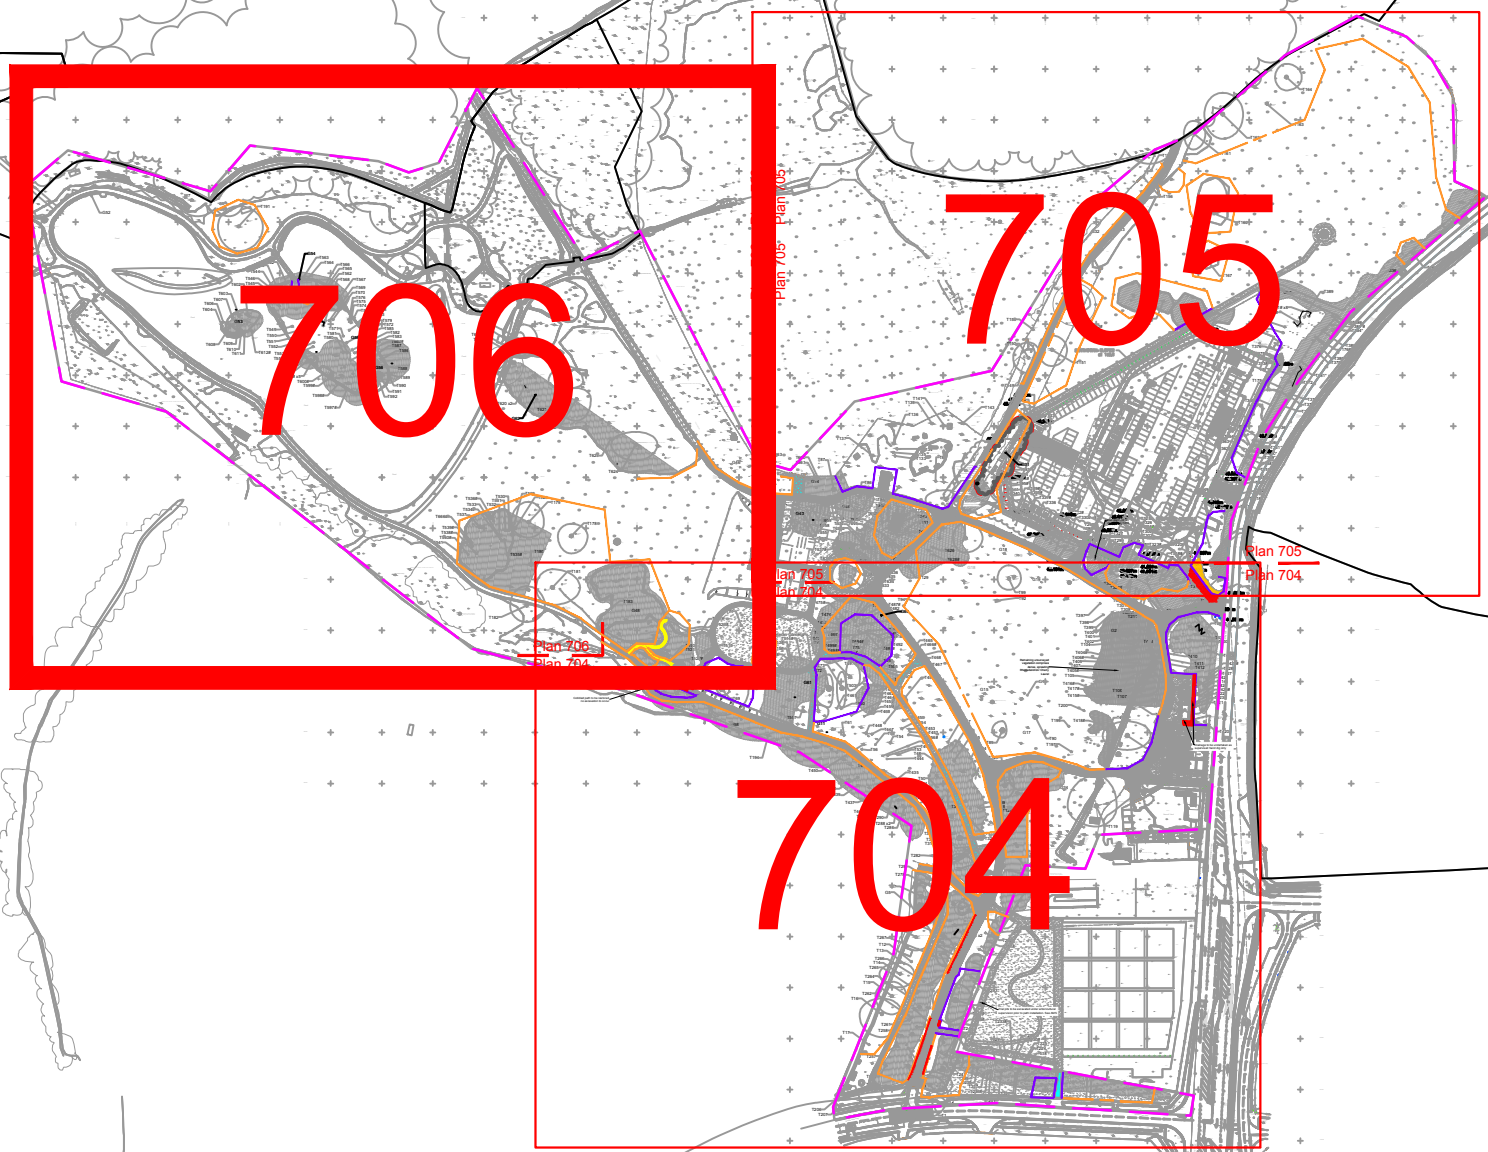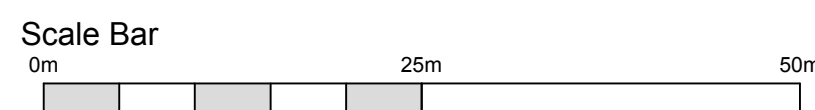

Plan 706
Plan 704