


Tree schedule				
Tree No	Species	Category	RPA Radius	Tree Works
All retained trees				Carry out safety check and lift over site to 3-4m as necessary.
T1	Oak	B	6.0	-
T2	Oak	B	6.6	-
T3	Poplar	C	8.4	-
G4	Cypress, thorn	C	3.0	-
T5	Oak	C	4.2	-
T6	Oak	C	5.0	-
T7	Poplar	C	8.4	Fell
T8	Oak	C	8.4	Crown reduce and reshape by up to 3m
T9	Oak	C	6.6	-
T10	Field maple	C	6.0	-
T11	Ash	C	8.0	-
T12	Field maple	U	1.8	Fell
T13	Ash	C	8.5	-
T14	Oak	C	7.0	-
T15	Oak	C	5.4	-
T16	Oak	B	14.0	-
T17	Oak	A	14.0	-
T18	Oak	U	4.8	Fell
T19	Oak	A	15.0	-
T20	Oak	C	9.0	-
T21	Oak	A	10.8	-
T22	Oak	C	4.2	-
G23	Thorn, field maple	C	3.0	-
T24	Oak	A	15.0	-
T25	Oak	C	3.6	-
T26	Oak	B	9.6	-
T27	Monterey pine	A	7.8	-
T28	Monterey pine	A	11.4	-
T29	Monterey pine	B	6.0	-
T30	Ash	C	2.2	-
T31	Plum	C	4.5	Fell
T32	Plum	C	3.6	Fell
T33	Norway spruce	U	3.4	Fell

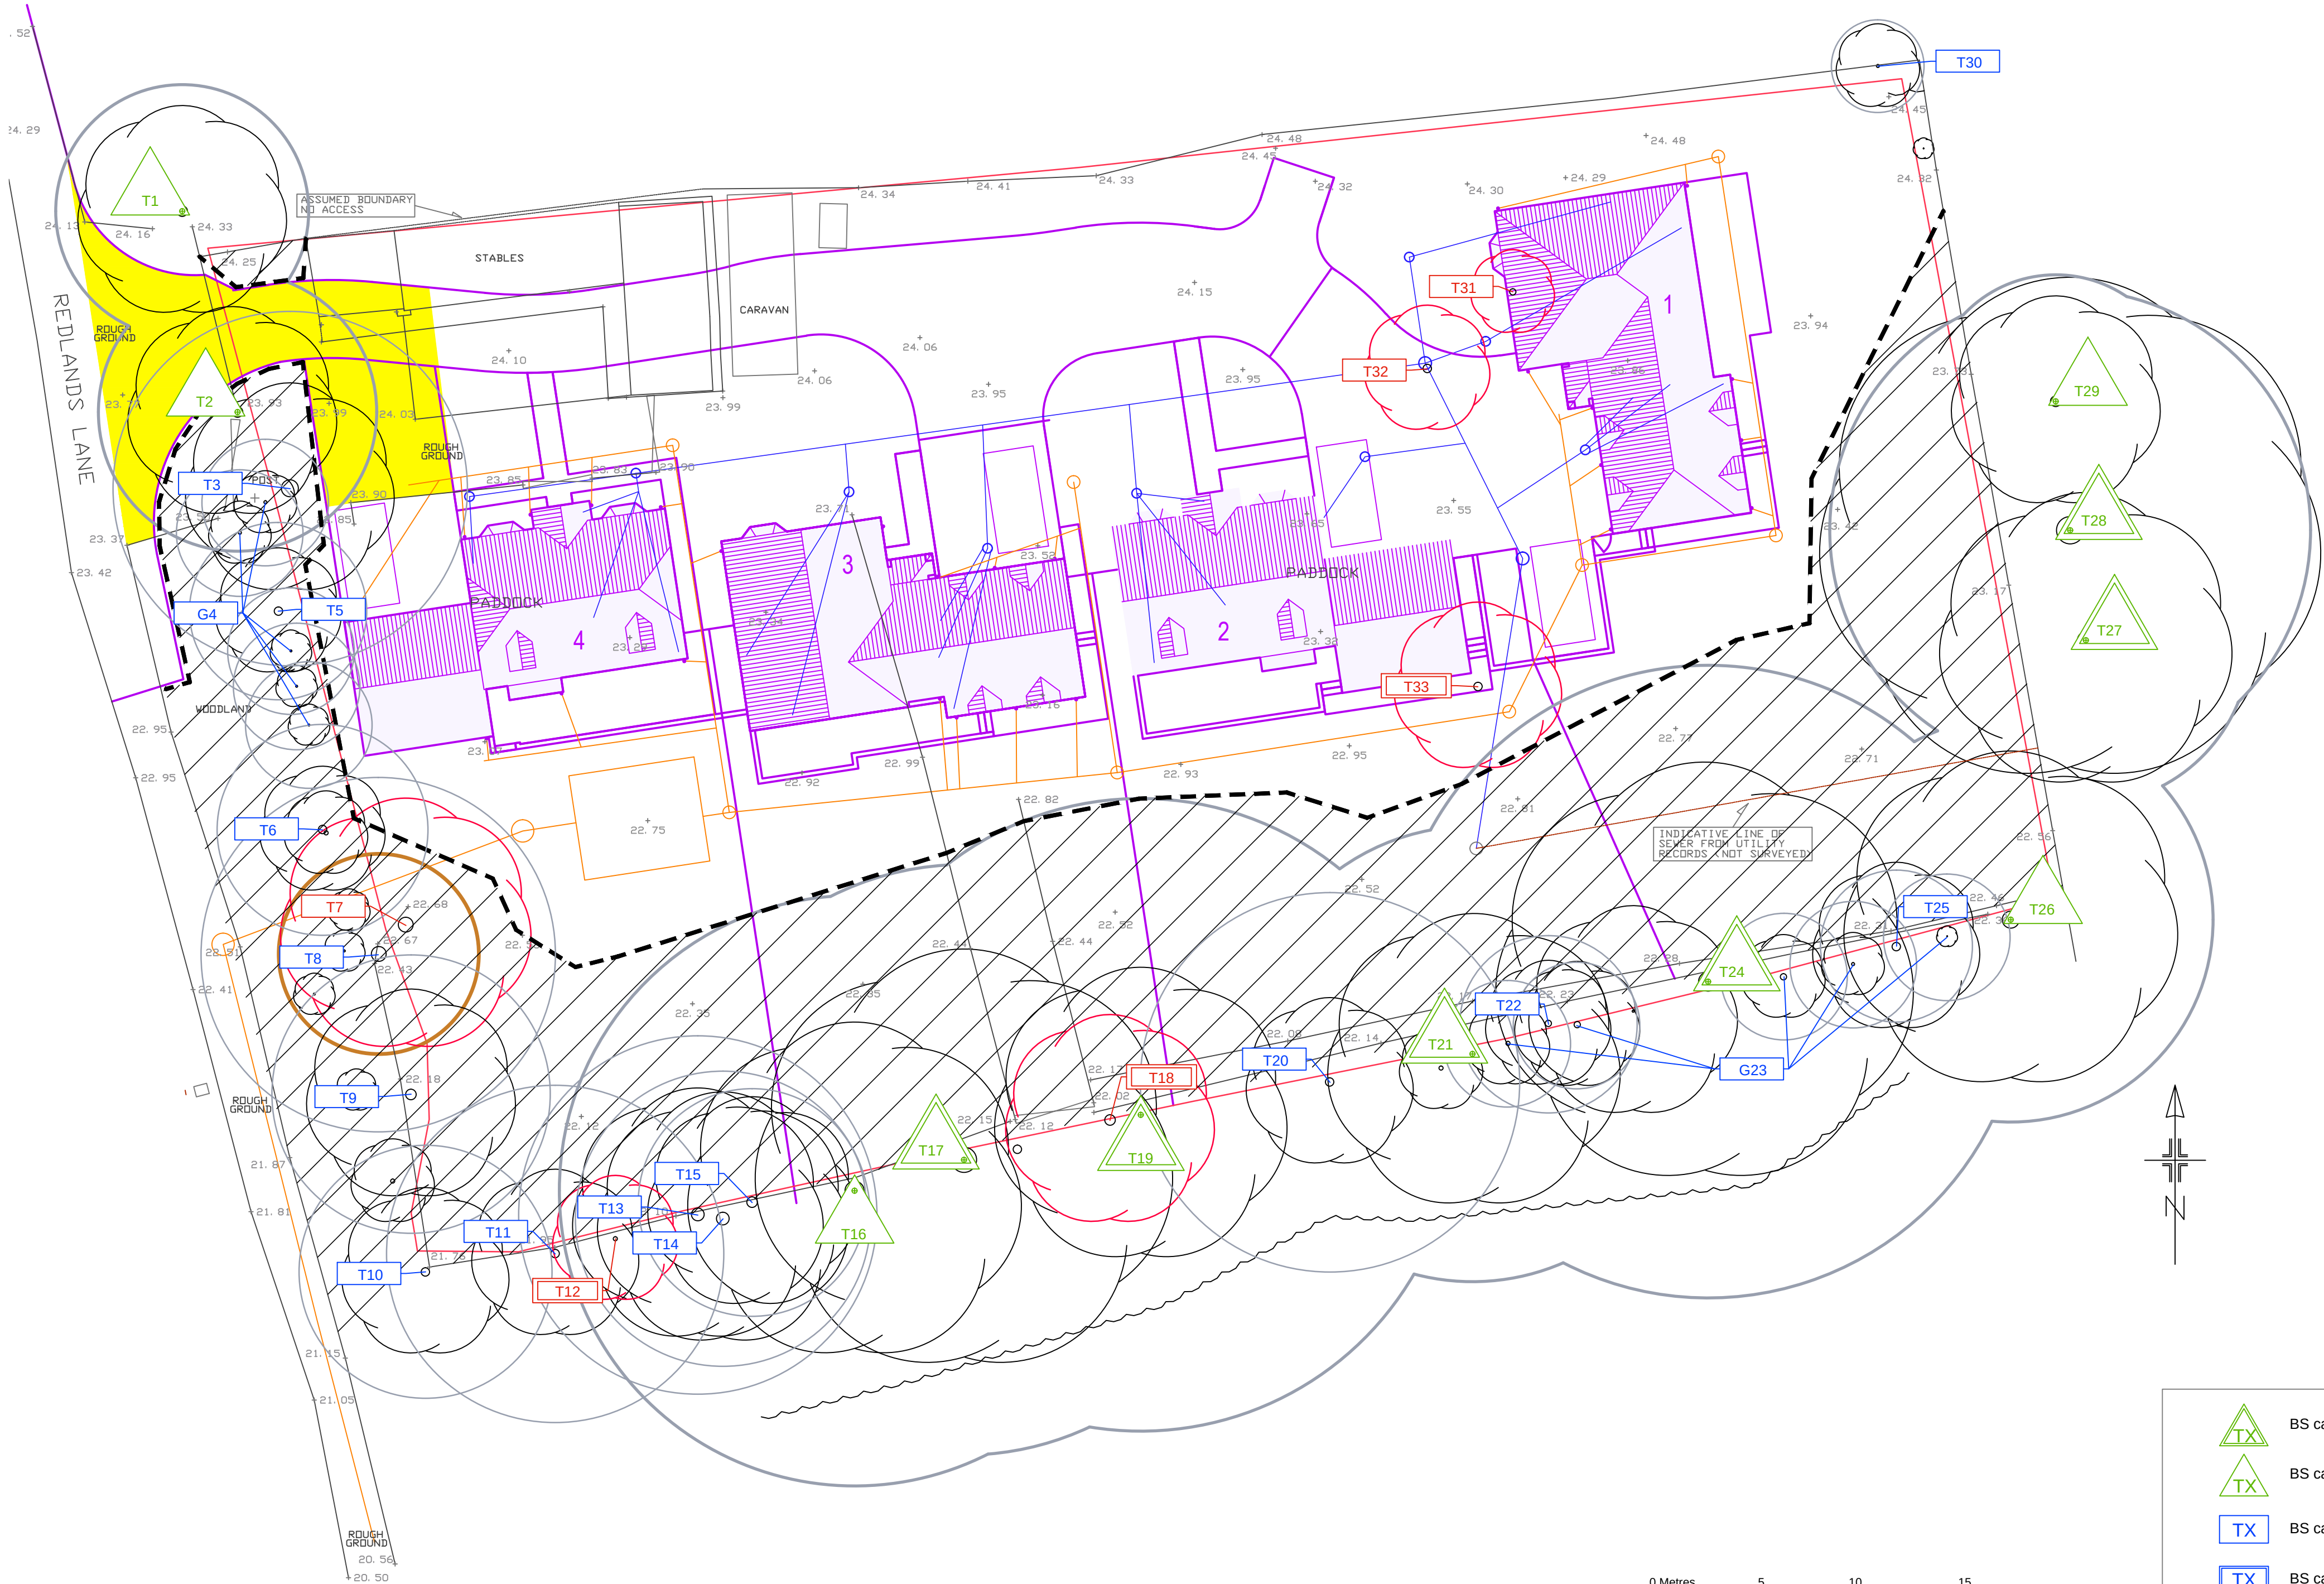

Tree protection plan
Location of trees, categorisation and protection/management proposals for land off Redlands Lane, Westbourne

Permission is granted to scale from this drawing for Local Authority Planning Approval purposes relating to tree protection measures only. Where applicable this drawing is to be read in conjunction with the arboricultural report. This drawing is the copyright of Barrell Tree Consultancy 2017. ©

This drawing to be reproduced in colour only.

Barrell Plan Ref: 16348-BT1

Provided Plan Refs: 04112_TOPO & SK 02b

barrell
TREE CONSULTANCY

Field House, Fordingbridge Business Park,
Ashford Road, Fordingbridge SP6 1BY
Tel: 01425 651470
Fax: 01425 653449
www.barrelltreecare.co.uk

- BS category A
- BS category B
- BS category C
- BS category U
- Trees to be removed
- Proposed layout
- Proposed foul and storm drainage layout
- Protective barrier/fencing
- Construction exclusion zone (CEZ)
- Precautionary Areas
- Proposed pruning line
- Root protection area (RPA) boundaries for category A and B trees
- Root protection area (RPA) boundaries for category C trees
- BS category A
- Trees of high quality
- BS category B
- Trees of moderate quality
- BS category C
- Trees of low quality
- BS category U
- Trees unsuitable for retention