

LEVEL MONITORING

for Subsidence Management Services

24 Ramblers Way, Waterlooovile, PO7 8RE

Client:	Subsidence Management Services
Client Contact:	Philippa Mann
Claim Number:	13WCI002010
Client Reference:	IFS-AVI-ROF-13-0044713
Policy Holder:	Mrs C Gradison
Report Date:	22 January 2016
Our Ref:	M2205



Level Monitoring Readings

The following table shows the reading levels of the various Level Monitoring Station points.

Date	1	2	3	4	5	6	7	8	9	10
16/04/2014	10.0572	10.0263	10.0303	10.0152	10.0078	10.0173	10.0308	9.9964	9.9645	10.0000
11/06/2014	10.0579	10.0280	10.0323	10.0178	10.0089	10.0182	10.0318	9.9974	9.9666	10.0000
13/08/2014	10.0584	10.0237	10.0209	10.0039	10.0008	10.0192	10.0324	9.9994	9.9564	10.0000
20/01/2015	10.0583	10.0265	10.0279	10.0114	10.0046	10.0200	10.0330	9.9995	9.9607	10.0000
18/03/2015	10.0577	10.0276	10.0305	10.0143	10.0065	10.0194	10.0328	9.9987	9.9639	10.0000
06/07/2015	10.0585	10.0287	10.0312	10.0151	10.0063	10.0198	10.0333	9.9982	9.9577	10.0000
02/09/2015	10.0587	10.0275	10.0243	10.0078	9.9953	10.0187	10.0332	9.9994	9.9546	10.0000
23/11/2015	10.0591	10.0275	10.0285	10.0128	10.0020	10.0200	10.0333	9.9999	9.9567	10.0000
19/01/2016	10.0597	10.0306	10.0347	10.0192	10.0074	10.0200	10.0333	9.9993	9.9631	10.0000



Level Monitoring Difference Graphs

The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.

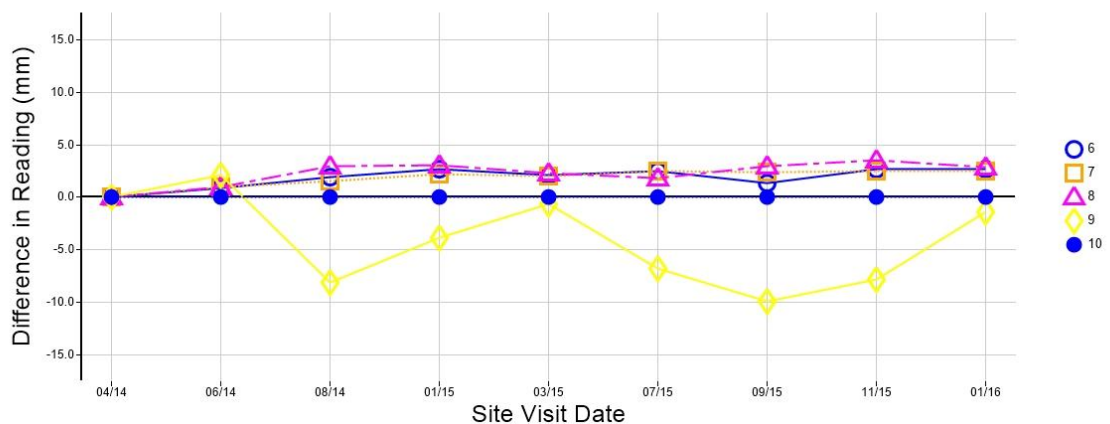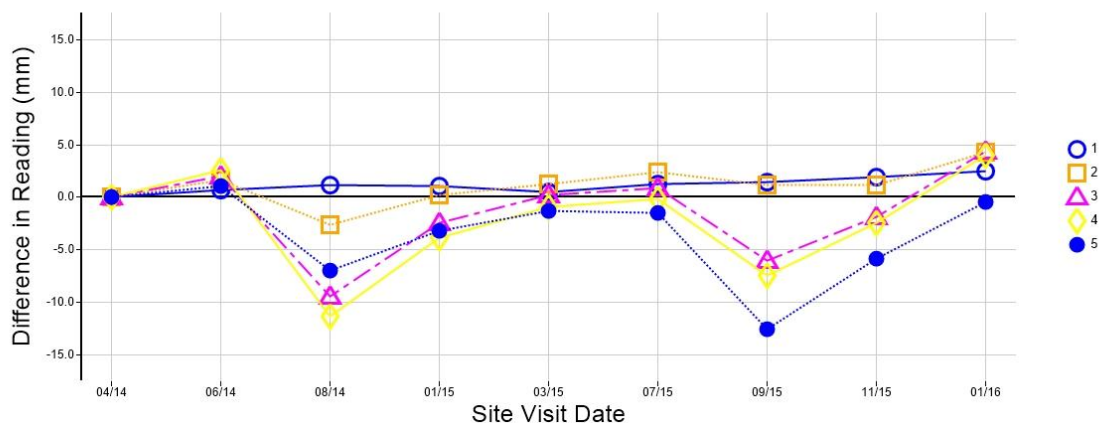

Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

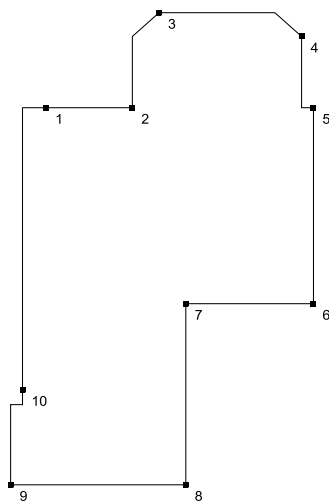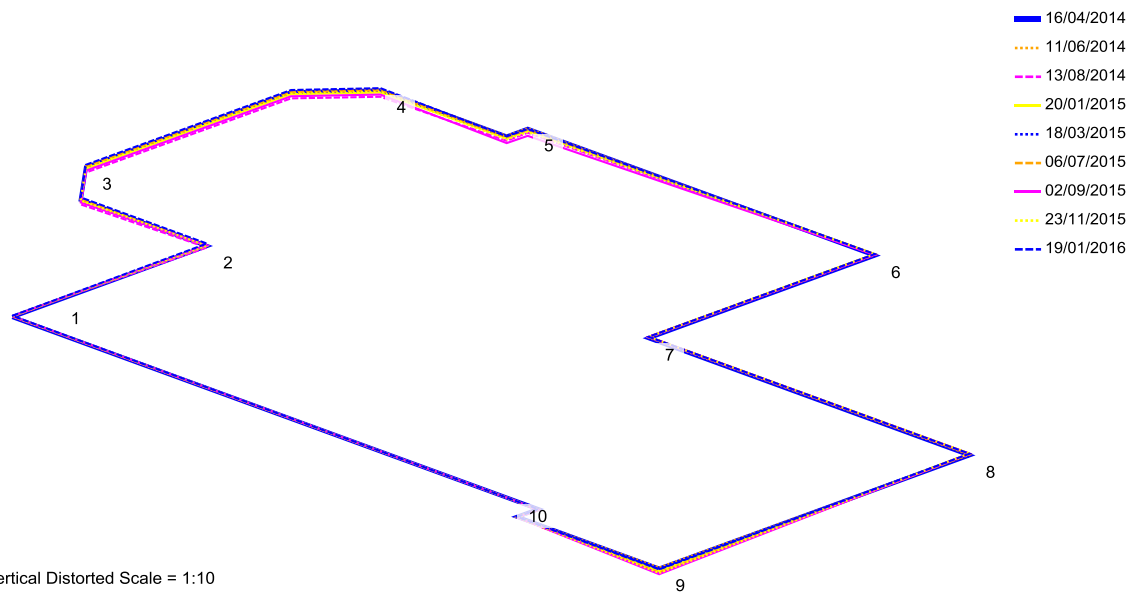

Site Visit Notes

Readings have been made relative to level station 10, it has an assumed value of 10.0000m. Suggested station 1 is next to a large tree. Please advise if this needs to be changed.